

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORTIndia International Insurance Pte Ltd
64 Cecil Street, #04-00 IOB Building
Singapore 049711**Our File No:** CS/III22006783/KVY3E2**Date:** 20/06/2023**REFERENCE**

Insured/Claimant: COMFORTDELGRO RENT-A-CAR PTE LTD Policy No: D20MFL0000326-02

Date of Loss: 12/07/2022

Nature of Claim: OD

Claim No: MFL2022D0003656

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SMN3811D**
 Make & Model: NISSAN QASHQAI, 1.2 DIG-T CVT (A) Engine No: HRA2688161A
 Reg. Date: 05/08/2019 (Man. Year: 2018) Chassis No: SJNFEAJ11U2385868
 Colour: Metallic Blue Odometer: 24023 km
 Engine Capacity: 1197 cc
 Market Value/New Car Price: S\$92,000.00
 Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
 Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 215/60 R17 Rear Tyre Size: 215/60 R17
 Front Left Side: Bridgestone 8 mm Rear Left Side: Bridgestone 8 mm
 Front Right Side: Bridgestone 8 mm Rear Right Side: Bridgestone 8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts (after Betterment)	23,861.37	22,604.70	1,256.67	5.27
Miscellaneous Items	11.00	11.00	0.00	0.00
Labour	4,190.00	2,630.00	1,560.00	37.23
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	28,062.37	25,245.70	2,816.67	10.04
- Excess (S\$)	0.00	750.00	-750.00	
(S\$)	28,062.37	24,495.70	3,566.67	12.71
+ GST 7.00/8.00% (S\$)	1,964.37	1,959.66	4.71	0.24
Nett Amount (S\$)	30,026.74	26,455.36	3,571.38	11.89

INSPECTION

Date of Assignment: 18/07/2022 Present Location: ComfortDelGro Engineering Pte Ltd (Braddell)
 Date Inspected: 18/07/2022 Inspected At: ComfortDelGro Engineering Pte Ltd (Braddell)
 205 Braddell Road
 Singapore 579701
 Estimated Period of Repair: 10.0 days

Adjuster: KENNETH KONG**Manager:** VERON CHEN*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 13 Jun 2023)
Parts:	M1-SUV	NISSAN QASHQAI 1.2 DIG-T CVT (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SMN3811D)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRT BUMPER	Buckled	737.00 F (10/0.00)%	*737.00 F (10/0.00)%
2	1		*FRT BUMPER RETAINER RH	Serviceable	26.00 F (10/0.00)%	*- F
3	1		*FRT BUMPER RETAINER LH	Distorted	26.00 F (10/0.00)%	*26.00 F (10/0.00)%
4	10		*FRT BUMPER CLIP	Necessary	50.00 F (10/0.00)%	*50.00 F (10/0.00)%
5	1		*FRT BUMPER COVER LH	Cut	120.00 F (10/0.00)%	*120.00 F (10/0.00)%
6	1		*FOG LAMP LH	No such part	278.00 F (10/0.00)%	*- F
7	1		*FRT NUMBER PLATE CASING	Serviceable	45.00 FS	*- FS
8	1		*FRT LH FENDER	Bent	739.00 F (10/0.00)%	*739.00 F (10/0.00)%
9	1		*FRT LH FENDER INNER SHIELD	Cracked	139.00 F (10/0.00)%	*139.00 F (10/0.00)%
10	8		*FRT LH FENDER INNER SHIELD CLIP	Necessary	40.00 F (10/0.00)%	*40.00 F (10/0.00)%
11	1		*FRT LH FENDER ARCH GARNISH	Bent	584.00 F (10/0.00)%	*584.00 F (10/0.00)%
12	1		*FRT LH TOP COVER	Serviceable	70.00 F (10/0.00)%	*- F
13	1		*LH HEADLAMP	Cracked	3,496.00 F (10/0.00)%	*3,496.00 F (10/0.00)%
14	1		*FRT LH RIM	Dented	1,333.00 F (10/0.00)%	*1,333.00 F (10/0.00)%
15	1		*FRT LH RIM CENTER NISSAN CAB	Missing	36.00 F (10/0.00)%	*36.00 F (10/0.00)%
16	1		*FRT LH TYRE (80%) (SN)	Cut	250.00 FS	*200.00 FS
17	1		*FRT LH DOOR	Bent	1,259.00 F (10/0.00)%	*1,259.00 F (10/0.00)%
18	1		*FRT LH DOOR OUTER LOWER GARNISH	Bent	370.00 F (10/0.00)%	*370.00 F (10/0.00)%
19	1		*FRT LH DOOR HINGE TOP	Repair	55.00 F (10/0.00)%	*- F
20	1		*FRT LH DOOR HINGE LOWER	Repair	55.00 F (10/0.00)%	*- F
21	1		*FRT LH DOOR WEATHER STRIP	Serviceable	165.00 F (10/0.00)%	*- F
22	1		*FRT LH DOOR FRAME WEATHER BLACK STICKER	Necessary	35.00 F (10/0.00)%	*35.00 F (10/0.00)%
23	1		*FRT LH DOOR FRAME TOP BLACK STICKER	Necessary	45.00 F (10/0.00)%	*45.00 F (10/0.00)%
24	1		*FRT LH DOOR TOP OUTER SUN VISOR	Serviceable	400.00 FS	*- FS
25	1		*FRT LH KUNCKLE ARM	Bent	602.00 F (10/0.00)%	*602.00 F (10/0.00)%
26	1		*FRT LH LOWER ARM	Bent	269.00 F (10/0.00)%	*269.00 F (10/0.00)%

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
27	1		*FRT LH WHEEL HUB WITH BEARING	Bent	310.00 F (10/0.00)%	*310.00 F (10/0.00)%
28	1		*FRT LH SHOCK ABSORBER TOP MOUNTING	Bent	112.00 F (10/0.00)%	*112.00 F (10/0.00)%
29	1		*FRT LH STEERING TIE ROD	Serviceable	200.00 F (10/0.00)%	*- F
30	1		*FRT LH STEERING TIE ROD END	Bent	129.00 F (10/0.00)%	*129.00 F (10/0.00)%
31	1		*LH FRT SEAT AIRBAG	Burst	1,399.00 F (10/0.00)%	*1,399.00 F (10/0.00)%
32	1		*LH FRT SEAT BACKREST CUSHION COVER	Torn	2,124.00 F (10/0.00)%	*2,124.00 F (10/0.00)%
33	1		*LH FRT SEAT BACKREST CUSHION	Torn	1,066.00 F (10/0.00)%	*1,066.00 F (10/0.00)%
34	1		*LH ROOF TOP AIRBAG	Burst	1,867.00 F (10/0.00)%	*1,867.00 F (10/0.00)%
35	1		*ROOF TOP LINING COVER	Deformed	1,426.00 F (10/0.00)%	*1,426.00 F (10/0.00)%
36	1		*AIRBAG CONTROL UNIT	Necessary	1,560.00 F (10/0.00)%	*1,560.00 F (10/0.00)%
37	1		*FRT LH SEAT AIRBAG SENSOR	Necessary	450.00 F (10/0.00)%	*450.00 F (10/0.00)%
Supplementary #1						
38	1		*FRT LH ABSORBER	Bent	607.00 F (10/0.00)%	*607.00 F (10/0.00)%
39	1		*FRT LH STABILIZER LINK	Not Necessary	40.00 F (10/0.00)%	*- F
40	1		*FRT STEERING RACK	Bent / Jammed	1,590.00 F (10/0.00)%	*1,590.00 F (10/0.00)%
41	1		*FRT ENGINE UNDERCOVER	Cracked	334.00 F (10/0.00)%	*334.00 F (10/0.00)%
42	1		*REAR LH SEAT HANDLE COVER	Cracked	6.00 F (10/0.00)%	*6.00 F (10/0.00)%
Supplementary #3						
43	1		*FRONT RH ENGINE MOUNTING	Cracked	427.00 F (10/10)%	*427.00 F (10/0)%
44	1		*FRONT LH SEAT BELT	Jammed	788.50 F	*788.50 F
45	1		*LH SIDE AIRBAG SENSOR	Necessary	367.20 F	*367.20 F
46	1		*FRONT LH TYRE PRESSURE SENSOR	Necessary	165.00 F (10/0.00)%	*165.00 F (10/0.00)%
47	1		*FRONT FENDR COWLING LH	Cracked	98.00 F (10/0.00)%	*98.00 F (10/0.00)%
48	1		*FRONT LH SEAT BELT PILLAR TRIM	Cracked	60.00 F (10/0.00)%	*60.00 F (10/0.00)%

F=Franchise part. S=SpcNett. (x/y)%=(PDisc/Depr)%.

Sub Total (\$)	26,349.70	24,965.70
- List Item Discount on L Items 0.00/0.00% (\$)	2,449.90	2,361.00
Total Parts (\$)	23,899.80	22,604.70
- Betterment 0.00/0.00% (\$)	38.43	0.00
Total Parts after Betterment (\$)	23,861.37	22,604.70

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

No	Qty	Particulars	Repairer's	Amount
Miscellaneous Items				
1	1	OD/TP Case (Insurer)	11.00	11.00
Sub Total (\$\$)			11.00	11.00

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO JACK ,STRAIGHTEN ON LH A PILLAR,FENDER INNER PANEL,REPLACE DAMAGE PARTS AND REALIGN AFFECTED AREAS	New	1,200.00	750.00
2	TO PUTTY ,RESPRAY FRT BUMPER,LH FENDER,A PILLAR,LH FRT DOOR ,BONNET AND AFFECTED AREAS	New	1,500.00	1,000.00
3	TO DISMANTLE FRT LH SUSPEION UNIT TO ASSIST REPAIR AND REPLACE DAMAGE PARTS	New	300.00	200.00
4	WHEEL ALIGNMENT	New	100.00	80.00
5	TO REMOVE LH FRT SEAT TO REPLACE CUSHION AND AIRBAG	New	200.00	150.00
6	TO REMOVE AND REPLACE ROOF TOP LINING AND CURTAIN AIRBAG	New	250.00	100.00
7	TO REPROGRAM ECU AND AIRBAG SYSTEM	New	400.00	250.00
8	TO TRANSFER DOOR PART TO NEW DOOR	New	180.00	80.00
9	CHECK LIGHTING AND WIRING	New	60.00	20.00
Gross Labour Cost (\$\$)			4,190.00	2,630.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >