

ASS. REC. BY:

REF:

F02 / 22006863/K9Y3

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

N/S	O/S

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

01 days

Res.: Yes or No

Lum Sum:

1.B.1 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

XE 4827E

Yr Regn:

01, 19

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Scania

P410XTcc

12742

Colour:

Red

A/C: Insured / Std / NI / NA

Sp. Reading

201519

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

YS2P6X4000.5517832

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Mod: M / S / Rim / STD A / Rim or

Tyre Size:

F:

295/80R22.5

R:

(D)

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI (D)

TOYO / YOKO or

Triangle

Front

R/Bal.

mm

Rear

R/Bal.

55 33 mm

L/Bal.

mm

L/Bal.

55 33 mm

D.O.A.

6/5/22

D.O.I.

21/7/2022

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Frt Rtd down minor

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

10/3 @ 39701 Condo (Red 2330, 37%)

Date/Time, File Pass to?

☐

: Prell. Report

1) 16/3 typing

☐

: Final Report

Date/Time, File Return to?

Days Of Repair: 1

Resurvey No. of Trip:

Survey Fee:

Transportation:

S + RS SI

Fees

Others

TOTAL

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Report Format:

TP

Lump Sum / I.B.I. (\$

3970



SC AUTO INDUSTRIES (S) PTE LTD

51 Senoko Road, Singapore 758133

T 65 6758 2222 F 65 6257 6931

E sales@scauto.com.sg

scauto.com.sg

Co. Reg. No. 199800107D

M/S CLC MACHINERY PTE LTD

20 SENOKO DR

SINGAPORE 758207

Insured CLC MACHINERY PTE LTD

Policy 5125510264-000022

ESTIMATE Bill

GST Reg. No: 19-9800107D

Date: 20/7/2022

Our Case Ref. SC22/07/095/4CM-TP

Accident Date 4/5/2022

Damaged Vehicle No: XE4627E

S/no	Description	QTY	Price	Disc	Amount
<u>Replaced Parts</u>					
1	SIDE MIRROR ASSEMBLY RH	1 PC	\$855.00 ³⁶⁵⁰	-	\$855.00 ✓
2	RECORDING CAMERA	1 PC	\$0.00	-	\$0.00 X
3	BODY STICKER	1 PC	\$150.00	-	\$150.00 X
<u>Labour Charges</u>					
1	LABOUR TO REMOVE AND REINSTALL SIDE MIRROR ASSEMBLY RH	1	\$800.00	-	\$800.00
2	LABOUR TO REMOVE, REPAIR AND REINSTALL FRONT DOOR RH	1	\$850.00	-	\$850.00 X
3	LABOUR TO RESPRAY FRONT DOOR RH	1	\$850.00	-	\$850.00 X
					3201
					Not Notified Repair After Party 1 day
LKK Auto Consultants hence notify the Repairer of the following: • To resurvey before/after spray painting • To display damaged part(s) during resurvey • Parts prices are subject to confirmation • Third party survey is on a "Without Prejudice" basis • No illegal modification(s) is allowed • Supplementary item(s) must be resurveyed <u>and</u> is subject to final approval from Insurance Company Acknowledged by Repairer Signature: Date:					
Sub Total					\$ 3,505.00

Authorised Signature