

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/AIS22006882/GQY3E2

Date: 03/08/2022

REFERENCE

Handling Insurer: Allianz Insurance Singapore Pte. Ltd.

Policy No:

Claimant Vehicle No : SLG7456T

Insured Vehicle No : SMM4823T

Date of Loss: 10/07/2022

Nature of Claim: TP

Claim No: 2022 22005612FR

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SLG7456T**

Make & Model: TOYOTA VELLFIRE, 2.5 CVT S/R (A)

Engine No: 2ARH648606

Reg. Date: 16/11/2015 (Man. Year: 2015)

Chassis No: JTNGF3DH808003059

Colour: Black

Odometer: 214921 km

Engine Capacity: 2494 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable):

Yes Footbrake (Serviceable):

Yes

Handbrake (Serviceable): Yes Engine Modification:

No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 235/55 R18

Rear Tyre Size: 235/55 R18

Front Left Side: RAPID 6 mm

Rear Left Side: RAPID 6 mm

Front Right Side: RAPID 6 mm

Rear Right Side: RAPID 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment: 20/07/2022

Date Inspected: 20/07/2022 Inspected At:

Carsmith Private Limited (HQ)
13 KAKI BUKIT ROAD 4 #01-20 BARTLEY BIZ
CENTRE
Singapore 417807

Estimated Period of Repair: 5.0 days

Adjuster: XING GUO QIANG

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$4,000.00
-\$5,000.00

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 03 Aug 2022)
Parts:	M1-MPV	TOYOTA VELLFIRE 2.5 CVT S/R (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SLG7456T)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >