

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI22006891/AVY3Q2**Date:** 25/08/2022**REFERENCE**

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMHCSNA00009082200

Claimant Vehicle No : SJN3291P **Insured Vehicle No :** SMM3966X

Date of Loss: 17/07/2022 Nature of Claim: TP Claim No: SNM22D204994/C02/IRENE

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SJN3291P**

Make & Model: HYUNDAI AVANTE, 1.6 (A) Engine No: G4FC9U600113

Reg. Date: 12/02/2009 (Man. Year: 2009) Chassis No: KMH DU41BR9U687793

Colour: Silver Odometer: 174520 km

Engine Capacity: 1591 cc

Market Value/New Car Price: N/A

Sum Insured (\$\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 195/60 R15 Rear Tyre Size: 195/60 R15

Front Left Side: Falken 6 mm Rear Left Side: Falken 6 mm

Front Right Side: Falken 6 mm Rear Right Side: Falken 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	8,536.64	6,392.24	2,144.40	25.12
Miscellaneous Items	0.00	0.00	0.00	
Labour	2,360.00	1,680.00	680.00	28.81
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	10,896.64	8,072.24	2,824.40	25.92
Approved Total (Overridden) (\$\$)		6,400.00		
(\$\$)	10,896.64	6,400.00	4,496.64	41.27
+ GST 7.00/7.00% (\$\$)	762.76	448.00	314.76	41.27
Nett Amount (\$\$)	11,659.40	6,848.00	4,811.40	41.27

INSPECTION

Date of Assignment: 03/08/2022

Date Inspected: 20/07/2022 Inspected At: Twincar Automotive Pte Ltd (Kaki Bukit)
BLK 2 KAKI BUKIT, #01-17/18 KAKI BUKIT
AUTOHUB
Singapore 417921

Estimated Period of Repair: 7.0 days

Adjuster: ADRIAN LING**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 24 Aug 2022)
Parts:	143	HYUNDAI AVANTE 1.6 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SJN3291P)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Deformed	442.80 FL	*442.80 FL
2	1		*FRONT BUMPER FOGLAMP COVER	Not Necessary	22.00 FL	*- FL
3	1		*FRONT BUMPER SIDE RETAINER L/R	N/S Damaged	54.00 FL	*27.00 FL
4	1		*FRONT ENGINE CROSS MEMBER	Damaged	3,092.00 FL	*2,598.00 FL
5	1		*FRONT ENGINE CROSS MEMBER MOUNTING (FRONT)	Not Necessary	38.00 FL	*- FL
6	1		*FRONT ENGINE CROSS MEMBER MOUNTING (REAR)	Not Necessary	55.00 FL	*- FL
7	1		*REAR LH ABS SENSOR	Damaged	155.00 FL	*155.00 FL
8	1		*REAR LH DRIVE SHAFT	Not Necessary	937.00 FL	*- FL
9	1		*FRONT LH FENDER	Dented	402.00 FL	*402.00 FL
10	1		*FRONT LH FENDER VVT EMBLEM	Necessary	28.00 FL	*28.00 FL
11	1		*FRONT LH FENDER INNER SHIELD	Torn	48.00 FL	*48.00 FL
12	1		*FRONT LH FENDER INNER SPONGE	Torn	114.00 FL	*114.00 FL
13	1		*FRONT LH FENDER MUDFLAP	Not Necessary	42.00 FL	*- FL
14	1		*FRONT LH HEADLAMP	Cracked	480.00 FL	*480.00 FL
15	1		*FRONT LH HEADLAMP LOWER BRACKET	Not Necessary	37.00 FL	*- FL
16	1		*FRONT LH KNUCKLE ARM	Damaged	372.00 FL	*372.00 FL
17	1		*FRONT LH KNUCKLE ARM BEARING	Damaged	111.00 FL	*111.00 FL
18	1		*FRONT LH LINKAGE	Bent	80.00 FL	*80.00 FL
19	1		*FRONT LH LOWER ARM	Bent	282.00 FL	*282.00 FL
20	1		*FRONT LH LOWER ARM BALL JOINT	Bent	78.00 FL	*78.00 FL
21	1		*FRONT LH SHOCK ABSORBER	Bent	214.00 FL	*214.00 FL
22	1		*FRONT LH SHOCK ABSORBER SPONGE	Not Necessary	28.00 FL	*- FL
23	1		*FRONT LH SHOCK ABSORBER SPONGE RUBBER	Not Necessary	32.00 FL	*- FL
24	1		*FRONT LH SHOCK ABSORBER TOP MOUNTING	Not Necessary	78.00 FL	*- FL
25	1		*FRONT LH SHOCK ABSORBER TOP MOUNTING BEARING	Not Necessary	69.00 FL	*- FL
26	1		*FRONT LH WHEEL HUB	Damaged	166.00 FL	*166.00 FL
27	1		*FRONT STABILIZER BAR	Not Necessary	184.00 FL	*- FL
28	1		*FRONT SUPPORT PANEL	Cracked	791.00 FL	*791.00 FL
29	1		*STEERING RACK & PINION	Bent	914.00 FL	*914.00 FL
30	1		*SET FRONT BUMPER CLIPS	Necessary	50.00 FS	*30.00 FS
31	1		*SET FRONT LH FENDER INNER SHIELD CLIPS	Necessary	50.00 FS	*30.00 FS
32	1		*FRONT LH SPORT RIM	Cut	600.00 FS	*450.00 FS
33	1		*FRONT LH TYRE	Not Necessary	300.00 FS	*- FS
34	1		*RADIATOR COOLANT	Necessary	60.00 FS	*40.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	10,405.80	7,852.80
- List Item Discount on L Items 20.00/20.00% (\$\$)	1,869.16	1,460.56
Total Parts (\$\$)	8,536.64	6,392.24

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE ,REINSTALL AIR CON PARTS ,VACUUM ,REFILL AIR CON GAS (TO FR)	New	150.00	120.00
2	TO REMOVE ,REINSTALL ELECTRICAL WIRING HARNESS ,CHECK LIGHTING (TO FR)	New	60.00	30.00
3	TO REMOVE ,CHARGE FRONT SUSPENSION PARTS ,ABSORBER ,LOWER ARM ,KNOCKLE ARM ,WHEEL BEARING ,BEARING HUB ,DRIVE SHAFT ,ANTI-ROLL BAR ,TOP ARM AND STEERING RACK AND PINION	New	500.00	350.00
4	TO ROAD TEST DRIVING CHECK AND RESETTNG WHEEL ALIGNMENT SYSTEM	New	100.00	80.00
5	TO -RESPRAY PAINTING ON THE CHARGE BODYPARTS ,REPAIR PORTION ,AND WHERE CONSISTENT TO THE ACCIDENT	New	700.00	400.00
6	TO PROVIDE LABOUR ,WORKMANSHIP TO CHARGE THE ABOVE DAMAGED BODYPARTS ,REPAIR ,RE-CONSTRUCT AND RE-ALIGN BODY STRUCTURE ,BODY ALIGNMENTS AND DAMAGED CONSISTENT TO THE ACCIDENT	New	800.00	700.00
7	TO APPLY ANTI-RUST CHEMICAL ON REPAIRED AND REPLACED PANEL	New	50.00	0.00
Gross Labour Cost (\$\$)			2,360.00	1,680.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >