

# Constant Appraiser Services

Qualified Automobile Accident Damage Appraisers/Loss Adjusters

Blk 2 Rivervale Link, #09-02 Singapore 545040

Tel/Fax: 6886 1106 Mobile: 9007 5234

Email: constant\_as@yahoo.com.sg

RCB No. 53138015K

9

## Automobile Inspection Report

To: Mr K Sasi  
Blk 505 Choa Chu Kang St 51  
#08-183  
Singapore 680505

Date : 20/11/2019

Reference No : CAS/19-11/032

### General Information

Registration No. : SKS 3137P  
Accident Date : 05/11/2019

Re/Sy-Smth

### Particulars of Damaged Vehicle

Colour	: Red	Make & Model	: Honda City 1.5 SV CVT
Engine Capacity	: 1497 cc	Pre-Accident Condition	: Good
Mileage (KM)	: 168571	Engine No.	: L15Z11423201
Chassis No.	: MRHGM6660EP000341	Steering	: In Order
Registration Date	: 06/04/2015	Brake	: In Order

### Tyre Condition

	Size	Make	Balance
R/H Front Tyre	185/55R16	TOYO	60%
L/H Front Tyre	185/55R16	TOYO	60%
R/H Rear Tyre	185/55R16	TOYO	60%
L/H Rear Tyre	185/55R16	TOYO	60%

### Inspection

Repairer : Fastech Auto Pte Ltd  
1 Kaki Bukit Ave 6, #01-46/48/50 Autobay, Singapore 417883

### Adjustment And Recommendation Cost Of Repair

Repairer's Estimate : \$20,747.45  
Revised Amount : \$16,650.00  
Less Excess : -  
Nett Total : \$16,650.00

### Remarks

- (A) Survey was done on 07/11/2019
- (B) Re-survey was done on 08/11/2019
- (C) The survey was conducted entirely on WITHOUT PREJUDICE basis.
- (D) We have NOT given any instruction to authorize the repair of the vehicle.

NOTE: The revised estimate was made from a visual inspection. Should there be any discrepancy or unseen damage/item in this survey, kindly notified the company within 7 (seven) days from the date hereof. Otherwise, the revised amount shall be deemed to be valid.

Submit 2/5 \$8000  
6 dys.

Adjustment On Repair Costs And Replacement Of Parts:

S/No	Qty	Descriptions	Assessed Condition	Estimate by Workshop (\$)	Revised Amount (\$)
<u>PARTS REPLACEMENT - LIST ITEMS</u>					
1	1pc	Rear bumper 554.10	Grazed/Torn Torn	861.90	594.10 861.90
2	2pcs	Rear bumper side retainer @ \$89.50 3542=70	Necessary	179.00	3542=70 179.00
3	1pc	Rear fender RH 981.10	Dented/Warped 22/wor	1,257.60	1,257.60
4	1pc	Rear door RH 855.20	Dented/Warped 22/wor	1,480.50	1,480.50
5	1pc	Rear door glass outer moulding RH 80	Necessary	181.90	181.90
6	1pc	Rear door glass run channel RH	Necessary	286.50	286.50
7	1pc	Rear door glass regulator assy RH	Bent	631.50	631.50
8	1pc	Rear door inner lock RH 350	Bent/Jammed bent/jam	590.60	590.60
9	1pc	Rear door inner trim board RH 600	Mounting Broken Torn	1,085.90	1,085.90
10	1pc	Rear door insulation RH	Necessary	151.20	151.20
11	1pc	Rear door weatherstrip RH 120	Necessary	190.90	190.90
12	1pc	Rear door checker RH 88	Bent	115.00	115.00
13	2pcs	Rear door hinge RH @ \$135.00 6242=120	Bent	270.00	270.00
14	1pc	Rear door edge seal RH 60	Necessary	112.60	112.60
15	1pc	Rear shock absorber RH 299	Bent	331.90	331.90
16	1pc	Rear axle beam 1455	Bent/Twisted bent/twist	1,996.90	1,996.90
17	1pc	Rear wheel hub bearing RH 450	Necessary	781.60	781.60
18	1pc	Rear windscreen moulding 68	Necessary	130.90	130.90
19	1pc	Front door RH 901.10	Dented/Warped 22	1,560.50	1,560.50
20	1pc	Front door outer handle RH	Grazed/Twisted	290.30	290.30
21	1pc	Front door glass outer moulding RH 80	Necessary	211.30	211.30
22	1pc	Front door glass run channel RH	Necessary	289.60	289.60
23	1pc	Front door glass regulator assy RH	Bent	681.60	681.60
24	1pc	Front door inner lock RH 350	Bent/Jammed Daye	599.50	599.50
25	1pc	Front door insulation RH	Necessary	151.60	151.60
26	1pc	Front door inner trim board RH 750	Mounting Broken Torn	1,138.80	1,138.80
27	1pc	Front door weatherstrip RH 120	Necessary	211.30	211.30
28	1pc	Center pillar RH	Repair	1,559.60	-
				17,330.50	15,770.90
Less 10% 20%				(1,733.05)	(1,577.09)
Sub total				15,597.45	14,193.81

S/No	Qty	Descriptions	Assessed Condition	Estimate by Workshop (\$)	Revised Amount (\$)
<u>PARTS REPLACEMENT – SPECIAL NETT ITEMS</u>					
1	1pc	Rear sport wheel	Grazed/Warped <i>reput</i>	450.00	450.00 ✓
2	1pc	Rear tyre	Cut <i>cut</i>	280.00	60.00 ✓
3	1set	Rear windscreen sealant	Necessary <i>neu</i>	80.00	60.00 40
4	1set	Rear door black tape	Necessary <i>neu</i>	120.00	120.00 60
5	1set	Front door black tape	Necessary <i>neu</i>	120.00	120.00 60
Sub total				16,647.45	15,003.81
<u>LABOUR &amp; MISC. CHARGES</u>					
1		To check rear electrical wiring		50.00	30.00 ✓
2		To remove, refix rear windscreen		180.00	150.00 120
3		To remove, refix rear undercarriage		350.00	350.00 250
4		To respray undercoating		180.00	120.00 90
5		To remove, refix rear interior trim to assist repair		120.00	100.00 ✓
6		To check wheel alignment		120.00	120.00 80
7		To respray painting & etc		1,500.00	1,200.00 1100
8		Panel beating, cut, weld, remove & replacing above parts		1,600.00	1,400.00 900
Grand total				20,747.45	18,473.81
Recommended cost of lump sum repair (To its pre-accident condition)					16,650.00

Adjustment/Recommendations

We have thoroughly inspected each and every item on the estimate against the physical damage found on the vehicle and we have listed the breakdown of our finding and our recommendation.

The repairer has agreed to undertake the job at a lump sum of **\$16,650.00** on a contractual basis. Under normal circumstances, the repair period would be about **8 (Eight)** working days.

Yours faithfully,

Constant Appraiser Services

Lim Yong Tian (Sebastian)

Licensed Appraiser

Adv. Dip. In Mechanical Engineering (AUS)

MSAAA

8391.50  
202  
671320  
670  
2670  
10053.2