LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/HLA22006927/UQY3E2

Date: 12/08/2022

REFERENCE

Handling Insurer: HL Assurance Pte Ltd Policy No: MP319282

Claimant Vehicle VEGCCER Property Assurance Pte Ltd Policy No: MP319282

No: XE3665B Insured Vehicle No: SKW6658L

Date of Loss: 15/07/2022 Nature of Claim: TP Claim No: MPC03557/GN

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: XE3665B

Make & Model: MITSUBISHI FUSO, 10.7 D FV70HJA00064 (M) Engine No: OM457LA457972C0341239

 Reg. Date:
 13/11/2017 (Man. Year: 2017)
 Chassis No:
 FV51SJA20288

 Colour:
 Yellow
 Odometer:
 265543 km

Engine Capacity: 11967 cc Market Value/New Car Price: N/A

Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 295/80 R22.5 Rear Tyre Size: 295/80 R22.5 (D/D)
Front Left Side: SAFEKING 6 mm
Front Right Side: SAFEKING 6 mm
Rear Left Side: SAFEKING 6/6/6/6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	6,696.00	3,730.78	2,965.22	44.28
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,690.00	820.00	870.00	51.48
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S	\$) 8,386.00	4,550.78	3,835.22	45.73
Approved Total (Overridden) (S	\$)	3,600.00		
(S	\$) 8,386.00	3,600.00	4,786.00	57.07
+ GST 7.00/7.00% (S	\$) 587.02	252.00	335.02	57.07
Nett Amount (S	\$) 8,973.02	3,852.00	5,121.02	57.07

INSPECTION

Date of Assignment: 21/07/2022

Focus Auto Pte Ltd (Kaki Bukit)

Date Inspected: 26/07/2022 Inspected At: NO 1 KAKI BUKIT AVE 6(AUTOBAY) #02-50

Singapore 417883

Estimated Period of Repair: 3.0 days

Adjuster: MARCUS CHUA Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: (Last Synchronised: 12 Aug 2022)

Parts: N/A MITSUBISHI FUSO 10.7 D FV70HJA00064 (M) (Model not available in database)

Labour: Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for XE3665B)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with

the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Dented / Bent	3,950.00 FL	*2,088.37 FL
2	1		*FRONT BUMPER SIDE CORNER GARNISH - LH	Distorted	105.00 FL	*105.00 FL
3	1		*FRONT BUMPER FOGLAMP - LH	Not Necessary	368.00 FL	*- FL
4	1		*FRONT BUMPER FOGLAMP COVER - LH	Not Necessary	127.00 FL	*- FL
5	1		*FRONT BUMPER SIDE TOP GARNISH - LH	Repair	280.00 FL	*- FL
6	1		*FRONT BUMPER SIDE LOWER BRACKER - LH	Not Necessary	102.00 FL	*- FL
7	1		*FRONT HEADLAMP - LH	Cracked	1,100.00 FL	*1,100.00 FL
8	1		*FRONT HEADLAMP COVER - LH	Warped	145.00 FL	*145.00 FL
9	1		*FRONT STEP PANEL GARNISH - LH	Torn	325.00 FL	*325.00 FL
10	1		*FRONT STEP PANEL SIDE GARNISH - LH	Warped	346.00 FL	*346.00 FL
11	1		*FRONT STEP PANEL REFLECTOR - LH	Not Necessary	80.00 FL	*- FL
12	1		*FRONT STEP PANEL SUPPORT - LH (2PCS)	Cracked (1pc only)	1,134.00 FL	*567.00 FL
13	1		*FRONT SUPPORT PLATE - LH	Cracked	298.00 FL	*298.00 FL
14	1		*FRONT WHEEL ACE COVER - LH	Not Necessary	568.00 FL	*- FL
F=Fra	nchise	part. L=ListIt	emDisc.	-		
				Sub Total (S\$)	8,928.00	4,974.37
	- List Item Discount on L Items 25.00/25.00% (S\$)				2,232.00	1,243.59
				Total Parts (S\$)	6,696.00	3,730.78

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Lab	our Items			
1	PANEL BEATING	New	920.00	400.00
2	CHECK WIRING	New	60.00	20.00
3	RUST PROOFING	New	60.00	0.00
4	TO SPRAY PAINTING	New	650.00	400.00
		Gross Labour Cost (S\$)	1,690.00	820.00
		Report was unsubmitted during this print-out.		

< END OF ESTIMATES >