



6 tampines st 73, #01-03, singapore 528825
tel: 6746 2118 fax: 6746 1148
reg no: 53058468m

Our Reference : KAAS/KT/6353/9462/TP/02.22

Invoice No. : 6353

Date : 15 January 2022

To: Chua Wen Qi Joanne
c/o Blk 3007 Ubi Road 1
#01-414
Singapore 408701

INVOICE

PARTICULARS	AMOUNT
Vehicle No. : SKB 9462A Make/Model : Hyundai i45 2.4(A) <input checked="" type="checkbox"/> Inspection of Vehicle <input checked="" type="checkbox"/> Appraisal Report <input checked="" type="checkbox"/> 41 Colored Photographs <input checked="" type="checkbox"/> Transport charges <input checked="" type="checkbox"/> Re-inspection <input type="checkbox"/> Others (Specify)	SGD 541.00
Total	SGD 541.00

Dollars: **Five Hundred and Forty-One Only**

(Cheque should be crossed and make payable to " Kelvin Automotive Appraising Services ")



Kelvin Automotive Appraising Services

Insured : -
Policy No. : -
Sum Insured : -
Excess : -
Our Reference : KAAS/KT/6353/9462/TP/02.22
Date : 15 January 2022

To: Chua Wen Qi Joanne
c/o Blk 3007 Ubi Road 1
#01-414
Singapore 408701

VEHICLE APPRAISAL REPORT

Name of Workshop : Leng Wang Motor
Place of inspection : Blk 3007 Ubi Road 1, #01-414 Singapore 408701
Date of Assignment : 28 February 2022
Date of Accident : 25 February 2022
Date of Inspection : 28 February 2022

PARTICULARS OF INSPECTED VEHICLE

Registration No.	: SKB 9462A	Chassis Frame No.	: KMHEC41CMBA259304
Make / Model	: Hyundai i45 2.4(A)	Engine No. (Logcard)	: G4KEAU223318
Year of Manufacture/Reg	: 2010	Odometer Reading	: 255,049 KM
Colour	: White		
Class / Type	: Saloon		

CONDITION OF VEHICLE DURING SURVEY (Visual & Static Check Only)

 
General Condition : Good
Paintwork : Good
Market Value : -
Scrap Value : -

CONDITION OF TYRES ON VEHICLE

	<u>Make/Size</u>	<u>Thread Balance</u>
Front Left	Yokohama 215 / 55 R17	7 mm
Front Right	Yokohama 215 / 55 R17	7 mm
Rear Left	Yokohama 215 / 55 R17	7 mm
Rear Right	Yokohama 215 / 55 R17	7 mm

*The above is an estimate of the remaining life of the tyre thread in millimeters

The information contained in these documents may be privileged and confidential, and is intended for the exclusive use of the addressee designation.
If you are not the addressee, any enclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited. If you
have received this survey report in error, please contact us immediately by phone so that we can arrange for its return.



: KAAS/KT/6353/9462/TP/02.22
: **SKB 9462A**




S/N	Qty	Descriptions	Conditions	Repairer's Estimate	Revised Amount
		LIST ITEMS:-			
1	1 pc	Front bumper	Broken	\$ 508.90	\$ 508.90
2	1 pc	Front bumper reinforcement	Buckled	\$ 304.20	\$ 304.20
3	1 pc	Front bumper sponge	Broken	\$ 96.40	\$ 96.40
4	1 pc	Front bumper rh fog lamp	Cracked	\$ 319.80	\$ 319.80
5	1 pc	Front bumper side retainer	Necessary	\$ 37.00	\$ 37.00
6	1 set	Front bumper fasteners	Necessary	\$ 35.00	\$ 35.00
7	1 pc	Front bumper tow hook cover	Damaged	\$ 22.00	\$ 22.00
8	1 pc	Front grille w/ chrome	Unconfirmed	\$ 821.70	not affected
9	1 pc	Front logo emblem	Unconfirmed	\$ 26.00	not necessary
10	1 pc	Front support panel (complete)	Unconfirmed	\$ 907.40	not affected
11	1 pc	Headlamp assy	Broken	\$ 1,989.50	\$ 1,989.50
12	1 pc	Headlamp HID Ballast	Not Working	\$ 974.00	\$ 974.00
13	1 pc	Wiper washer tank	Deformed	\$ 112.00	\$ 112.00
		Less 20%		\$ 6,153.90	\$ 4,398.80 \$ 879.76
		SPECIAL NETT ITEMS:-		\$ 6,153.90	\$ 3,519.04
14	1 pc	Front no. plate	Buckled	\$ 60.00	\$ 50.00
15	1 pc	Front no. plate frame	Deformed	\$ 35.00	\$ 35.00
				\$ 95.00	\$ 85.00
			Sub - Total	\$ 6,248.90	\$ 3,604.04

APPRAISEMENT SCHEDULE

S/N	Qty	Descriptions	Conditions	Repairer's Estimate	Revised Amount
		B/F		\$ 6,248.90	\$ 3,604.04
		LABOUR & OTHER CHARGES:-			
1		To panel beat and renewal of all necessary damaged body parts		\$ 960.00	\$ 880.00
2		To realign headlamp focus		\$ 35.00	\$ 20.00
3		To check front wiring and rewire		\$ 60.00	\$ 50.00
4		To apply anti-rust		\$ 100.00	\$ 80.00
5		To putty and spray-paint of affected areas		\$ 960.00	\$ 880.00
				\$ 2,115.00	\$ 1,910.00
Sub - Total				\$ 8,363.90	\$ 5,514.04

ASSESSMENT SUMMARY

Damages sustained were consistent with the subject vehicle being involved in a collision with another vehicle and the impact was delivered **Squarely to the RH front** of the vehicle.

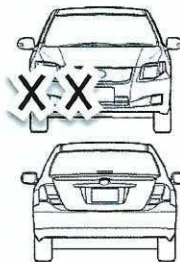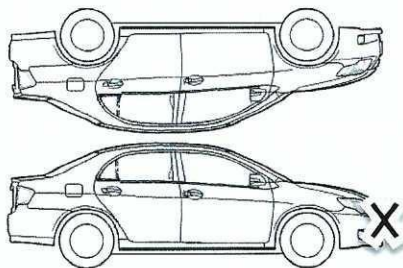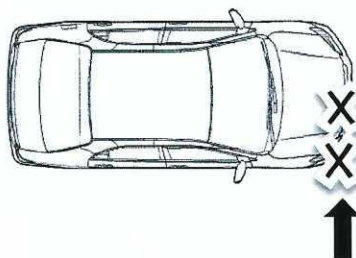

The general area of damages is at the **Front portion**
(Please refer to the parts list and photographs as attached for more information)

ASSESSOR'S RECOMMENDATIONS

The estimated repair costs submitted by Messrs **Leng Wang Motor** is \$ 8,363.90 .
We have adjusted the cost to \$ 5,514.04 and the repairer has agreed to undertake the repairs at a **Contract Lump Sum of \$ 4,400.00** to a acceptable quality and standards.
However, we have not given authorization and instruction to the repairer to proceed with the repairs.

The repairs should be completed within a reasonable period of **6** working days.

41 photographs were taken at the time of static inspection.

This report is strictly done in a **Without Prejudice Basis**.

We are reverting the matter to you a decision.

We enclose herewith our Invoice No. **6353** for our services rendered and
we thank you for engaging our services.

KELVIN TEO

Licensed Automotive Appraiser

Nitec in Automotive Technology

Cert. Crash Investigation & Reconstruction

Dip MS

MSAAA, AM SAE-A

NOTE : This revised estimate was from a visual inspection. Should there be any discrepancy or unseen items not listed in this survey, kindly notify the company within Seven (7) days from the date hereof. Otherwise this revised amount shall be treated as valid.

