LKK Auto Consultants #01-25 Paya Ubi Industrial Park, 51 **Ubi Avenue 1** 408933

Insurer Reference: SKA1166M Repairer Reference: SKA1166M

Registration: SKA1166M Date calculated: 15/09/2022 2:40 PM Printed: 15/09/2022 3:23 PM

Summary Information

Claim

Location: Work Provider: Singapore (SG) China Taiping Insurance

(Singapore) Pte Ltd

Full Report

Printed by: KK LAU Currency: Claim Reference: SKA1166M Date of Incident:

Hire Car Start: Hire Car End:

SGD 24/07/22

Estimated Repair Time: Actual Repair Days:

Vehicle Details

Vehicle

CITROEN Manufacturer:

Model: C5 AIRCROSS (AC) Sub Model: BASE MODEL Model Sheet Number: 10 CA 01 Registration: SKA1166M

VIN number: VR7A45GFRKL072409

Odometer: 50230

Model Specs

FROM 04.2019 COOLANT R134 AUTO CIRC AIR CONTR ELECTRIC TAILGATE

SMARTPHONE CHARGING HEADLAMP LED/H7 PEDAL CARRIER ALU INT MIRROR AUTODIP OUT FUEL FILTER **AUTO GEARBOX ATN8** AUTOMATIC BRAKE SYS

ALTERNATOR 150 AMP HEAD/SIDE AIRBAG PAINTED MOULDINGS

LAMINATED S-WINDOW BLIND SPOT SENSOR **FUNC MIRROR SCREEN**

ULTRASONIC PARK SYS LEATHER STRG WHEEL LUMBAR SUPPORT MECH STOP-START SYSTEM REAR AXLE 30000N.M

ELECT POWER STEERING

ENGINE FAN 180W DIAGNOSIS EOBD REAR SKIRT GLOSS CONDENS 16MM 23.5DM2 AUTO AIR CON ACCESS FOOT OPENING

KEYLESS ENTRY/START RADIO SYSTEM COLOUR

VISIO PARK 1

CHROME SILL MLDGS ELEC ADJ DRIVER SEAT HOUSING PREHEATING **REAR BUMPER 2 STOP** TYRES 235/55 VR 18

ROOF RAILS

BATTERY 12V 70AH TWO COAT METALLIC DEAD LOCKS

ELECT FOLDING MIRROR FOG LAMPS

LEATHER TRIM INTERIOR LIGHT LED RADIATOR 28DM2 28MM 1.6 LTR 166KW HYBRID FRT SUPP FRAME STEEL WHEELS 7.5J X 18 ALU

EMISSION STD EURO6.2 **DUST ATMOSPHERE** PREPARE OFF VEHICLE


Vehicle Condition

Vehicle Status

Pre-Accident Damage: Date of Inspection:

Damage Areas

All	
Underbody	

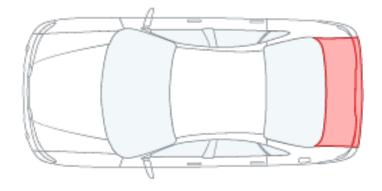

Tyres Condition

Tyre Brand Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner), Tread (Right Outer), Tread (Right Outer),

mm mm mm mm Middle), mm

Spare Tyre Brand

Tread (Spare), mm

Labour

Time Base 10 WU/h		Price = 42.	00 SGD/h
Code	Description	WU	Price SGD
6815 0210	R + R REAR BUMPER	11.0	46.20
NO NUMBER	REMOVE AND REFIT REAR BUMPER SKIRT	2.0	8.40
NO NUMBER	REPLACE REAR BUMPER SKIRT (REMOVED)	2.0	8.40
	Labour Cost Panel / Mechanical Labour	Hrs WU 1.50 15.0	63.00
	Total of Labour		63.00

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h	
Code	Description - TWO COAT METALLIC	WU Price SGD	
	REAR BUMPER NEW PART PAINT K1R	8.0	
	REAR BUMPER SKIRT NEW PART PAINT K1R	7.0	
	REAR PANEL REPAIR PAINTING >50%	15.0	

Paint Material Per Part

Code	Description	Price SGD
2581	REAR BUMPER NEW PART PAINT K1R	35.42
2585	REAR BUMPER SKIRT NEW PART PAINT K1R	26.57
2711	REAR PANEL REPAIR PAINTING >50%	14.22

Labour Cost - Paint Factor	42.00 SGD/h	Hrs	wu	Price SGD
Time Paint Preparation Main Work Metal	42100 305/11	2.50	30.0 25.0	105.00
Preparation Comp. Work Plastic	10 1111 11	0.50	5.0	21.00
Total	10 WU/h	6.00	60.0	252.00
Matavial Cost Paint				Duine CCD

Material Cost - Paint	Price Sub
New Part Painting - Plastic K1R	61.99
Repair Painting	14.22
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
Total	113.81

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2001-01-01 Price SGD
2585	REAR BUMPER SKIRT	16 389 540 80	Original	0.00
1000	RR BUMPER LOWER	BUMPER LOWER	Original	620.00
f: OEM Parts n: Non-OEM Parts u: Used parts	Savings Subtotal Fixed Sundry Parts	s Price		0.00 620.00 100.00
	Total			720.00

Final Calculation

SGD	SGD
620.00	
100.00	
	720.00
63.00	
	63.00
252.00	
113.81	
	365.81
	1,148.81
	80.42
	1,229.23
	620.00 100.00 63.00

Comments

* - USER SUPPLIED DATA NN - NO MANUFACTURERS CODE EXISTS) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.