

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

ERGO Insurance Pte. Ltd.
8 Temasek Boulevard, #04-01 Suntec Tower Three
Singapore 038988

Our File No: CS/EGI22007102/UCY3Q2**Date:** 18/08/2022**REFERENCE**

Insured/Claimant:	ZHENG WEN HAO	Policy No:	DMPG21011572	
Date of Loss:	25/07/2022	Nature of Claim:	OD	Claim No: CDMPG22001461

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SLG543X		
Make & Model:	HONDA CIVIC, 1.6 (A)	Engine No:	R16B21600259
Reg. Date:	20/09/2016 (Man. Year: 2016)	Chassis No:	MRHFC5650GT000155
Colour:	Black	Odometer:	116025 km
Engine Capacity:	1597 cc		
Market Value/New Car Price:	S\$58,000.00		
Sum Insured (\$\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:		Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	

CONDITION OF TYRES

Front Tyre Size:	215/55 R16	Rear Tyre Size:	215/55 R16
Front Left Side:	Firenza 6 mm	Rear Left Side:	Firenza 6 mm
Front Right Side:	Firenza 6 mm	Rear Right Side:	Firenza 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	5,585.15	4,579.65	1,005.50	18.00
Miscellaneous Items	0.00	0.00	0.00	
Labour	2,280.00	1,420.00	860.00	37.72
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	7,865.15	5,999.65	1,865.50	23.72
Approved Total (Overridden) (\$\$)		4,700.00		
- Excess (\$\$)	800.00	800.00	0.00	0.00
(\$\$)	7,065.15	3,900.00	3,165.15	44.80
+ GST 7.00/7.00% (\$\$)	494.56	273.00	221.56	44.80
Nett Amount (\$\$)	7,559.71	4,173.00	3,386.71	44.80

INSPECTION

Date of Assignment:	26/07/2022		
Date Inspected:	26/07/2022	Inspected At:	Precise Auto Service (HQ) No 1 Kaki Bukit Ave 6, #02-34/36 Singapore 417883
Estimated Period of Repair:	5.0 days		

Adjuster: MARCUS CHUA**Manager:** CELINE FONG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 18 Aug 2022)
Parts:	143	HONDA CIVIC 1.6 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SLG543X)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BONNET (WCP)	Repair	450.00 F	*- F
2	2		*BONNET HINGES (WCP)	Bent	90.00 F	*90.00 F
3	1		*BONNET LOCK (WCP)	Serviceable	75.00 F	*- F
4	1		*BONNET LOCK CABLE (WCP)	Not Necessary	45.00 F	*- F
5	1		*FRONT GRILLE CHROME (WCP)	Cracked	95.00 F	*95.00 F
6	1		*FRONT GRILLE BASE (WCP)	Cracked	85.00 F	*85.00 F
7	1		*FRONT GRILLE EMBLEM (WCP)	Scratched	25.00 F	*25.00 F
8	5		*FRONT GRILLE CLIPS (WCP)	Necessary	17.50 F	*17.50 F
9	2		*HEAD LAMP ASSY (WCP)	Cracked	960.00 F	*960.00 F
10	2		*HEAD LAMP BRACKET (WCP)	Cracked	70.00 F	*70.00 F
11	1		*FRONT BUMPER FASCIA (WCP)	Torn	310.00 F	*310.00 F
12	10		*FRONT BUMPER CLIPS (WCP)	Necessary	35.00 F	*35.00 F
13	1		*FRONT BUMPER REINFORCEMENT (WCP)	Dented	260.00 F	*260.00 F
14	2		*FRONT BUMPER SIDE RETAINER (WCP)	Bent	30.00 F	*30.00 F
15	1		*FRONT TEMP SENSOR (WCP)	Not Necessary	65.00 F	*- F
16	1		*FRONT SUPPORT PANEL (WCP)	Buckled	420.00 F	*420.00 F
17	1		*FRONT FENDER LH & RH (WCP)	N/S Repair / O/S Buckled	440.00 F	*220.00 F
18	1		*AIR COND CONDENSOR (WCP)	Bent / Punctured	330.00 F	*330.00 F
19	1		*FRONT NUMBER PLATE }	Bent	30.00 FS	*35.00 FS
20	1		*FRONT NUMBER PLATE CASING }	Bent	15.00 FS	*- FS
21	1		*FRONT BUMPER CENTER AIR GRILLE GARNISH (WCP)	Torn	110.00 F	*110.00 F
22	1		*FRONT BUMPER TOP BEAM (WCP)	Bent	150.00 F	*150.00 F
23	2		*HEAD LAMP CHROME (WCP)	Cracked	160.00 F	*160.00 F
24	2		*AIR COND CONDENSOR SIDE AIR GRILLE GARNISH (WCP)	Torn	120.00 F	*120.00 F
25	1		*AIR COND LIQUID PIPE (WCP)	Bent	180.00 F	*180.00 F
26	2		*RADIATOR TOP MOUNTING (WCP)	Twisted	36.00 F	*36.00 F
27	1		*RADIATOR ASSY (WCP)	Bent / Punctured	400.00 F	*400.00 F
28	1		*COOLANT (WCP)	Necessary	28.00 F	*28.00 F
29	2		*FOG LAMP COVER (WCP)	Not Necessary	50.00 F	*- F

F=Franchise part. S=SpcNett.

Sub Total (\$\$)	5,081.50	4,166.50
+ Margin on L,N Items 10.00/10.00% (\$\$)	503.65	413.15
Total Parts (\$\$)	5,585.15	4,579.65

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO RENEW BONNET ,LH & RH FENDER ,FRONT BUMPER ,CUT & WELD SUPPORT PANEL,AND ALIGNED ALL PARTS	New	850.00	600.00
2	TO CHECK ELECTRICAL WIRING HARNESS	New	150.00	20.00
3	TO REPLACE AIR COND CONDENSOR ,VACUUM & TOP UP GAS	New	180.00	100.00
4	TO RESPRAY BONNET ,FENDERS ,FRONT BUMPER AND SUPPORT PANEL	New	950.00	700.00
5	TO REMOVE & REFXI RADIATOR ,HOSES & FAN ASSY	New	150.00	0.00
Gross Labour Cost (\$\$)			2,280.00	1,420.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >