

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/AIS22007170/AVY3E2
Date: 08/09/2022

REFERENCE

Handling Insurer: Allianz Insurance Singapore Pte. Ltd. Policy No:
Claimant Vehicle No : SDR1888G **Insured Vehicle No :** SLV5858B
Date of Loss: 22/07/2022 Nature of Claim: TP Claim No: 2022 22005794KC

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SDR1888G**
Make & Model: MERCEDES-BENZ GLC 250, 2.0 4MATIC (A) Engine No: 27492031882065
Reg. Date: 25/11/2019 (Man. Year: 2019) Chassis No: WDC2539462F671941
Colour: Black Odometer: 82681 km
Engine Capacity: 1991 cc
Market Value/New Car Price: N/A
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 235/60 R18 Rear Tyre Size: 235/60 R18
Front Left Side: Pirelli 6 mm Rear Left Side: Pirelli 6 mm
Front Right Side: Pirelli 6 mm Rear Right Side: Pirelli 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	41,020.00	25,770.40	15,249.60	37.18
Miscellaneous Items	0.00	0.00	0.00	
Labour	5,620.00	3,090.00	2,530.00	45.02
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	46,640.00	28,860.40	17,779.60	38.12
Approved Total (Overridden) (S\$)		23,000.00		
(S\$)	46,640.00	23,000.00	23,640.00	50.69
+ GST 7.00/7.00% (S\$)	3,264.80	1,610.00	1,654.80	50.69
Nett Amount (S\$)	49,904.80	24,610.00	25,294.80	50.69

INSPECTION

Date of Assignment: 27/07/2022
Date Inspected: 27/07/2022 Inspected At: H S Automotive Services (Kaki Bukit)
BLK 2 KAKI BUKIT, AVENUE 2, # 01-15, KAKI
BUKIT AUTOHUB
Singapore 417921
Estimated Period of Repair: 8.0 days

Adjuster: ADRIAN LING

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG	Version: 1.0 (Last Synchronised: 07 Sep 2022)
Parts: M1-SUV	MERCEDES-BENZ GLC 250 2.0 4MATIC (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SDR1888G)
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*RH FRONT DOOR	Dented	2,950.00 F	*2,696.00 FL
2	2		*RH FRONT DOOR HINGE TOP / BOTTOM	Not Necessary	760.00 F	*- FL
3	1		*RH FRONT DOOR TOP MOULDING CHROME	Not Necessary	380.00 F	*- FL
4	1		*RH FRONT DOOR WHEATHERSTRIP	Necessary	320.00 F	*320.00 FL
5	1		*RH FRONT DOOR INNER TRIM BOARD	Not Necessary	2,500.00 F	*- FL
6	1		*RH FRONT DOOR TRIM BOARD CLIP	Not Necessary	110.00 FS	*- FS
7	1		*RH SIDE MIRROR	Damaged	1,350.00 F	*1,350.00 FL
8	1		*RH SIDE MIRROR COVER	Missing	240.00 F	*240.00 FL
9	1		*RH SIDE MIRROR COVER SIGNAL LAMP	Missing	200.00 F	*200.00 FL
10	1		*RH SIDE MIRROR GLASS	Missing	1,100.00 F	*1,100.00 FL
11	1		*RH SIDE SKIRT (STEP PANEL)	Cut	1,400.00 FS	*850.00 FS
12	2		*RH SIDE STEP PANEL BRACKET	Not Necessary	870.00 FS	*- FS
13	1		*RH FRONT FENDER	Dented	960.00 F	*960.00 FL
14	1		*RH FRONT FENDER INNER SHIELD	Deformed	380.00 F	*380.00 FL
15	1		*RH FRONT FENDER INNER SHIELD CLIP	Necessary	110.00 FS	*30.00 FS
16	1		*RH FRONT FENDER GARNISH	Deformed	270.00 F	*270.00 FL
17	1		*RH FRONT FENDER GARNISH CLIP	Necessary	110.00 FS	*20.00 FS
18	1		*FRONT BUMPER	Repair	1,450.00 F	*- FL
19	1		*FRONT BUMPER CLIP	Not Necessary	110.00 FS	*- FS
20	1		*FRONT BUMPER RETAINER RH	Not Necessary	20.00 F	*- FL
21	1		*RH FRONT BUMPER BRACKET	Not Necessary	250.00 F	*- FL
22	1		*RH FRONT HEAD LAMP	Cracked	3,650.00 F	*3,650.00 FL
23	1		*RH FRONT HEAD LAMP LOWER BRACKET	Not Necessary	180.00 F	*- FL
24	1		*RH FRONT SHOCK ABSORBER	Bent	980.00 F	*980.00 FL
25	1		*RH FRONT WHEEL KNUCKLE	Damaged	1,350.00 F	*1,350.00 FL
26	1		*RH FRONT WHEEL BEARING	Damaged	660.00 F	*660.00 FL
27	1		*RH FRONT LINKAGE ROD	Bent	170.00 F	*170.00 FL
28	1		*FRONT LINKAGE ANTI-ROLL BAR	Not Necessary	870.00 F	*- FL
29	1		*RH FRONT LOWER ARM	Bent	890.00 F	*890.00 FL
30	1		*RH FRONT TOP ARM	Bent	890.00 F	*650.00 FL
31	1		*RH FRONT DRIVE SHAFT	Not Necessary	3,650.00 F	*- FL
32	1		*ELECTRONIC POWER STEERING RACK AND PINION	Broken	8,600.00 F	*8,600.00 FL
33	1		*SPORT RIM (ORIGINAL)	Cut	920.00 F	*920.00 FL
34	1		*RH FRONT TYRE	Punctured	400.00 FS	*250.00 FS
35	1		*RH FRONT DRIVER SEAT BELT	Activated	750.00 F	*750.00 FL
36	1		*SEAT BELT CONTROL UNIT (SRS)	Activated	1,220.00 F	*1,220.00 FL

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	41,020.00	28,506.00
- List Item Discount on L Items 0.00/10.00% (\$\$)	0.00	2,735.60
Total Parts (\$\$)	41,020.00	25,770.40

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEAT	New	1,800.00	1,000.00
2	SPRAY PAINT	New	1,800.00	1,000.00
3	WHEEL ALIGNMENT	New	160.00	80.00
4	TO REMOVE / REFIX UNDERCARRIAGE	New	380.00	220.00
5	TO REMOVE / REFIX POWER STEERING RACK	New	350.00	150.00
6	TO REMOVE FRONT DRIVER SEAT BELT AXID CONTROL UNIT (SRS)	New	350.00	250.00
7	TO PROGRAMME SRS SYSTEM AND EPS	New	480.00	300.00
8	TO CHECK WIRING	New	150.00	30.00
9	RUST PROOF	New	150.00	60.00
			Gross Labour Cost (\$)	3,090.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >