



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLS 701T

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BUMPER	BENT	1,908.00	1,550.00
1	REAR BUMPER LOWER TRIM	MTG CRACKED	518.40	432.00
1	REAR BUMPER CENTER BOTTOM CARRIER	TO REPAIR SEE LABOUR	172.80	-
1	REAR BUMPER CENTER CARRIER	SERVICEABLE	133.00	-
1	REAR BUMPER RH RETAINER	DISTORTED	50.00	50.00
1	REAR BUMPER LH RETAINER	DISTORTED	50.00	50.00
1	REAR BUMPER RH CARRIER	SERVICEABLE	82.00	-
1	REAR BUMPER LH CARRIER	SERVICEABLE	82.00	-
1	REAR BUMPER TOW COVER	DENTED	69.00	69.00
1	REAR EXHAUST TIP BRACKET RH	SERVICEABLE	95.00	-
1	REAR EXHAUST TIP BRACKET LH	SERVICEABLE	95.00	-
1	REAR EXHAUST PIPE TRIM RH	SERVICEABLE	370.00	-
1	REAR EXHAUST PIPE TRIM LH	SERVICEABLE	370.00	-
4	DISTANCE SENSOR @ \$250 EACH	SHORTED (2PCS ONLY)	1,000.00	430.00
1	TAIL LAMP LH	CUT	885.00	587.00
1	TAIL LAMP RH	SERVICEABLE	845.00	-
1	TAIL GATE	BENT	2,365.20	1,600.00
1	END PANEL	TO REPAIR SEE LABOUR	1,230.60	-
1	END PANEL TOP GARNISH	SERVICEABLE	140.00	-
10	BUMPER RIVETS	NECESSARY	60.00	60.00
1	EXHAUST HEAT SHIELD (ADDITIONAL)	BENT	435.60	185.00
1	REAR BUMPER LOWER BRACKET LH (ADDITIONAL)	DISTORTED	95.00	95.00
1	REAR BUMPER LOWER BRACKET RH (ADDITIONAL)	DISTORTED	95.00	95.00
1	REAR REINFORCEMENT (ADDITIONAL)	BUCKLED	619.50	565.50
	LESS 10% DISCOUNT		-1,176.61	-576.85
			10,589.49	5,191.65

Report Ref No. CS/AGI22007172/Kvy3m4



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	<u>SPECIAL NETT ITEMS</u>	CRACKED		
	NUMBER PLATE & HOLDER (SN)		50.00	45.00
			50.00	45.00
	<u>LABOUR</u>	NOT NECESSARY		
	TO REMOVE, REFIT & REPAIR AFFECTED DAMAGED PARTS. INCLUDING TO KNOCK-OUT, WELD & STRAIGHTEN ON THE AFFECTED PARTS. INCLUSIVE OF THE REPAIR OF REAR BUMPER CENTER BOTTOM CARRIER AND END PANEL.		900.00	500.00
	TO RESET ENGINE WARNING LIGHT (ABS,SRS,ECU MEMORY & ETC).		300.00	-
	TO APPLY ANTI RUST COATING.		150.00	30.00
	TO REMOVE, REFIT & UPHOLSTERY TO FACILITATE REPAIRS.		150.00	60.00
	TO REMOVE & REPLACE BUMPER SENSORS.		60.00	60.00
	TO CHECK & RECONNECT ALL NECESSARY WIRING.		80.00	20.00
	TO SPRAY PAINT ON THE AFFECTED AREAS.		900.00	600.00
			2,540.00	1,270.00
GRAND TOTAL			13,179.49	6,506.65
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				5,200.00

Report Ref No. CS/AGI22007172/Kvy3m4

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.