11/7/22, 5:41 PM Adjuster Report

#### LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

#### VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/CTI22007179/TQY3E2

**Date:** 07/11/2022

Engine No:

Odometer:

Chassis No:

**REFERENCE** 

Handling Insurer: China Taiping Insurance

(Singapore) Pte. Ltd.

Policy No: DMCVSNW00125502101

**Claimant Vehicle** 

No:

SKA7035T

Insured Vehicle No :

GBJ9445P

Date of Loss: 24/07/2022

Nature of Claim: TP

Claim SNM22D2

SNM22D205235/C02/LEEPG

**HIDDEN** 

149611 km

ANH208171825

**DESCRIPTION & IDENTIFICATION OF VEHICLE** 

Reg No: SKA7035T

Make & Model: TOYOTA VELLFIRE, 2.4 Z (A)

Reg. Date: 01/03/2011 (Man. Year: 2011)

Colour: White Engine Capacity: 2362 cc

Engine Capacity: 236: Market Value/New Car Price: N/A

Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

**CONDITION OF TYRES** 

Front Tyre Size: 255/40 R19 Rear Tyre Size: 255/40 R19
Front Left Side: Habilead 6 mm Rear Left Side: Habilead 6 mm
Front Right Side: Habilead 6 mm Rear Right Side: Habilead 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

**INSPECTION** 

Date of Assignment: 28/07/2022

Garage 13 Pte Ltd (HQ)

Date Inspected: 27/07/2022 Inspected At: 8 Kaki Bukit Ave 4, Premier @ Kaki Bukit, #03-46

Singapore 415875

Estimated Period of Repair: 4.0 days

Adjuster: MOHD TAUFIKH BIN HAMID Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

11/7/22, 5:41 PM Adjuster Report

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION. THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$3,000.00 -\$4,000.00

11/7/22, 5:41 PM Adjuster Report

## **REPAIR DETAILS**

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 07 Nov 2022)

Parts: M1-MPV TOYOTA VELLFIRE 2.4 Z (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for SKA7035T)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the

END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk \*.

## **Recommended Parts**

There are no new parts selected.

Report was unsubmitted during this print-out.

11/7/22, 5:41 PM Adjuster Report

# Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >