

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

ERGO Insurance Pte. Ltd.
8 Temasek Boulevard, #04-01 Suntec Tower Three
Singapore 038988

Our File No: CS/EGI22007201/KQY3Q2**Date:** 30/08/2022**REFERENCE**

Insured/Claimant:	CHUA YAO SHENG	Policy No:	DMPG22000738	
Date of Loss:	27/07/2022	Nature of Claim:	OD	Claim No: CDMPG22001500

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SJV1146Y		
Make & Model:	HYUNDAI AVANTE, 1.6 HD (M)	Engine No:	G4FC9U776058
Reg. Date:	13/01/2010 (Man. Year: 2009)	Chassis No:	KMH DU41BLAU942598
Colour:	Black	Odometer:	279427 km
Engine Capacity:	1591 cc		
Market Value/New Car Price:	S\$21,000.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:		Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	

CONDITION OF TYRES

Front Tyre Size:	205/55 R16	Rear Tyre Size:	205/55 R16
Front Left Side:	Tourador 6 mm	Rear Left Side:	Tourador 6 mm
Front Right Side:	Tourador 6 mm	Rear Right Side:	Tourador 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	10,822.40	10,490.70	331.70	3.06
Miscellaneous Items	0.00	0.00	0.00	
Labour	2,070.00	1,730.00	340.00	16.43
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	12,892.40	12,220.70	671.70	5.21
Approved Total (Overridden) (S\$)		9,800.00		
- Excess (S\$)	0.00	500.00	-500.00	
(S\$)	12,892.40	9,300.00	3,592.40	27.86
+ GST 7.00/7.00% (S\$)	902.47	651.00	251.47	27.86
Nett Amount (S\$)	13,794.87	9,951.00	3,843.87	27.86

INSPECTION

Date of Assignment:	28/07/2022	Present Location:	Alan's United Auto Pte Ltd (HQ)
Date Inspected:	28/07/2022	Inspected At:	Alan's United Auto Pte Ltd (HQ) Blk 7 Sin Ming Industrial Estate, #01-76 Singapore 575642
Estimated Period of Repair:	8.0 days		

Adjuster: KENNETH KONG**Manager:** SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 30 Aug 2022)
Parts:	143	HYUNDAI AVANTE 1.6 HD (M) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SJV1146Y)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*STEERING AIR BAG	Burst	950.00 F	*950.00 F
2	1		*STEERING AIR BAG COIL SPRING	Necessary	180.00 F	*180.00 F
3	2		*FRONT SAFETY BELT	Jammed	2,300.00 F	*2,300.00 F
4	2		*FRONT AIR BAG SENSOR	Necessary	230.00 F	*230.00 F
5	1		*AIR BAG CONTROL UNIT	Necessary	530.00 F	*530.00 F
6	1		*BONNET	Buckled	620.00 F	*620.00 F
7	1		*BONNET INSULATOR	Serviceable	175.00 F	*- F
8	2		*BONNET HINGE	Repair	110.00 F	*- F
9	1		*BONNET INNER LOCK	Distorted	62.00 F	*62.00 F
10	1		*BONNET INNER LOCK COVER	Serviceable	12.00 F	*- F
11	1		*BONNET RUBBER	Cut	22.00 F	*22.00 F
12	2		*FRONT FENDER	Buckled / Bent	510.00 F	*510.00 F
13	2		*FRONT FENDER VVT EMBLEM	Necessary	32.00 F	*32.00 F
14	2		*HEADLAMP	Mtg Cracked	660.00 F	*660.00 F
15	2		*HEADLAMP LOWER BRACKET	Cracked	100.00 F	*100.00 F
16	1		*FRONT GRILLE	Cracked	365.00 F	*365.00 F
17	1		*FRONT SUPPORT PANEL	Bent	420.00 F	*420.00 F
18	1		*ENGINE TOP COVER	Cracked	210.00 F	*210.00 F
19	1		*LH FUSE BOX HOLDER -TOP	Cracked	36.00 F	*36.00 F
20	1		*LH FUSE BOX HOLDER -BOTTOM	Cracked	70.00 F	*70.00 F
21	1		*AIR INTAKE DUCT	Cracked	155.00 F	*155.00 F
22	1		*AIR CON CONDENSER	Punctured	330.00 F	*330.00 F
23	1		*RADIATOR ASSY -M	Housing Cracked	350.00 F	*350.00 F
24	1		*RADIATOR FAN ASSY	Cracked	380.00 F	*380.00 F
25	1		*RADIATOR TOP HOSE	Punctured	52.00 F	*52.00 F
26	1		*RADIATOR LOWER HOSE	Cut	46.00 F	*46.00 F
27	1		*FRONT BUMPER FASCIA	Cracked	300.00 F	*300.00 F
28	1		*FRONT BUMPER REINFORCEMENT	Bent	190.00 F	*190.00 F
29	1		*FRONT BUMPER SPONGE	Cracked	95.00 F	*95.00 F
30	1		*FRONT BUMPER LOWER GRILLE	Distorted	60.00 F	*60.00 F
31	2		*FRONT BUMPER SIDE RETAINER	Distorted	32.00 F	*32.00 F
32	1		*BATTERY	Cracked	160.00 FS	*160.00 FS
33	1		*FRONT NO.PLATE WITH BOX	Bent	50.00 FS	*45.00 FS
34	1		*RADIATOR COOLANT	Necessary	30.00 FS	*30.00 FS
35	1		*FRONT BUMPER CLIP (SET)	Necessary	40.00 FS	*40.00 FS

F=Franchise part. S=SpcNett.

Sub Total (\$\$)	9,864.00	9,562.00
+ Margin on L,N Items 10.00/10.00% (\$\$)	958.40	928.70
Total Parts (\$\$)	10,822.40	10,490.70

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REWIRE DAMAGED PARTS & REFOCUS HEADLAMP BEAM	New	20.00	20.00
2	TO REMOVE AIR CON CONDENSER,PIPES & DRIER,VACUUM & TO RECHARGE GAS	New	120.00	100.00
3	TO PUTTY AND SPRAY REPLACED PARTS	New	900.00	800.00
4	TO REMOVE ,CUT OUT DAMAGED PARTS,PANEL BEATING,WELDING,ALIGN,REFIX AND TO RENEW ABOVE PARTS	New	800.00	600.00
5	TO REMOVE & RENEW STEERING AIR BAG,SAFTEY BELT,AIR BAG CONTROL UNIT ,DIAGNOS,PROGRAMME,RESET AIR BAG SYSTEM	New	150.00	150.00
6	TO TRANSFER FUSE BOX	New	80.00	60.00
Gross Labour Cost (\$\$)			2,070.00	1,730.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >