

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com; cs-a@lkkauto.com; admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC6/AIG22007258/APA3Q2**Date:** 02/08/2023**REFERENCE**

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	7990000064
Claimant Vehicle No :	SMN786M	Insured Vehicle No :	GBL2802C
Date of Loss:	21/07/2022	Nature of Claim:	TP
		Claim No:	4376221848SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMN786M		
Make & Model:	TOYOTA VELLFIRE, 3.5 ZA G-EDITION 2WD 5DR (A)	Engine No:	2GRK115193
Reg. Date:	23/08/2016 (Man. Year: 2015)	Chassis No:	GGH300006357
Colour:	Black	Odometer:	190795 km
Engine Capacity:	3456 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	255/35 R20	Rear Tyre Size:	255/35 R20
Front Left Side:	Michelin 6 mm	Rear Left Side:	Michelin 6 mm
Front Right Side:	Michelin 6 mm	Rear Right Side:	Michelin 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	24,160.70	9,564.87	14,595.83	60.41
Miscellaneous Items	0.00	0.00	0.00	
Labour	4,030.00	2,840.00	1,190.00	29.53
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	28,190.70	12,404.87	15,785.83	56.00
Approved Total (Overridden) (S\$)		9,800.00		
Nett Amount (S\$)	28,190.70	9,800.00	18,390.70	65.24
+ Loss of Use (8.0 x S\$100.00/day) (S\$)		800.00		
Nett Liability (S\$)		10,600.00		

INSPECTION

Date of Assignment:	27/07/2022	
Date Inspected:	27/07/2022 Inspected At:	ADVANCE AUTO GARAGE (23 KAKI BUKIT) (HQ) 25 KAKI BUKIT AVE 4 #04-01 VICOM KAKI BUKIT Singapore 415933
Estimated Period of Repair:	7.0 days	

Adjuster: ADRIAN LING**Manager:** CHEW HSIAO TONG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER	Deformed	1,759.40 F	*1,759.40 FL
2	1		*REAR BUMPER CLIPS	Necessary	30.00 FS	*30.00 FS
3	2		*REAR BUMPER SIDE HOLDER	Not Necessary	130.20 F	*- FL
4	1		*REAR BUMPER TOW COVER	Missing	34.50 F	*34.50 FL
5	1		*REAR BUMPER SIDE REFLECTOR	N/S Cracked	119.60 F	*59.80 FL
6	1		*REAR BUMPER LOWER SPOILER	Deformed	1,200.00 FS	*880.00 FS
7	1		*REAR BUMPER UNDERCOVER LH	Deformed	290.70 F	*290.70 FL
8	1		*REAR BUMPER UNDERCOVER CLIPS	Necessary	20.00 FS	*20.00 FS
9	2		*REAR BUMPER IMPACT BRACKET	Not Necessary	138.40 F	*- FL
10	4		*REVERSE SENSOR	Damaged (3 PCS ONLY)	1,160.00 F	*870.00 FL
11	4		*REVERSE SENSOR HOLDER	Necessary	100.00 F	*100.00 FL
12	1		*REVERSE SENSOR WIRE HARNESS	Not Necessary	288.10 F	*- FL
13	1		*REAR END PANEL	Dented	781.90 F	*781.90 FL
14	1		*REAR END PANEL TOP GARNISH	Deformed	245.40 F	*245.40 FL
15	1		*REAR END PANEL TOP GARNISH CLIPS	Necessary	20.00 FS	*20.00 FS
16	1		*REAR END PANEL SEALANT	Necessary	60.00 FS	*60.00 FS
17	1		*REAR END PANEL ANTENNA SENSOR	Not Necessary	195.40 F	*- FL
18	1		*REAR END PANEL BUZZER	Not Necessary	124.20 F	*- FL
19	1		*TAILLAMP LH	Cut	689.20 F	*689.20 FL
20	1		*TAILLAMP LOWER APRON LH	Deformed	348.60 F	*348.60 FL
21	1		*TAILGATE	Dented	2,040.50 F	*1,905.00 FL
22	1		*TAILGATE LOCK	Damaged	498.40 F	*498.40 FL
23	1		*TAILGATE AUTO LOCK MOTOR	Not Necessary	2,812.70 F	*- FL
24	1		*TAILGATE WEATHERSTRIPE	Cut	324.70 F	*324.70 FL
25	2		*TAILGATE AUTO LOCK SIDE SENSOR	Not Necessary	1,490.20 F	*- FL
26	1		*TAILGATE INNER TRIM BOARD	Deformed	734.50 F	*734.50 FL
27	1		*TAILGATE INNER TRIM BOARD CLIPS	Necessary	30.00 FS	*30.00 FS
28	1		*TAILGATE REFLECTOR LH	Cut	585.40 F	*585.40 FL
29	1		*TAILGATE GLASS MOULDING	Necessary	185.40 F	*185.40 FL
30	1		*TAILGATE GLASS SEALANT	Necessary	60.00 FS	*60.00 FS
31	1		*VELLFIRE EMBLEM	Necessary	85.90 F	*85.90 FL
32	1		*EXECUTIVE LOUNGE EMBLEM	Necessary	90.40 F	*90.40 FL
33	1		*V6 EMBLEM	Necessary	58.90 F	*58.90 FL
34	2		*REAR CENTRE RAIL	Not Necessary	2,460.20 F	*- FL
35	1		*REAR CENTRE RAIL COVER	N/S Deformed	419.60 F	*209.80 FL
36	1		*REAR CENTRE RAIL UTILITY TRAY	Not Necessary	294.80 F	*- FL
37	1		*REAR FENDER INNER TRIM BOARD	N/S Cracked	1,799.00 F	*899.50 FL
38	1		*REAR FENDER INNER TRIM BOARD CLIPS	Necessary	60.00 FS	*30.00 FS
39	1		*FLOOR PANEL	Repair	818.20 F	*- FL
40	1		*FLOOR PANEL TOP BOARD LH	Deformed	489.10 F	*489.10 FL
41	1		*FLOOR PANEL TOP CENTRE BOARD	Not Necessary	281.90 F	*- FL
42	1		*FLOOR PANEL SORROUND MAT	Not Necessary	755.30 F	*- FL
43	1		*FLOOR PANEL SORROUND MAT CLIPS	Not Necessary	50.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	24,160.70	12,376.50
- List Item Discount on L Items 0.00/25.00% (\$\$)	0.00	2,811.63
Total Parts (\$\$)	24,160.70	9,564.87

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEATING	New	1,600.00	1,100.00
2	SPRAY PAINTING	New	1,400.00	1,200.00
3	WIRING	New	100.00	30.00
4	TO APPLY TUFF COAT	New	150.00	80.00
5	TO REMOVE UPHOLSTERY	New	150.00	80.00
6	TO REMOVE REVERSE SENSOR	New	100.00	50.00
7	TO REMOVE REAR CAMERA	New	100.00	50.00
8	TO REMOVE REAR VIDEO RECORDER	New	100.00	50.00
9	TO TRANSFER TAILGATE FITTINGS	New	150.00	80.00
10	TO REMOVE TAILGATE GLASS	New	180.00	120.00
Gross Labour Cost (S\$)			4,030.00	2,840.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >