

# LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

## VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/CTI22007395/EQY3E2

Date: 05/08/2022

### REFERENCE

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMCVSNW00113912101  
Claimant Vehicle No: GBG5547X Insured Vehicle No: GBG6021P  
Date of Loss: 30/07/2022 Nature of Claim: TP Claim No: SNM22D205371/C02/IRENE

### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: GBG5547X  
Make & Model: TOYOTA DYNA 1.5T, 3.0 (A) Engine No: 1KD2744287  
Reg. Date: 30/08/2017 (Man. Year: 2017) Chassis No: JTFAT35Y10K208945  
Colour: Silver Odometer: 227307 km  
Engine Capacity: 2982 cc  
Market Value/New Car Price: N/A  
Sum Insured (\$\$): Market Value/New Car Price

### CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes  
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

### CONDITION OF TYRES

Front Tyre Size: 195 R15C Rear Tyre Size: 195 R15C  
Front Left Side: Dunlop 4 mm Rear Left Side: Dunlop 4 mm  
Front Right Side: Dunlop 4 mm Rear Right Side: Dunlop 4 mm

*The above values represent the remaining tyre treads depth*

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Nett Amount (\$\$)</b>	<b>0.00</b>	<b>0.00</b>	<b>0.00</b>	

### INSPECTION

Date of Assignment: 03/08/2022  
Date Inspected: 03/08/2022 Inspected At: Ride Now Pte. Ltd. (HQ)  
1 Bukit Batok Crescent, #04-40 WCEGA Plaza  
Singapore 658064  
Estimated Period of Repair: 10.0 days

Adjuster: CHEN TSUE YEE

Manager: SHIAU CHAN

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.  
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$6,000.00  
-\$7,000.00

# REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 05 Aug 2022)	
Parts:	N/A	TOYOTA DYNA 1.5T 3.0 (A) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for GBG5547X)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

## Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.
-----------------------------------------------

# Recommended Miscellaneous Items

There are no new miscellaneous items selected.

# Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.
-----------------------------------------------

< END OF ESTIMATES >