

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI22007404/ECY3Q2**Date:** 16/09/2022**REFERENCE**

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMCVSNW00102542101

Claimant Vehicle No : SBS6384D **Insured Vehicle No :** XE4281T

Date of Loss: 30/07/2022 Nature of Claim: TP Claim No: SNM22D205393/C02/LEEPG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SBS6384D**

Make & Model: MERCEDES-BENZ CITARO O530, 6.4 D (A) Engine No: 902926C0995691

Reg. Date: 01/04/2013 (Man. Year: 2012) Chassis No: WEB62808323124797

Colour: Multi-colour Odometer: 504966 km

Engine Capacity: 6374 cc

Market Value/New Car Price: N/A

Sum Insured (\$\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 295/80 R22.5 Rear Tyre Size: 295/80 R22.5

Front Left Side: Michelin 4 mm Rear Left Side: Michelin 4 mm

Front Right Side: Michelin 4 mm Rear Right Side: Michelin 4 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	1,020.00	918.00	102.00	10.00
Miscellaneous Items	0.00	0.00	0.00	
Labour	600.00	450.00	150.00	25.00
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (\$\$)	1,620.00	1,368.00	252.00	15.56
+ GST 7.00/7.00% (\$\$)	113.40	95.76	17.64	15.56
Nett Amount (\$\$)	1,733.40	1,463.76	269.64	15.56

INSPECTION

Date of Assignment: 03/08/2022

Date Inspected: 04/08/2022 Inspected At: Boxfresh Pte Ltd (HQ)
154 GUL CIRCLE
Singapore 629611

Estimated Period of Repair: 2.0 days

Adjuster: CHEN TSUE YEE**Manager:** CELINE FONG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 15 Sep 2022)	
Parts:	N/A	MERCEDES-BENZ CITARO O530 6.4 D (A) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SBS6384D)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REPLACEMENT OF SHATTERED GLASS	Broken	1,020.00 F	*1,020.00 FL
						F=Franchise part. L=ListItemDisc.
					Sub Total (\$\$)	1,020.00 1,020.00
					- List Item Discount on L Items 0.00/10.00% (\$\$)	0.00 102.00
					Total Parts (\$\$)	1,020.00 918.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	LABOUR FOR REMOVAL AND INSTALLATION OF NEW GLASS	New	600.00	450.00
Gross Labour Cost (\$\$)			600.00	450.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >