AUTO PERFORMANCE APPRAISAL



VEHICLE SURVEY REPORTS

Huang ZhongXiang C/O Sze Kang Automobile Spraying Services 10 Ang Mo Kio Ind. Park 2A Ang Mo Kio Auto Point #03-17 Singapore 568047

1 Reference

Job Reference No

: 22/002505

Claim No

Claim Type

: Third Party

Accident Date

: 01/04/2022 : 26/05/2022

Survey Date Survey Report Date

20/06/2022

2 Particulars Of Vehicle

Vehicle Registration No : SMG8185G

Make & Model

: Subaru Forester 2.0I-S Eyesight

Vehicle Registration Date : 23/03/2019

Chassis No

: JF1SK7KL5KG006297

Engine No

: Blocked

Colour

: Brown

3 **Condition Of Vehicle And Tyres**

Mileage (KM)	<u>Brakes</u>	<u>Steering</u>	Modification
41369	Serviceable	Serviceable	None
<u>Tryes</u> Front RHS Front LHS Rear RHS Rear LHS	Make Bridgestone Bridgestone Bridgestone Bridgestone	<u>Size</u> 225/55R18 225/55R18 225/55R18 225/55R18	Balance (MM) 5 5 6 6

Description Of Damages

The vehicle sustained damages at front left hand portion.

(For information of damages please refer to Parts/Labour/Photographs attached)

5 Instruction

This survey was conducted entirely on a "WITHOUT PREJUDICE" basis, and we have not authorised any repair.

* AUTO PERFORMANCE APPRAISAL

Vehicle Assessment Reports

Ref No:

22/002505

Damage And Repair Cost Adjustment

0.01	0 6	D. (D		Workshop	<u>Our</u>
S/No	Qty	Parts Description	Comments/condition	Estimate (\$)	Assessment (\$)
			List Items		
1	1	Front bumper	Deformed/dented	796.00	796.00
2	1	Front bumper RH fog lamp cover	Broken/deformed	54.00	54.00
3	1	Front bumper LH fog lamp	Broken/cut	272.00	272.00
4	1	Front bumper LH headlamp washer nozzle cover	Serviceable/reuse	54.00	-
.5	1	Front bumper RH headlamp washer nozzle	Serviceable/reuse	82.10	-
6	1	Front bumper LH side retainer	Deformed/broken	26.80	26.80
7	1 set	Front bumper clips	Broken/necessary	30.00	30.00
8	1	Front bumper inner reinforcement	Badly dented/bent	306.00	306.00
9		Front bumper inner foam	Broken	98.20	98.20
10	1	LH headlamp	Cracked/cut	2,380.00	2,380.00
11	1	LH headlamp lower bracket	Deformed/broken	52.00	52.00
12	1	Front grille assy	Broken/cut	660.00	660.00
13	1	Front LH fender	Badly dented/bent	560.00	560.00
14	1	Front fender under shield clips	Necessary	30.00	30.00
15	1	Front support panel	To repair	560.00	-
			-	5.004.40	5.005.00
		Loop diagonat 200/		5,961.10	5,265.00
		Less discount 20%		1,192.22	1,053.00
			Total :	4,768.88	4,212.00
			Total Spare Parts :	4,768.88	4,212.00

AUTO PERFORMANCE APPRAISAL

Vehicle Assessment Reports

Ref No:

22/002505

Damage And Repair Cost Adjustment

<u>Items</u>	Job Description	Workshop Estimate (\$)	Adjusted Costs (\$)
1	To remove, jack out, straighten, panel beating, align and renew replaced parts.	800.00	500.00
2	To putty and respray painting on affected areas.	800.00	600.00
3	To check wirings and lightings.	50.00	30.00
4	To remove, refix aircon condenser, pipes, drier vacuum and recharge gas.	140.00	-
5	To supplied and applied anti rust treatments.	50.00	30.00
	Total Labour :	1,840.00	1,160.00
	Total Spare Parts : Total Labour : Total Repair Costs :	4,768.88 1,840.00 6,608.88	4,212.00 1,160.00 5,372.00

Assessor's Recommendation

Repairer Estimate : Our Adjustment :

6,608.88

<u>5,372.00</u>

Remarks

The repairer has agreed to undertake the repair on a lump sum basis of \$4,300.00, with a repair period of 4 working days.

Surveyed By:

Lek Boon Hwee

Automobile Appraiser