

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI22007623/UVY3Q2**Date:** 01/09/2022**REFERENCE**

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMPCSNA00228452102		
Claimant Vehicle No :	SMR5580K	Insured Vehicle No :	SLU5232L		
Date of Loss:	07/08/2022	Nature of Claim:	TP	Claim No:	SNM22D205530/C02/KHONGLH

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMR5580K	Engine No:	CVN005017
Make & Model:	AUDI A4, 1.4 (A)	Chassis No:	WAUZZZF48GA038640
Reg. Date:	31/03/2016 (Man. Year: 2016)	Odometer:	91019 km
Colour:	White		
Engine Capacity:	1395 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	245/40Z R18	Rear Tyre Size:	245/40Z R18
Front Left Side:	Pirelli 6 mm	Rear Left Side:	Pirelli 6 mm
Front Right Side:	Pirelli 6 mm	Rear Right Side:	Pirelli 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	19,132.05	14,207.53	4,924.52	25.74
Miscellaneous Items	0.00	0.00	0.00	
Labour	4,115.00	3,055.00	1,060.00	25.76
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	23,247.05	17,262.53	5,984.52	25.74
Approved Total (Overridden) (S\$)		13,800.00		
(S\$)	23,247.05	13,800.00	9,447.05	40.64
+ GST 7.00/7.00% (S\$)	1,627.29	966.00	661.29	40.64
Nett Amount (S\$)	24,874.34	14,766.00	10,108.34	40.64

INSPECTION

Date of Assignment:	11/08/2022		
Date Inspected:	11/08/2022	Inspected At:	NPH Auto Service (HQ) Blk 9005 Tampines Steet 93, #01-246/254 Singapore 528839
Estimated Period of Repair:	7.0 days		

Adjuster: MARCUS CHUA**Manager:** VERON CHEN*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS**Reference**

Part Source: MRM-SG	Version: 1.0 (Last Synchronised: 01 Sep 2022)
Parts: 143	AUDI A4 1.4 (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's	(Price-denominated Standard List)
Print Code: (Unsubmitted, no print-code for SMR5580K)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BOOT	Dented / Buckled	3,030.00 FL	*2,823.00 FL
2	2		*REAR BOOT LAMP L&R	Scratched	1,964.00 FL	*1,548.30 FL
3	1		*REAR AUDI LOGO	Necessary	125.00 FL	*108.00 FL
4	1		*REAR A4 EMBLEM	Necessary	90.00 FL	*90.00 FL
5	1		*REAR TFSI EMBLEM	Necessary	93.00 FL	*93.00 FL
6	2		*REAR LAMP ASSEMBLY L&R	Scratched / Cracked	1,964.00 FL	*1,964.00 FL
7	1		*REAR BOOT LOCK	Bent / Twisted	195.00 FL	*195.00 FL
8	1		*REAR BOOT LOCK LOWER CATCH	Not Necessary	48.00 FL	*- FL
9	1		*REAR BUMPER	Distorted	2,262.00 FL	*2,071.00 FL
10	3		*REAR BUMPER PARKING SENSOR	Shorted	1,515.00 FL	*555.00 FL
11	2		*REAR BUMPER SIDE RETAINER L&R	Not Necessary	96.00 FL	*- FL
12	1		*REAR PARKING SENSOR WIRE	Serviceable	707.00 FL	*- FL
13	1		*REAR BUMPER REFLECTOR LAMP L&R	O/S Cracked	80.00 FL	*40.00 FL
14	1		*REAR BUMPER LOWER SPOILER	Distorted	244.00 FL	*244.00 FL
15	1		*REAR BUMPER REINFORCEMENT	Bent	980.00 FL	*905.00 FL
16	1		*REAR BUMPER TOWING COVER	Deformed	50.00 FL	*35.00 FL
17	1		*REAR BUMPER TOP COWLING	Cracked	220.00 FL	*220.00 FL
18	1		*REAR BUMPER CENTER SUPPORT COWLING	Not Necessary	237.00 FL	*- FL
19	1		*REAR BUMPER INNER CENTER END PANEL	Badly Dented	468.00 FL	*468.00 FL
20	1		*REAR SPARE TYRE PANEL	Crumpled / Buckled	2,145.00 FL	*2,015.00 FL
21	6		*REAR BUMPER CLIP	Necessary	42.00 FL	*42.00 FL
22	1		*REAR BUMPER LOWER SIDE COWLING RH	Not Necessary	125.00 FL	*- FL
23	2		*REAR LAMP LOWER BUMPER RETAINER L&R	Bent	70.00 FL	*70.00 FL
24	1		*REAR BUMPER KEYLESS SENSOR	Not Necessary	409.00 FL	*- FL
25	1		*REAR EXHAUST BOX	Repair	1,412.00 FL	*- FL
26	1		*REAR EXHAUST BOX ALUMINIUM COVER	Bent	282.00 FL	*282.00 FL
27	1		*REAR BOOT RUBBER	Twisted	200.00 FL	*200.00 FL
28	1		*REAR CENTER END PANEL INNER CENTER GARNISH	Distorted	170.00 FL	*170.00 FL
29	1		*REAR TOOL BOX	Cracked	137.00 FL	*137.00 FL
30	1		*REAR SPARE TYRE SOUND INSULATOR BOARD	Not Necessary	72.00 FL	*- FL
31	1		*REAR SPARE TYRE BOARD	Warped	707.00 FL	*680.00 FL

F=Franchise part. L=ListItemDisc.

Sub Total (S\$)	20,139.00	14,955.30
- List Item Discount on L Items 5.00/5.00% (S\$)	1,006.95	747.77
Total Parts (S\$)	19,132.05	14,207.53

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	REMOVE REAR BOOT ,REAR LAMP ,REAR BUMPER ,CUT OUT AND RENEW END PANEL ,SPARE TYRE PANEL.KNOCKING REAR FENDER L&R ,RESTRAIGHTEN BODY AND CHASSIS	New	2,200.00	1,600.00
2	CAR -O-LINER	New	350.00	0.00
3	SPRAY PAINTING	New	1,200.00	1,150.00
4	CHECK WIRING SYSTEM	New	25.00	25.00
5	REMOVE AND INSTALL REAR BOT CARPET	New	100.00	80.00
6	RENEW PARKING SENSOR & REPROGRAMME	New	120.00	100.00
7	REMOVE AND INSTALL REAR EXHAUST BOX	New	120.00	100.00
			Gross Labour Cost (\$)	3,055.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >