

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI22007635/EVY3Q2**Date:** 18/08/2022**REFERENCE**Handling Insurer: China Taiping Insurance
(Singapore) Pte. Ltd.

Policy No: DMCVSNW00030432102

**Claimant Vehicle
No :** SLN4238P**Insured Vehicle
No :** GBB6567H

Date of Loss: 01/04/2022

Nature of Claim: TP

Claim
No: SNM22D202285/C02/CSC**DESCRIPTION & IDENTIFICATION OF VEHICLE**Reg No: **SLN4238P**

Make & Model: TOYOTA COROLLA ALTIS, 1.6 (A)

Engine No: 1ZRY339979

Reg. Date: 02/05/2017 (Man. Year: 2016)

Chassis No: MR053REH104560302

Colour: Grey

Odometer: 62173 km

Engine Capacity: 1598 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price****CONDITION OF VEHICLE AT THE TIME OF SURVEY**

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 185/60 R15

Rear Tyre Size: 185/60 R15

Front Left Side: Michelin 4 mm

Rear Left Side: Michelin 4 mm

Front Right Side: Michelin 4 mm

Rear Right Side: Michelin 4 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	904.00	584.00	320.00	35.40
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,030.00	430.00	600.00	58.25
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	1,934.00	1,014.00	920.00	47.57
Approved Total (Overridden) (S\$)		800.00		
(S\$)	1,934.00	800.00	1,134.00	58.63
+ GST 7.00/7.00% (S\$)	135.38	56.00	79.38	58.63
Nett Amount (S\$)	2,069.38	856.00	1,213.38	58.63

INSPECTION

Date of Assignment: 18/08/2022

Date Inspected: 11/08/2022 Inspected At:

Ethoz Automotive Solutions Ltd (HQ)
30, BUKIT BATOK CRESCENT
Singapore 658075

Estimated Period of Repair: 3.0 days

Adjuster: CHEN TSUE YEE**Manager:** VERON CHEN*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 18 Aug 2022)
Parts:	143	TOYOTA COROLLA ALTIS 1.6 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SLN4238P)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER	Dented	482.00 FL	*482.00 FL
2	10		*REAR BUMPER CLIPS	Necessary	50.00 FL	*30.00 FL
3	1		*BOOT LID CHROME MOULDING	Not Necessary	380.00 FL	*- FL
4	1		*END PANEL (NPA)	Not Necessary	0.00 FL	*- FL
5	1		*REVERSE SENSOR	Shorted	220.00 FS	*200.00 FS
					Sub Total (\$\$)	1,132.00
					- List Item Discount on L Items 25.00/25.00% (\$\$)	228.00
					Total Parts (\$\$)	904.00

F=Franchise part. S=SpcNett. L=ListItemDisc.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	LABOUR TO FACILITATE REPAIR	New	500.00	200.00
2	TO RESPRAY AFFECTED AREAS	New	500.00	200.00
3	TO CHECK AND RECONNECT ALL NECESSARY WIRINGS	New	30.00	30.00
Gross Labour Cost (\$)			1,030.00	430.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >