



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
SINGAPORE CIVIL DEFENCE FORCE (MHA05)		Ref:	CS3/SCD22004508/Eqy3e2-1
91 UBI AVE 4		Date:	24/08/2022
SINGAPORE 408827			
SINGAPORE 408827			
ATTN: RALF TAY		Code:	SCD
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	YN 4077H	Veh. Inspected	YP 8711Z
Policy No.		Coverage (\$)	0.00
Claim No.	2022 - 48	Excess (\$)	0.00
Assign From	RALF TAY	Assign Date	11/08/2022
2. Vehicle Particulars & Condition			
Make & Model	ISUZU NPR75	c.c	5193
Engine No.	HIDDEN	Year of Reg.	2018
Chassis No.	JAANPR75HJ7100505	Colour	WHITE
Odometer	143096 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	FAIR		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	195 R15C	GOODYEAR	4 mm
L/H Front Tyre	195 R15C	GOODYEAR	4 mm
R/H Rear Tyre	195 R15C	GOODYEAR	4 mm
L/H Rear Tyre	195 R15C	GOODYEAR	4 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.			
DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	09/05/2022	Inspection Date	13/05/2022
Survey held at	ASTUTE AUTOWORKS PTE LTD 60 JALAN LAM HUAT, #02-16/17, CARROS CENTRE SINGAPORE 737869		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. YP 8711Z

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR CABIN PANEL	TO REPAIR SEE LABOUR	3,024.60	-
1	AIR INTAKE DUCT - BEFORE AIR CLEANER	NOT NECESSARY	476.20	-
1	AIR INTAKE DUCT - AFTER AIR CLEANER	DEFORMED	386.30	386.30
1	AIR INTAKE DUCT CLIP - AFTER AIR CLEANER	BENT	45.20	45.20
1	RHS TAIL LAMP	BROKEN	293.20	293.20
1	NUMBER PLATE LAMP	NOT NECESSARY	184.20	-
	LESS 15% DISCOUNT		-661.45	-108.70
			3,748.25	616.00
<u>SPECIAL NETT ITEMS</u>				
1	REAR WOODEN TAILGATE (SN)	WARPED	3,800.00	1,300.00
1	REAR TAILGATE LOCK WITH PIN (SN)	NOT NECESSARY	180.00	-
1	REAR RHS WOODEN SIDEGATE (SN)	NOT NECESSARY	3,800.00	-
1	REAR WOODEN TAILGATE SUPPORT (SN)	CRACKED	500.00	300.00
1	REAR WOODEN NUMBER PLATE SUPPORT (SN)	BROKEN	300.00	200.00
1	REAR NUMBER PLATE BRACKET (SN)	BENT	250.00	150.00
1	REAR NUMBER PLATE (SN)	BENT	50.00	40.00
1	SET REVERSE CAMERA (SN)	NOT NECESSARY	380.00	-
1	SET REVERSE SENSOR (SN)	MALFUNCTION	280.00	200.00
1	RHS WOODEN FLATBED SUPPORT (SN)	BROKEN	1,200.00	700.00
1	RHS WOODEN FLATBED SUPPORT ALUMINIUM PLATE COVERING (SN)	NECESSARY	180.00	180.00
3	REAR TAILGATE HINGES (SN)	BENT	360.00	360.00
1	REAR BUMPER BAR (SN)	BENT	650.00	650.00
2	REAR BUMPER BAR BRACKET (SN)	BENT	400.00	300.00
6	U CLAMP (SN)	BENT	720.00	400.00
1	TAILGATE PERIMETER METAL FRAME (SN)	BENT	380.00	380.00
1	TAILGATE METAL FRAME BRACING (SN)	BENT	360.00	360.00
1	SIDEGATE PERIMETER METAL FRAME (SN)	NOT NECESSARY	380.00	-
1	SIDEGATE METAL FRAME BRACING (SN)	NOT NECESSARY	360.00	-

Report Ref No. CS3/SCD22004508/Eqy3e2-1



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET BOLTS / NUTS / SCREWS (SN)	NECESSARY	200.00	100.00
			14,730.00	5,620.00
	LABOUR			
	REPAIR / REPLACE DAMAGED PARTS LISTED ABOVE. INCLUSIVE OF THE REPAIR OF REAR CABIN PANEL.		1,200.00	900.00
	USE OVERHEAD CRANE TO LIFT UP REAR FLATBED TO FACILITATE REPAIRS AND CHANGE RHS WOODEN FLATBED SUPPORT.		800.00	400.00
	CHECK REAR LIGHTINGS & WIRING.		50.00	30.00
	REPLACE REVERSE SENSORS.		120.00	30.00
	REPLACE AND CALIBRATE REVERSE CAMERA.	NOT NECESSARY	250.00	-
	SPRAY PAINTING ON REAR CABIN PANEL (INSIDE & OUTSIDE).		600.00	400.00
	SPRAY PAINTING ON REAR WOODEN SUPPORT AND METAL FRAMES.		500.00	200.00
	REMOVE INTERIOR LINING AND SEATS TO FACILITATE REPAIRS TO REAR CABIN PANEL.		300.00	80.00
			3,820.00	2,040.00
GRAND TOTAL			22,298.25	8,276.00
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				6,600.00

Report Ref No. CS3/SCD22004508/Eqy3e2-1

CHEN TSUE YEE

Automotive Assessor

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.