

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS3/FWD22007864/RVY3M4**Date:** 25/08/2022REFERENCE

Handling Insurer: FWD Singapore Pte. Ltd. Policy No: PNPV2020-00005136-02
Claimant Vehicle No : SLA9200H **Insured Vehicle No :** SML5308M
 Date of Loss: 15/08/2022 Nature of Claim: TP Claim No: 1202200025500

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SLA9200H**
 Make & Model: TOYOTA COROLLA ALTIS, 1.6 (A) Engine No: 1ZR552018
 Reg. Date: 22/03/2016 (Man. Year: 2015) Chassis No: MR053REH104545529
 Colour: Grey Odometer: 200311 km
 Engine Capacity: 1598 cc
 Market Value/New Car Price: N/A
 Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
 Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 205/55 R16 Rear Tyre Size: 205/55 R16
 Front Left Side: Yokohama 6 mm Rear Left Side: Yokohama 6 mm
 Front Right Side: Yokohama 6 mm Rear Right Side: Yokohama 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment: 17/08/2022
 Date Inspected: 19/08/2022 Inspected At: Perfect Power PI (HQ)
 1 BUKIT BATOK CRESCENT, #06-12 WCEGA
 PLAZA
 Singapore 658064
 Estimated Period of Repair: 4.0 days

Adjuster: MOHD RASUL**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.

B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.

C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$3,000.00
-\$4,000.00

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 25 Aug 2022)

Parts: 143 TOYOTA COROLLA ALTIS 1.6 (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for SLA9200H)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >