

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI22007901/TQY3E2**Date:** 01/02/2023REFERENCEHandling Insurer: China Taiping Insurance
(Singapore) Pte. Ltd.

Policy No: DMHCSNW00014032105

**Claimant Vehicle
No :** SMW6795A**Insured Vehicle
No :** SLJ8945B

Date of Loss: 16/08/2022

Nature of Claim: TP

Claim
No: SNM22D205743/C02/LEWLCDESCRIPTION & IDENTIFICATION OF VEHICLEReg No: **SMW6795A**

Make & Model: AUDI Q3, 1.4 TFSI S TRONIC (17") (A)

Engine No: CZDC04528

Reg. Date: 30/11/2020 (Man. Year: 2020)

Chassis No: WAUZZZF34M1006450

Colour: Grey

Odometer: 50427 km

Engine Capacity: 1395 cc

Market Value/New Car

Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	225/60 R17	Rear Tyre Size:	225/60 R17
Front Left Side:	Bridgestone 6 mm	Rear Left Side:	Bridgestone 6 mm
Front Right Side:	Bridgestone 6 mm	Rear Right Side:	Bridgestone 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	32,930.10	23,801.60	9,128.50	27.72
Miscellaneous Items	0.00	0.00	0.00	
Labour	17,624.00	14,324.00	3,300.00	18.72
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	50,554.10	38,125.60	12,428.50	24.58
+ GST 8.00/8.00% (S\$)	4,044.33	3,050.05	994.28	24.58
Nett Amount (S\$)	54,598.43	41,175.65	13,422.78	24.58

INSPECTION

Date of Assignment: 18/08/2022

Date Inspected: 18/08/2022 Inspected At: 24 Benoi Sector
Repairer: Premium Automobiles Pte Ltd

Estimated Period of Repair: 11.0 days

Adjuster: MOHD TAUFIKH BIN HAMID**Manager:** SHIAU CHAN*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 01 Feb 2023)
Parts:	M1-SUV	AUDI Q3 1.4 TFSI S TRONIC (17") (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SMW6795A)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	3		*FRONT BUMPER	Torn	1,301.00 FS	*1,234.50 FS
2	1		*FRONT BUMPER GRILLE - CENTER	Cracked	242.00 FS	*242.00 FS
3	1		*FRONT BUMPER LOWER GRILLE COVER PLATE	Not Necessary	58.00 FS	*- FS
4	1		*FRONT BUMPER LOWER GRILLE - LH	Missing	124.00 FS	*123.50 FS
5	1		*FRONT BUMPER CLOSING ELEMENT	Not Necessary	212.00 FS	*- FS
6	1		*FRONT BUMPER SPOILER	Torn	426.00 FS	*426.00 FS
7	1		*FRONT BUMPER BRACKET	Not Necessary	24.00 FS	*- FS
8	1		*FRONT BUMPER AIR GUIDE GRILLE - LH	Missing	171.00 FS	*170.50 FS
9	1		*RADIATOR GRILLE	Cracked	1,594.00 FS	*1,594.00 FS
10	1		*RADIATOR STRIKER PLATE	Cut	271.00 FS	*271.00 FS
11	1		*FRONT S-LINE EMBLEM	Not Necessary	47.00 FS	*- FS
12	1		*FRONT 360 CAMERA COVER CAP	Missing	46.10 FS	*46.10 FS
13	1		*FRONT 360 CAMERA	Not Necessary	1,264.00 FS	*- FS
14	1		*FRONT BUMPER FOAM FILLER PIECE	Cracked	114.00 FS	*114.00 FS
15	1		*FRONT BUMPER CARRIER	Bent	974.00 FS	*973.50 FS
16	1		*FRONT BUMPER GUIDE SECTION - LH	Distorted	43.00 FS	*42.80 FS
17	1		*FRONT BUMPER TOP COVER	Cut	137.00 FS	*137.00 FS
18	1		*CAUTION SIGN STICKER	Necessary	16.00 FS	*15.50 FS
19	1		*AIR CONDITIONER STICKER	Necessary	9.00 FS	*8.30 FS
20	1		*HORN SIGNAL HIGH TONE - LH	Cracked	154.00 FS	*153.50 FS
21	1		*HORN BRACKET - LH	Bent	25.00 FS	*24.10 FS
22	1		*FRONT PARKING AID SENSOR (3PCS)	Distorted (1Pc Only)	797.00 FS	*265.00 FS
23	4		*FRONT PARKING AID SEAL RING	Necessary	10.00 FS	*10.00 FS
24	1		*SET FRONT BUMPER WIRING	Torn	750.00 FS	*750.00 FS
25	1		*FRONT FENDER - LH	Bent	1,445.00 FS	*1,445.00 FS
26	1		*FRONT FENDER ATTACHMENT PARTS	Not Necessary	66.00 FS	*- FS
27	1		*FRONT FENDER BRACE - LH	Bent	98.00 FS	*97.10 FS
28	1		*FRONT FENDER BRACKET - LH	Bent	39.00 FS	*38.10 FS
29	1		*FRONT FENDER CLOSING ELEMENT - LH	Broken	37.00 FS	*36.40 FS
30	1		*FRONT FENDER INSULATION - LH	Not Necessary	48.00 FS	*- FS
31	1		*FRONT WHEEL HOUSING LINER - LH	Torn	260.00 FS	*260.00 FS
32	1		*FRONT WHEEL HOUSING LINER ATTACHMENT PARTS	Not Necessary	105.00 FS	*- FS
33	1		*FRONT FENDER COVER - LH	Deformed	18.00 FS	*17.40 FS
34	1		*BONNET	Bent	3,695.00 FS	*3,695.00 FS
35	1		*BONNET HINGE - LH / RH	N/S Bent / O/S Not Necessary	162.00 FS	*80.60 FS
36	1		*BONNET ATTACHMENT PARTS	Not Necessary	309.00 FS	*- FS
37	1		*BONNET IMPACT PROTECTION - CENTER	Cut	31.00 FS	*30.30 FS
38	1		*BONNET STRIKER - LH	Not Necessary	123.00 FS	*- FS
39	1		*FRONT FENDER COVER - LH	Not Necessary	46.00 FS	*- FS
40	1		*FRONT PLENUM CHAMBER COVER	Not Necessary	144.00 FS	*- FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
41	1		*BOWDEN CABLE - CENTER	Not Necessary	64.00 FS	*- FS
42	1		*BOWDEN CABLE COVER	Not Necessary	11.00 FS	*- FS
43	1		*BONNET LATCH ASSEMBLY	Not Necessary	228.00 FS	*- FS
44	1		*BONNET RELEASE ELEMENT	Not Necessary	65.00 FS	*- FS
45	1		*BONNET RELEASE LEVER	Not Necessary	16.00 FS	*- FS
46	1		*BONNET LOCK CABLE - RH	Not Necessary	82.00 FS	*- FS
47	1		*BONNET ACTUATING LEVER - RH	Not Necessary	48.00 FS	*- FS
48	1		*BONNET GAS FILLED STRUT	Not Necessary	110.00 FS	*- FS
49	1		*BONNET SOUND ABSORBER	Not Necessary	244.00 FS	*- FS
50	1		*HEADLIGHT MOUNTING - LH / RH	O/S NotNecessary/N/SCracked	264.00 FS	*131.50 FS
51	1		*HEADLIGHT - LH	Cracked	5,952.00 FS	*5,952.00 FS
52	1		*HEADLIGHT POWER MODULE - LH	Not Necessary	850.00 FS	*- FS
53	1		*HEADLIGHT HEAT SINK - LH	Broken	870.00 FS	*870.00 FS
54	1		*HEADLIGHT HOSE - LH	Not Necessary	28.00 FS	*- FS
55	1		*HEADLIGHT COMPENSATING PIECE	Not Necessary	45.00 FS	*- FS
56	1		*HEADLIGHT LIFT CYLINDER - LH / RH	O/S NotNecessary/N/SDistorted	462.00 FS	*230.50 FS
57	1		*LIFT CYLINDER HOSE	Torn	92.00 FS	*91.80 FS
58	1		*LIFT CYLINDER WASH WATER RESERVOIR	Deformed	240.00 FS	*239.50 FS
59	1		*LIFT CYLINDER CORRUGATED PIPE	Not Necessary	27.00 FS	*- FS
60	2		*FRONT WHEEL COVER - LH / RH	Missing	566.00 FS	*565.00 FS
61	1		*LOCK CARRIER	Cracked	1,412.00 FS	*1,412.00 FS
62	1		*OUTSIDE TEMPERATURE SENSOR BRACKET	Necessary	9.00 FS	*8.10 FS
63	1		*A/C CONDENSER	Not Necessary	605.00 FS	*- FS
64	1		*ADDITIONAL RADIATOR	Not Necessary	984.00 FS	*- FS
65	1		*RADIATOR RUBBER BUSH	Not Necessary	1,093.00 FS	*- FS
66	2		*RUBBER BUSH - UPPER	Not Necessary	90.00 FS	*- FS
67	2		*RUBBER BUSH - LOWER	Not Necessary	22.00 FS	*- FS
68	1		*RADIATOR AIR GUIDE - LH	Broken	43.00 FS	*42.60 FS
69	1		*RADIATOR AIR GUIDE - UPPER / LOWER (Upper Not Necessary)	Lower Broken	96.00 FS	*47.30 FS
70	6		*RADIATOR COOLANT	Necessary	297.00 FS	*296.40 FS
71	1		*RADIATOR INTAKE AIR DUCT COVER	Not Necessary	30.00 FS	*- FS
72	1		*AIR INTAKE LOWER BRACKET	Not Necessary	59.00 FS	*- FS
73	1		*AIR INTAKE INNER BRACKET	Not Necessary	21.00 FS	*- FS
74	1		*AIR INTAKE WATER DRAINAGE	Not Necessary	23.00 FS	*- FS
75	1		*AIR INTAKE HOSE	Not Necessary	36.00 FS	*- FS
76	1		*E BOX - LH	Not Necessary	395.00 FS	*- FS
77	1		*FRONT WINDOW SLOT SEAL - LH	Bent	251.00 FS	*251.00 FS
78	1		*FRONT WINDOW TRIM STRIP - LH	Cut	287.00 FS	*287.00 FS
79	1		*FRONT DOOR COVER - LH	Cut	283.00 FS	*282.50 FS
80	1		*FRONT WINDOW GUIDE - LH	Cut	481.00 FS	*481.00 FS
81	1		*FRONT NO PLATE	Bent	60.00 FS	*60.00 FS
82	1		*SUNDRIES	Necessary	500.00 FS	*99.50 FS
83	1		*FRONT BUMPER CLOSING ELEMENT - LH	Deformed	66.00 FS	*65.40 FS
84	1		*WHEEL LINER CLOSING ELEMENT - LH	Missing	22.00 FS	*21.60 FS
85	1		*WASHER TANK SEAL	Necessary	66.00 FS	*65.70 FS

F=Franchise part. S=SpcNett.

Total Parts (\$\$) **32,930.10** **23,801.60**

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE, CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR, HEADLIGHT WASHER ASSY AND FRONT PARKING AID	New	480.00	480.00
2	TO REMOVE AND TRANSFER LHS HEADLIGHTS CONTROL UNIT AND POWER MODULE	New	400.00	400.00
3	TO REMOVE AND RENEW AIRCON CONDENSER, ADDITIONAL RADIATOR AND RADIATOR. CHECK ELECTRICAL FANS AND CONTROL UNIT. PRESSURISE COOLING SYSTEM	New	1,600.00	1,600.00
4	TO CARRY OUT VACUUM AND REGAS FOR R1234	New	1,200.00	1,200.00
5	TO REMOVE AND REINSTALL LHS FRONT DOOR PANEL TRIM. TO REMOVE AND REINSTALL LHS WING MIRROR ASSY TO FACILITATE RESPRAY OF LHS FRONT DOOR	New	280.00	280.00
6	TO DISMANTLE AND RENEW FRONT BUMPER, LHS FRONT FENDER, BONNET AND LHS HEADLIGHT. TO REPAIR LHS FRONT DOOR, LHS FRONT FENDER TOP SUPPORT AND LHS UPPER A-PILLAR. TO RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	New	7,000.00	5,200.00
7	TO RESPRAY FRONT BUMPER, BONNET, HINGES, LHS FRONT FENDER, LHS FRONT FENDER TOP SUPPORT, LHS UPPER A-PILLAR AND LHS FRONT DOOR	New	6,000.00	4,500.00
8	TO TOW BACK THE VEHICLE FROM ACCIDENT SCENE	New	280.00	280.00
9	TO CARRY OUT PRE/POST DIAGNOSTIC CHECK	New	384.00	384.00
Gross Labour Cost (\$\$)			17,624.00	14,324.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >