



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SGQ 3375B

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	REAR BUMPER	BUCKLED	974.70	688.90
1	REAR BUMPER SIDE RETAINER	DISTORTED	73.40	73.40
1	REAR BUMPER TOW COVER	SERVICEABLE	69.30	-
1	REAR TAIL LAMP	CUT	782.60	458.60
1	REAR FENDER	BENT	1,067.56	975.20
1	REAR FENDER LOWER INNER TRIM	SERVICEABLE	754.80	-
1	REAR FENDER FUEL INLET COVER	TO REPAIR SEE LABOUR	154.20	-
1	REAR FENDER FUEL INLET PIPE	SERVICEABLE	396.40	-
1	REAR FENDER QUARTER GLASS MOULDING	NECESSARY	574.20	82.40
1	REAR DOOR L/H	TO REPAIR SEE LABOUR	1,331.16	-
1	REAR DOOR OUTER HANDLE	SERVICEABLE	345.20	-
1	REAR DOOR WEATHERSTRIP	SERVICEABLE	298.60	-
1	REAR SHOCK ABSORBER	BENT	596.70	299.60
1	REAR WHEEL HUB }	BENT	488.40	339.00
2	REAR WHEEL BEARING }	NECESSARY	468.40	-
1	REAR KNUCKLE ARM	BENT	357.20	357.20
1	REAR LOWER ARM	DISTORTED	569.40	384.10
1	REAR UPPER CONTROL ARM	SERVICEABLE	366.10	-
	LESS 20% DISCOUNT		-1,933.66	-731.68
			7,734.66	2,926.72
<b><u>SPECIAL NETT ITEMS</u></b>				
1	TUBE FENDER GLASS SEALANT (SN)	NECESSARY	60.00	30.00
1	SET SUNDRIES (CLIPS, BOLTS, NUTS ETC) (SN)	NOT NECESSARY	50.00	-
1	ALLOY RIM (SN)	DENTED	650.00	250.00
			760.00	280.00
<b><u>LABOUR</u></b>				
	TO REMOVE & REPLACE PARTS, REALIGN & PANEL BEAT THE AFFECTED AREAS. INCLUSIVE OF THE REPAIR OF REAR FENDER FUEL INLET COVER AND REAR DOOR L/H.		1,200.00	650.00

Report Ref No. CS/INC22007910/Kqy3e2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO CHECK WIRING SYSTEM.		50.00	20.00
	TO SPRAY PAINTING ON AFFECTED AREAS.		1,100.00	600.00
	TO DRAIN FUEL, REMOVE AND REFIT FUEL TANK.		80.00	60.00
	TO APPLY RUST PROOFING.		120.00	30.00
	TO INSTALL REVERSE SENSOR.		80.00	50.00
	TO REMOVE AND REFIT CABIN INTERIORS TO ENABLE REPAIR WORKS.		180.00	100.00
	TO REMOVE AND REFIT SIDE WINDSCREEN GLASS.		140.00	60.00
	TO APPLY WATER PROOF SEALANT ON JOINTED PANELS.		150.00	30.00
	TO REMOVE AND REPLACE REAR UNDER CARRIAGE PARTS.		220.00	160.00
	TO PERFORM WHEEL ALIGNMENT.		85.00	60.00
	TO REPLACE ALLOY RIM AND BALANCE WHEEL.		40.00	20.00
	TO TRANSFER DOOR ACCESSORIES.	NOT NECESSARY	60.00	-
			3,505.00	1,840.00
	<b>GRAND TOTAL</b>		<b>11,999.66</b>	<b>5,046.72</b>

<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION) (CONFIRMED)</b>				<b>4,000.00</b>
---	--	--	--	-----------------

Report Ref No. CS/INC22007910/Kqy3e2

KONG SENG CHEONG

Licensed Appraiser

K.K.LAU CPT(RET)

BEng(Hons),B.Bus,MBA,PEng,PE,  
MInstAEA,MASME,MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.