

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS3/CTI22007926/RVY3M4**Date:** 31/08/2022**REFERENCE**

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMPCSNW00179632201

Claimant Vehicle No : FBU629C **Insured Vehicle No :** SNB2643E

Date of Loss: 12/08/2022 Nature of Claim: TP Claim No: SNM22D205706/C02

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **FBU629C**

Make & Model: YAMAHA XSR155 MANUAL, 155cc Engine No: G3J6E0328485

Reg. Date: 28/07/2022 (Man. Year: 2021) Chassis No: MH3RG4760MK026239

Colour: Black Odometer: 0 km

Engine Capacity: 155 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 110/70-17 Rear Tyre Size: 140/70-17

Front Left Side: TRAIL WINNER 4 mm Rear Left Side: TRAIL WINNER 4 mm

Front Right Side: 0 mm Rear Right Side: 0 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment: 26/08/2022

Date Inspected: 19/08/2022 Inspected At: UNITED CYCLES LLP (HQ)
25 KAKI BUKIT ROAD 4
#01-25 SYNERGY @ KB SINGAPORE 417800

Estimated Period of Repair: 3.0 days

Adjuster: MOHD RASUL**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$1,000.00
-\$2,000.00

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 31 Aug 2022)	
Parts:	N/A	YAMAHA XSR155 MANUAL 155cc (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for FBU629C)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >