

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS3/AIS22007978/TVY3M4**Date:** 14/10/2022REFERENCE

Handling Insurer: Allianz Insurance Singapore Pte. Ltd. Policy No: SP2002472960-01
Claimant Vehicle No : SKJ8169L **Insured Vehicle No :** GBH6052U
 Date of Loss: 17/08/2022 Nature of Claim: TP Claim No: 2022 22006217FR

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SKJ8169L**
 Make & Model: HONDA STREAM, 1.8 X (A) Engine No: R18A2102304
 Reg. Date: 24/11/2009 (Man. Year: 2009) Chassis No: RN63102178
 Colour: Grey Odometer: 239151 km
 Engine Capacity: 1799 cc
 Market Value/New Car Price: N/A
 Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
 Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 225/40 R18 Rear Tyre Size: 225/40 R18
 Front Left Side: Goodyear 6 mm Rear Left Side: Goodyear 6 mm
 Front Right Side: Goodyear 6 mm Rear Right Side: Goodyear 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	
Global Sum Settlement (S\$)		0.00		

INSPECTION

Date of Assignment: 19/08/2022
 Date Inspected: 22/08/2022 Inspected At: BENEFIT AUTO CARE PTE LTD
 11 KAKI BUKIT ROAD 1 #01-02
 SINGAPORE 415939
 Estimated Period of Repair: 12.0 days

Adjuster: MOHD TAUFIKH BIN HAMID**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$10,000.00
-\$12,000.00

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 14 Oct 2022)
Parts:	M1-MPV	HONDA STREAM 1.8 X (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SKJ8169L)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >