

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC6/III22008049/UPA3Q2**Date:** 11/10/2022REFERENCE

Handling Insurer: India International Insurance Pte Ltd Policy No: D19MFL0005549_02

Claimant Vehicle No : SLA1215T **Insured Vehicle No :** GBH9810D

Date of Loss: 19/08/2022 Nature of Claim: TP Claim No: MFL2022D0004611

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SLA1215T**

Make & Model: MAZDA 5, 2.0 SP.6EAT SUNROOF (A) Engine No: PE10299237

Reg. Date: 23/02/2016 (Man. Year: 2015) Chassis No: JM6CW1071G0123206

Colour: Grey Odometer: 95699 km

Engine Capacity: 1998 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 205/55 R16 Rear Tyre Size: 205/55 R16

Front Left Side: Michelin 6 mm Rear Left Side: Michelin 6 mm

Front Right Side: Michelin 6 mm Rear Right Side: Michelin 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	26,446.70	10,652.96	15,793.74	59.72
Miscellaneous Items	0.00	0.00	0.00	
Labour	7,430.00	3,190.00	4,240.00	57.07
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	33,876.70	13,842.96	20,033.74	59.14
Approved Total (Overridden) (S\$)		11,000.00		
Nett Amount (S\$)	33,876.70	11,000.00	22,876.70	67.53
+ Car Rental (7.0 x S\$120.00/day) (S\$)		840.00		
+ Doc/Search Fee (S\$)		7.45		
Nett Liability (S\$)		11,847.45		
Global Sum Settlement (S\$)		11,800.00		

INSPECTION

Date of Assignment: 22/08/2022

Date Inspected: 22/08/2022 Inspected At:

Choo Motor Spray Painter (HQ)
1 Kaki Bukit Avenue 6, #01-39 AutoBay @ Kaki
Bukit
Singapore 417883

Estimated Period of Repair: 8.0 days

Adjuster: MARCUS CHUA**Manager:** CHEW HSIAO TONG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	(Last Synchronised: 23 Sep 2022)	
Parts:	N/A	MAZDA 5 2.0 SP.6EAT SUNROOF (A) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SLA1215T)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*TAILGATE	Distorted	2,885.20 F	*1,637.00 FL
2	1		*TAILGATE REAR WINDSCREEN	Shattered	1,621.60 F	*1,121.00 FL
3	1		*REAR WINDSCREEN MOULDING	Necessary	126.30 F	*126.30 FL
4	1		*TAILGATE TOP SPOILER	Serviceable	645.00 F	*- FL
5	1		*TAILGATE WIPER ARM	Cracked	102.90 F	*102.90 FL
6	1		*TAILGATE WIPER BLADE	Bent	98.50 F	*98.50 FL
7	1		*TAILGATE WIPER MOTOR	Jammed	665.00 F	*428.00 FL
8	1		*TAILGATE REAR LOGO	Cracked	48.60 F	*48.60 FL
9	1		*TAILGATE MAZDA EMBLEM	Necessary	42.00 F	*42.00 FL
10	1		*TAILGATE 5 EMBLEM	Necessary	38.00 F	*38.00 FL
11	1		*TAILGATE SKYACTIC EMBLEM	Necessary	60.00 F	*60.00 FL
12	1		*TAILGATE OUTER GARNISH	Cracked	341.80 F	*186.90 FL
13	1		*TAILGATE LICENCE PLATE LAMP	Not Necessary	42.00 F	*- FL
14	2		*TAILGATE REFLECTORS	Cracked	1,370.00 F	*790.00 FL
15	1		*TAILGATE INNER LOCK	Dented / Jammed	299.00 F	*286.90 FL
16	1		*TAILGATE INNER TRIM BOARD	Distorted / Cracked	626.00 F	*421.60 FL
17	1		*SET TAILGATE INNER TRIM BOARD CLIPS	Necessary	50.00 F	*50.00 FL
18	1		*TAILGATE INNER TOP TRIM O/S	Not Necessary	66.00 F	*- FL
19	1		*TAILGATE WEATHERSTRIP	Twisted	285.00 F	*162.60 FL
20	1		*TAILGATE INNER LOCK SWITCH	Damaged	380.00 F	*250.00 FL
21	2		*TAILLAMPS	Cracked / Broken	1,900.00 F	*1,374.00 FL
22	1		*TAILLAMP HOUSING PANELS	N/S Dented / O/S Repair	1,300.00 F	*420.00 FL
23	1		*REAR BUMPER	Distorted	1,541.90 F	*915.40 FL
24	2		*REAR BUMPER REFLECTORS	Cracked	120.00 F	*120.00 FL
25	2		*REAR BUMPER SIDE RETAINERS	Bent	136.00 F	*136.00 FL
26	1		*REAR BUMPER REINFORCEMENT	Bent	425.10 F	*165.20 FL
27	1		*SET REAR BUMPER CLIPS	Necessary	50.00 F	*50.00 FL
28	1		*REAR END PANEL	Badly Dented	580.90 F	*491.10 FL
29	1		*REAR END PANEL TOP GARNISH	Distorted	181.20 F	*181.20 FL
30	1		*REAR FLOOR PANEL	Crumpled / Buckled	1,895.20 F	*1,255.00 FL
31	1		*REAR FLOOR PANEL TOP TRAY	Cracked	455.00 F	*385.00 FL
32	1		*REAR FLOOR PANEL TOP BOARD	Serviceable	615.00 F	*- FL
33	1		*REAR EXHAUST	Repair	1,135.10 F	*- FL
34	1		*REAR EXHAUST HEAT SHIELD	Not Necessary	122.00 F	*- FL
35	2		*REAR FENDERS	Repair	2,910.20 F	*- FL
36	2		*REAR FENDER INNER TRIM BOARDS	Cracked / Twisted	1,576.20 F	*1,198.00 FL
37	1		*REAR WINDSCREEN SEALANT	Necessary	50.00 FS	*40.00 FS
38	1		*REAR WINDSCREEN INNER SEAL	Necessary	50.00 FS	*40.00 FS
39	1		*REAR WINDSCREEN SOLAR FILM	Necessary	200.00 FS	*150.00 FS
40	1		*REAR LICENCE PLATE	Bent	50.00 FS	*40.00 FS
41	1		*SET REAR BUMPER REVERSE SENSOR	Shorted	280.00 FS	*200.00 FS
42	1		*REAR END PANEL SEALANT	Necessary	50.00 FS	*50.00 FS
43	1		*SET REAR FLOOR PANEL INSULATOR	Necessary	150.00 FS	*100.00 FS
44	1		*SET REAR REVERSE CAMERA	Serviceable	380.00 FS	*- FS
45	1		*SET REAR VIEW CAMS	Serviceable	450.00 FS	*- FS
46	1		*REAR LICENCE PLATE	Repeated	50.00 FS	*- FS

Report was unsubmitted during this print-out.

10/11/22, 11:11 AM

Adjuster Report

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
F=Franchise part. S=SpcNett. L=ListItemDisc.						
Sub Total (S\$)					26,446.70	13,161.20
- List Item Discount on L Items 0.00/20.00% (S\$)					0.00	2,508.24
Total Parts (S\$)					26,446.70	10,652.96
Report was unsubmitted during this print-out.						

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO CHECK WIRING	New	50.00	30.00
2	TO DISMANTLE & REPLACE REAR REVERSE SENSOR	New	80.00	50.00
3	TO DISMANTLE & REFIX REAR WINDSCREEN	New	150.00	120.00
4	TO DISMANTLE & REFIX TAILGATE MECHANISM	New	100.00	60.00
5	TO DISMANTLE & REFIX CUSHION UPHOLSTERY	New	120.00	80.00
6	TO REFILL AIR CON GAS	New	100.00	0.00
7	TO SPRAY RUST PROOFING	New	150.00	100.00
8	TO RESET & REPROGRAMME SYSTEM	New	180.00	50.00
9	LABOUR FOR PANEL BEATING & REPLACED PARTS	New	3,500.00	1,500.00
10	TO PUTTY & SPRAY PAINTING	New	3,000.00	1,200.00
Gross Labour Cost (\$\$)			7,430.00	3,190.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >