

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS3/CTI22008197/AVY3E2**Date:** 22/09/2022**REFERENCE**

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMPCSNW00102912202		
Claimant Vehicle No :	SJR2470A	Insured Vehicle No :	SLZ6900J		
Date of Loss:	20/08/2022	Nature of Claim:	TP	Claim No:	SNM22D205872/C02/KHONGLH

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SJR2470A		Engine No:	HIDDEN
Make & Model:	MERCEDES-BENZ C180K, 1.6 (A)		Chassis No:	WDD2040452A260641
Reg. Date:	01/08/2009 (Man. Year: 2009)		Odometer:	150616 km
Colour:	White			
Engine Capacity:	1597 cc			
Market Value/New Car Price:	N/A			
Sum Insured (\$\$):	Market Value/New Car Price			

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	225/40 R18	Rear Tyre Size:	225/40 R18
Front Left Side:	Continental 6 mm	Rear Left Side:	Continental 6 mm
Front Right Side:	Continental 6 mm	Rear Right Side:	Continental 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (\$\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment:	12/09/2022	Mirage Motorwerkz Pte Ltd (HQ) 10 KAKI BUKIT ROAD 2 #01-29 FIRST EAST CENTRE Singapore 417868
Date Inspected:	24/08/2022 Inspected At:	
Estimated Period of Repair:	6.0 days	

Adjuster: ADRIAN LING**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$5,000.00
-\$6,000.00

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 22 Sep 2022)
Parts:	143	MERCEDES-BENZ C180K 1.6 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SJR2470A)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >