

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS3/AIS22008258/RNY3M4**Date:** 19/09/2022**REFERENCE**

Handling Insurer:	Allianz Insurance Singapore Pte. Ltd.	Policy No:	SP2001256008
Claimant Vehicle No :	SFL5211R	Insured Vehicle No :	GBC5721E
Date of Loss:	23/08/2022	Nature of Claim:	TP
		Claim No:	2022 22006330FR

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SFL5211R		
Make & Model:	TOYOTA COROLLA ALTIS, 1.6 Standard (AUTO) (2WD) (A)	Engine No:	1ZR0F18358
Reg. Date:	17/02/2020 (Man. Year: 2020)	Chassis No:	MR2BE3BE300007702
Colour:	Grey	Odometer:	31254 km
Engine Capacity:	1598 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/55 R16	Rear Tyre Size:	205/55 R16
Front Left Side:	Bridgestone 6 mm	Rear Left Side:	Bridgestone 6 mm
Front Right Side:	Bridgestone 6 mm	Rear Right Side:	Bridgestone 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment:	26/08/2022	
Date Inspected:	26/08/2022	Inspected At: PERFECT POWER PTE LTD (HQ) 1 BUKIT BATOK CRESCENT #06-12, WCEGA PLAZA SINGAPORE 658064
Estimated Period of Repair:	5.0 days	

Adjuster: MOHD RASUL**Manager:** HUEY YON

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.

B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.

C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$2,000.00
-\$3,000.00

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 19 Sep 2022)
Parts:	143	TOYOTA COROLLA ALTIS 1.6 Standard (AUTO)(2WD) (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's (Price-denominated Standard List)	
Print Code:	(Unsubmitted, no print-code for SFL5211R)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >