

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way, #09-16
Singapore 079120

Our File No: CC3/AIG22008319/RVCE2**Date:** 01/03/2023**REFERENCE**

Insured/Claimant: PREMIUM AUTOMOBILES PTE LTD
Date of Loss: 24/08/2022

Policy No: 0999993555
Nature of Claim: OD Claim No: 4611910833SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SND490G**
Make & Model: AUDI Q3, 1.4 TFSI (A) Engine No: CZDC47295
Reg. Date: 30/11/2021 (Man. Year: 2021) Chassis No: WAUZZZF33M1150250
Colour: Grey Odometer: 11927 km
Engine Capacity: 1395 cc
Market Value/New Car Price: S\$179,000.00
Sum Insured (\$\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 215/65 R17 Rear Tyre Size: 215/65 R17
Front Left Side: Falken 6 mm Rear Left Side: Falken 6 mm
Front Right Side: Falken 6 mm Rear Right Side: Falken 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	50,531.00	27,478.48	23,052.52	45.62
Miscellaneous Items	0.00	0.00	0.00	
Labour	34,504.00	15,049.00	19,455.00	56.38
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	85,035.00	42,527.48	42,507.52	49.99
- Excess (\$\$)	1,500.00	1,500.00	0.00	0.00
(\$\$)	83,535.00	41,027.48	42,507.52	50.89
+ GST 8.00/8.00% (\$\$)	6,682.80	3,282.20	3,400.60	50.89
Nett Amount (\$\$)	90,217.80	44,309.68	45,908.12	50.89

INSPECTION

Date of Assignment: 29/08/2022
Date Inspected: 26/08/2022 Inspected At: 24 Benoi Sector
Estimated Period of Repair: 15.0 days Repairer: Premium Automobiles Pte Ltd

Adjuster: MOHD RASUL**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Torn	1,301.00 FS	*987.60 FS
2	1		*FRONT BUMPER GRILLE - CENTER	Not Necessary	242.00 FS	*- FS
3	1		*FRONT BUMPER GRILLE - LH	Scratched	124.00 FS	*98.80 FS
4	1		*FRONT BUMPER CLOSING ELEMENT	Not Necessary	212.00 FS	*- FS
5	1		*FRONT BUMPER SPOILER	Scratched	426.00 FS	*340.80 FS
6	1		*FRONT BUMPER BRACKET	Cracked	24.00 FS	*18.56 FS
7	1		*RADIATOR AIR GUIDE GRILLE - LH	Missing	171.00 FS	*136.40 FS
8	1		*RADIATOR GRILLE	Scratched	1,594.00 FS	*1,275.20 FS
9	1		*RADIATOR GRILLE STRIKER PLATE	Not Necessary	271.00 FS	*- FS
10	1		*FRONT BUMPER GUIDE SECTION - LH	Missing	43.00 FS	*34.24 FS
11	1		*FRONT BUMPER FOAM FILLER PIECE	Not Necessary	114.00 FS	*- FS
12	1		*FRONT BUMPER CARRIER	Not Necessary	974.00 FS	*- FS
13	1		*FRONT BUMPER TOP COVER	Broken	137.00 FS	*109.60 FS
14	1		*CAUTION SIGN STICKER	Necessary	16.00 FS	*12.40 FS
15	1		*AIR CONDITIONER STICKER	Necessary	9.00 FS	*6.64 FS
16	1		*HORN SIGNAL HIGH TONE - LH	Not Necessary	154.00 FS	*- FS
17	1		*HORN SIGNAL BRACKET	Not Necessary	25.00 FS	*- FS
18	2		*FRONT PARKING AID SENSOR	Not Necessary	531.00 FS	*- FS
19	4		*FRONT PARKING AID SEAL RING	Not Necessary	10.00 FS	*- FS
20	1		*SET FRONT BUMPER WIRING	Not Necessary	750.00 FS	*- FS
21	1		*FRONT FENDER - LH	Buckled	1,445.00 FS	*1,156.00 FS
22	1		*FRONT FENDER ATTACHMENT PARTS	Not Necessary	66.00 FS	*- FS
23	1		*FRONT FENDER BRACE - LH	Bent	98.00 FS	*77.68 FS
24	1		*FRONT FENDER BRACKET - LH	Bent	39.00 FS	*30.48 FS
25	1		*FRONT FENDER CLOSING ELEMENT - LH	Cracked	37.00 FS	*29.12 FS
26	1		*FRONT FENDER SEAL - LH	Necessary	40.00 FS	*32.00 FS
27	1		*FRONT WHEEL HOUSING LINER - LH	Torn	260.00 FS	*208.00 FS
28	1		*FRONT WHEEL HOUSING LINER ATTACHMENT PARTS	Not Necessary	105.00 FS	*- FS
29	1		*FRONT FENDER COVER - LH	Not Necessary	18.00 FS	*- FS
30	1		*HEADLIGHT MOUNTING - LH	Cracked	132.00 FS	*105.20 FS
31	1		*HEADLIGHT - LH	Broken	5,952.00 FS	*4,761.60 FS
32	1		*HEADLIGHT POWER MODULE	Cracked	850.00 FS	*680.00 FS
33	1		*HEADLIGHT HEAT SINK	Missing	870.00 FS	*696.00 FS
34	1		*HEADLIGHT HOSE - LH	Not Necessary	28.00 FS	*- FS
35	1		*HEADLIGHT COMPENSATING PIECE	Necessary	45.00 FS	*35.52 FS
36	1		*LIFT CYLINDER - LH	Cracked	231.00 FS	*184.40 FS
37	1		*LIFT CYLINDER HOSE	Torn	92.00 FS	*73.44 FS
38	1		*HEADLIGHT WASHER PUMP	Not Necessary	172.00 FS	*- FS
39	1		*LIFT CYLINDER WASH WATER RESERVOIR	Deformed	240.00 FS	*191.60 FS
40	1		*WINDSCREEN WASHER PUMP	Not Necessary	138.00 FS	*- FS
41	1		*FRONT FENDER FLEDGE COVER - LH	Not Necessary	46.00 FS	*- FS
42	1		*LOCK CARRIER	Not Necessary	1,412.00 FS	*- FS
43	6		*READY-MIX COOLANT	Not Necessary	297.00 FS	*- FS
44	1		*RADIATOR AIR GUIDE - LH	Not Necessary	43.00 FS	*- FS
45	2		*RADIATOR AIR GUIDE - UPPER / LOWER	Not Necessary	96.00 FS	*- FS
46	1		*OUTSIDE TEMPERATURE SENSOR BRACKET	Not Necessary	9.00 FS	*- FS
47	1		*A/B PILLAR FRAME - LH	Bent	3,629.00 FS	*2,903.20 FS
48	1		*FRONT BODY SIDE SILL TRIM STRIP - LH	Necessary	99.00 FS	*78.56 FS
49	1		*FRONT SIDE MEMBER TRIM - LH	Deformed	189.00 FS	*151.20 FS
50	1		*FRONT DOOR - LH	Bent	3,017.00 FS	*2,413.60 FS
51	1		*FRONT OUTER DOOR SEAL - LH	Necessary	185.00 FS	*147.60 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
52	1		*FRONT DOOR CATCH - LH	Not Necessary	134.00 FS	*- FS
53	1		*FRONT DOOR COVER - LH	Necessary	283.00 FS	*226.00 FS
54	1		*FRONT WING MIRROR MOUNTING - LH	Scratched	2,278.00 FS	*1,822.40 FS
55	1		*FRONT WING MIRROR CAP - LH	Repair	203.00 FS	*- FS
56	1		*FRONT WING MIRROR GLASS - LH	Not Necessary	940.00 FS	*- FS
57	1		*FRONT DOOR CORNER TRIM - LH	Not Necessary	51.00 FS	*- FS
58	1		*FRONT WINDOW GUIDE TRIM STRIP - LH	Not Necessary	287.00 FS	*- FS
59	1		*FRONT WINDOW OUTER SLOT SEAL TRIM STRIP - LH	Scratched	251.00 FS	*200.80 FS
60	1		*FRONT WINDOW PILLAR B TRIM - LH	Not Necessary	131.00 FS	*- FS
61	1		*FRONT WINDOW GUIDE - LH	Not Necessary	481.00 FS	*- FS
62	1		*FRONT DOOR WINDOW - LH	Not Necessary	269.00 FS	*- FS
63	2		*FRONT UPPER HINGE HALVES - LH	Not Necessary	106.00 FS	*- FS
64	2		*FRONT LOWER HINGE HALVES - LH	Not Necessary	106.00 FS	*- FS
65	1		*FRONT WATER DEFLECTOR STRIP - LH	Cut	52.00 FS	*41.28 FS
66	1		*FRONT UNDERBODY TRIM - LH	Cracked	216.00 FS	*172.40 FS
67	2		*FRONT WHEEL ARCH COVER - LH / RH	Necessary	566.00 FS	*452.00 FS
68	1		*FRONT ALUMINIUM RIM - LH	Cut	1,414.00 FS	*1,131.20 FS
69	4		*RUBBER VALVE	Necessary	15.00 FS	*2.96 FS
70	1		*FRONT ASSEMBLY CARRIER	Bent	753.00 FS	*602.40 FS
71	1		*FRONT BONDED RUBBER BUSHES - UPPER / LOWER	Necessary	179.00 FS	*142.80 FS
72	1		*FRONT OUTER SUPPORT BRACKET - LH	Not Necessary	25.00 FS	*- FS
73	1		*FRONT TRACK CONTROL ARM - LH	Bent	512.00 FS	*409.60 FS
74	1		*FRONT WHEEL BEARING HOUSING - LH	Bent	753.00 FS	*602.40 FS
75	1		*FRONT BEARING WHEELHUB - LH	Necessary	550.00 FS	*440.00 FS
76	1		*FRONT SUSPENSION BALL JOINT - LH	Bent	145.00 FS	*115.60 FS
77	1		*FRONT POLES LEVEL SENSOR - LH	Not Necessary	652.00 FS	*- FS
78	1		*FRONT COUPLING ROD	Bent	105.00 FS	*84.00 FS
79	1		*FRONT COUPLING ROD STABILIZER	Not Necessary	457.00 FS	*- FS
80	1		*FRONT GAS SHOCK ABSORBER - LH	Bent	338.00 FS	*270.40 FS
81	1		*FRONT DRIVE SHAFT - LH	Bent	1,521.00 FS	*1,216.80 FS
82	1		*FRONT STEERING GEAR	Not Necessary	5,990.00 FS	*- FS
83	1		*FRONT TRACK ROD - LH	Bent	99.00 FS	*78.56 FS
84	1		*FRONT TIE ROD END - LH	Bent	126.00 FS	*100.40 FS
85	1		*FRONT NOISE INSULATION	Necessary	516.00 FS	*412.80 FS
86	1		*FRONT NO PLATE	Necessary	60.00 FS	*60.00 FS
87	1		*SUNDRIES	Necessary	1,000.00 FS	*291.12 FS
88	1		*FRONT FENDER SUPPORT-LH (Supplementary)	Dented	455.00 FS	*363.60 FS
89	1		*FRONT FENDER CLOSING ELEMENET-LH (Supplementary)	Bent	66.00 FS	*52.32 FS
90	1		*SILL PANEL SEAL-LH (Supplementary)	Broken	151.00 FS	*120.40 FS
91	1		*COVER PLATE FOR BRAKE DISC-LH (Supplementary)	Bent	53.00 FS	*42.00 FS
92	1		*BRAKE CARRIER-LH (Supplementary)	Bent	364.00 FS	*291.20 FS
93	1		*BRAKE CALIPER HOUSING-LH (Supplementary)	Bent	560.00 FS	*447.60 FS
94	1		*LHS FRONT TYRE	Punctured	310.00 FS	*310.00 FS

F=Franchise part. S=SpcNett.

Total Parts (\$) **50,531.00** **27,478.48**

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE, CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR, HEADLIGHT WASHER ASSY AND FRONT PARKING AID	New	480.00	480.00
2	TO REMOVE AND TRANSFER LHS HEADLIGHTS CONTROL UNIT AND POWER MODULE	New	400.00	400.00
3	TO REMOVE AND REINSTALL AIRCON CONDENSER, CHARGE AIR COOLER AND RADIATOR. CHECK ELECTRICAL FANS AND CONTROL UNIT. PRESSURISE COOLING SYSTEM	New	1,600.00	0.00
4	TO CARRY OUT VACUUM AND REGAS FOR R124	New	1,200.00	0.00
5	TO REMOVE AND TRANSFER LHS FRONT DOORS MULTI-LOCK SYSTEM AND POWER WINDOW DEVICES. INSPECT FOR DAMAGES	New	400.00	400.00
6	TO REMOVE AND REINSTALL FRONT SEAT ASSY, BACK REST, AB PILLAR TRIMS, SILL TRIMS, CARPETS, ELECTRONIC COMPONENTS AND FUSE TRAYS	New	1,800.00	1,800.00
7	TO REMOVE CENTER CONSOLE AND DASHBOARD ASSY FOR A-PILLAR RENEWAL. INSPECT FOR DAMAGES	New	3,200.00	0.00
8	TO REMOVE AND RENEW LHS FRONT WHEEL SUSPENSION ASSY WITH SUBFRAME	New	2,400.00	2,400.00
9	TO CARRY OUT FIRST MEASUREMENT ON CAR-O-LINER	New	800.00	0.00
10	TO SETUP VEHICLE ON CAR-O-LINER TO FACILITATE THE REPAIR	New	2,400.00	0.00
11	TO DISMANTLE AND RENEW FRONT BUMPER, LHS FRONT FENDER, LHS FRONT DOOR AND LHS HEADLIGHT. TO REPAIR BONNET AND LHS FRONT FENDER TOP SUPPORT. TO CUT OUT AND WELD LHS A-PILLAR AND LHS SILL PANEL. TO RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	New	9,600.00	3,750.00
12	TO RESPRAY FRONT BUMPER, LHS FRONT FENDER, BONNET, LHS FRONT FENDER TOP SUPPORT, LHS FRONT DOOR, HINGES, LHS WING ERROR COVER, LHS A-PILLAR, LHS SILL PANEL AND DOOR ENTRANCE	New	7,000.00	3,875.00
13	TO RENEW LHS FRONT RIM WITH TYRE AND LHS REAR TYRE. TO CARRY OUT PRE/POST WHEEL ALIGNMENT	New	560.00	560.00
14	TO TOW BACK THE VEHICLE FROM ACCIDENT SCENE	New	280.00	0.00
15	TO CARRY OUT PRE/POST DIAGNOSTIC CHECK	New	384.00	384.00
16	TO CUT OUT AND WELD LHS FRONT FENDER SUPPORT (Supplementary)	New	2,000.00	1,000.00
Gross Labour Cost (S\$)			34,504.00	15,049.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >