# Constant Appraiser Services Qualified Automobile Accident Damage Appraisers/Loss Adjusters

Qualified Automobile Accident Damage Appraisers/Loss Adjusters Blk 2 Rivervale Link, #09-02 Singapore 545040 Mobile: 9007 5234 Email: constant\_as@yahoo.com.sg RCB No. 53138015K

# INVOICE

To: Mega Gas Enterprise Pte Ltd

28D Pioneer Sector 2

Singapore 628407

Date : 08/08/2022

Invoice No: IV22-08006/CAS

Particulars	Amount		
Fee For Services Rendered In Respect Of: Surveying, Adjusting, and Re-inspection Of Accident Damaged Vehicle GBE 5150S (Inclusive Of Photographs And Transport Charges) Our reference: CAS/22-08/006	\$1,882.00		
Total	\$1,882.00		

E. & O.E

**Constant Appraiser Services** 



# **Constant Appraiser Services**

Qualified Automobile Accident Damage Appraisers/Loss Adjusters Blk 2 Rivervale Link, #09-02 Singapore 545040 Mobile: 9007 5234 Email: constant as@yahoo.com.sg RCB No. 53138015K

# **Automobile Inspection Report**

To: Mega Gas Enterprise Pte Ltd

28D Pioneer Sector 2

Singapore 628407

Date

: 08/08/2022

Reference No : CAS/22-08/006

### General Information

Registration No.

**GBE 5150S** 

Accident Date

: 29/06/2022

### Particulars of Damaged Vehicle

Colour

: Multi

Make & Model

: Toyota Dyna 150 Manual

**Engine Capacity** 

: 2982 cc

Pre-Accident Condition

: Good

Mileage (KM)

273049

Engine No. Steering

: 1KD2507261 : In Order

Chassis No. Registration Date : 22/12/2015

: JTFAT35Y90K204688

Brake

: In Order

#### Tyre Condition

Size

Make

Balance

R/H Front Tyre

195R15 195R15

FALKEN FALKEN 90% 90%

L/H Front Tyre R/H Rear Tyre L/H Rear Tyre

155R12 (D) 155R12 (D)

FALKEN FALKEN

90% / 90% 90% / 90%

#### Inspection

Repairer

: LYS Engineering

65 Chestnut Avenue, #18-15, Singapore 679524

#### Adjustment And Recommendation Cost Of Repair

. -

Repairer's Estimate: \$46,846.48

Revised Amount

: \$34,350.00

Less Excess

Nett Total

: \$34.350.00

#### Remarks

- (A) Survey was done on 30/06/2022
- (B) Re-survey was done on 05/07/2022 & 08/07/2022
- (C) Re-survey after repair was done on 02/08/2022
- (D) The survey was conducted entirely on WITHOUT PREJUDICE basis.
- (E) We have NOT given any instruction to authorize the repair of the vehicle.

NOTE: The revised estimate was made from a visual inspection. Should there be any discrepancy or unseen damage/item in this survey, kindly notified the company within 7 (seven) days from the date hereof. Otherwise, the revised amount shall be deem to be valid.

# **Constant Appraiser Services**

Vehicle No: GBE 5150S Our ref: CAS/22-08/006

# Adjustment On Repair Costs And Replacement Of Parts:

S/No	Qty	Descriptions	Assessed Condition	Estimate by Workshop (\$)	Revised Amount (\$)	
		PARTS REPLACEMENT – LIST ITEMS				
1	1pc	Diesel EGR control valve (c/item 38)	Dented	174.85	174.85	× NN
2	2pcs	Engine mounting L/R @ \$172.50	Serviceable	345.00	_	× NN
3	1pc	Front cabin end panel	Repair	1,461.80	-	× NN
4	1pc	Front cabin end panel glass	Cracked	220.60	220.60	<b>~</b>
5	1pc	Front cabin end panel glass rubber	Necessary	116.20	116.20	<b>/</b>
6	1pc	Front cabin opener handle	Bent/Twisted	311.20	311.20	<b>✓</b>
7	2pcs	Front cabin safety lock bracket @ \$195.60	Bent	391.20	391.20	<b>/</b>
8	2pcs	Front cabin safety lock L/R @ \$265.50	Bent	531.00	531.00	<b>/</b>
9	1pc	Fuel exhaust injector (switch)	Dented/Bent	1,217.10	1,217.10	500 ✓
10	1pc	Fuel exhaust injector pipe	Bent	372.25	372.25	<b>/</b>
11	1pc	Fuel injector bracket	Bent	381.90	381.90	× NN
12	1pc	Value assy vacuum	Dented	173.82	173.82	× NN
13	1pc	Gear box mounting	Torn	182.10	182.10	<b>/</b>
14	1pc	Water pump	Dented/Jammed	272.50	272.50	<b>/</b>
15	1pc	Radiator assy	Mounting Broken	1,217.45	1,217.45	<b>/</b>
16	1pc	Radiator fan blade	Serviceable	281.90		
17	1pc	Radiator fan clutch	Bent/Jammed	371.25	371.25	<b>/</b>
18	1pc	Radiator fan cowling	Broken	274.45	274.45	<b>/</b>
19	1pc	Rear exhaust silencer gasket	Necessary	43.75	43.75	<b>/</b>
20	1pc	Rear exhaust silencer pipe	Dented/Bent	781.90	781.90	<b>/</b>
21	2pcs	Rear exhaust silencer rubber mounting @ \$61.10	Distorted	122.20	122.20	× NN
22	1pc	Rear floor carrier	Dented/Warped	6,914.00	6,914.00	5000 🗸
23	1pc	Rear number plate bracket	Bent	291.40	291.40	<b>✓</b>
24	2pcs	Rear number plate lamp @ \$69.60	Cracked	139.20	139.20	× NN
25	1pc	Rear spare tyre carrier bracket	Repair	174.45		
26	1pc	Tailgate (c/w item 22)	Dented	1,137.00	1,137.00	× NN
27	4pcs	Tailgate hinge @ \$64.40 (c/w item 22)	Bent/Jammed	257.60	257.60	× NN
28	2pcs	Tailgate opener handle @ \$213.10 (c/w item 22	Dented/Bent	426.20	426.20	× NN
29	2pcs	Tailgate rubber stopper bracket @ \$135.00	Bent	270.00	270.00	× NN
30	2pcs	Tailgate rubber stopper @ \$43.10 (c/w item 2	Cut/Deformed	86.20	86.20	× NN
31	2pcs	Taillamp bracket @ \$93.00	Bent/Twisted	186.00	186.00	× Repa
32	2pcs	Taillamp @ \$251.30	Cracked/Broken	502.60	502.60	<b>/</b>

Vehicle No : GBE 5150S

Revised Assessed Estimate by S/No Oty Descriptions Condition Workshop (\$) Amount (\$) PARTS REPLACEMENT - LIST ITEMS (CONT'D) 33 2pcs Side gate flip lock handle @ \$213.10 Dented/Jammed 426.20 426.20 × NN Side gate flip lock handle pin holder @ 34 2pcs Bent 52.00 52.00 X NN \$26.00 35 2pcs Side gate flip lock handle pin @ \$22.00 Necessary 44.00 44.00  $\times$  NN 36 10pcs Side gate hinge @ \$64.40 Bent 644.00 644.00 NN 37 2pcs Side gate L/R @ \$1,812.55 Dented/Twisted 3,625.10 3,625.10 X NN 38 1pc Swirl control valve Damaged 1,538.70 1,538.70 800 ✓ (exhaust manifold) 39 1pc Air cleaning box Broken 598.90 598.90 26,557.97 24,294.82 Less 25% (6,639.49)(6,073.70)Sub total 19,918,48 18,221.12 PARTS REPLACEMENT - SPECIAL NETT ITEMS 1 1pc Gearbox Jammed/Oil Leaked 3,500.00 3,500.00 3000 ✓ 2 1pc Propeller shaft 800.00 Bent 800.00 3 1bot Gearbox oil Necessary (50%) 100.00 50.00 4 4ltrs Rear axle oil @ \$20.00 Necessary (50%) 80.00 40.00 1bot Coolant 5 Necessary (50%) 60.00 30.00 × NN Fan belt 6 1pc X Cut (50%) 96.00 48.00 NN 7 1bot Radiator coolant Necessary (50%) 25.00 50.00 8 1set Reverse sensor Damaged 250.00 220.00 200 🗸 9 1pc Rear carrier front inner board Broken 600.00 600.00 X NN 10 6 12pcs Rear carrier floor wooden board @ \$250.00 Broken 3,000.00 3,000.00 1500 🗸 11 4 9pcs Rear carrier floor wooden beam @ \$80.00 Broken 720.00 320 🗸 720.00 12 1pc Tailgate inner wooden board Broken 600.00 600.00 400 🗸 13 2pcs Side gate inner wooden board @ \$800.00 Broken 1,600.00 1,600.00 × NN 14 3pcs Rear carrier front wooden guard @ \$250.00 Broken 750.00 750.00 NN 4sets 15 Side gate top wooden guard @ \$650.00 Broken 2,600.00 2,600.00 NN 16 16pcs Side gate wooden guard holder @ \$12.00 NN Bent/Twisted 180.00 180.00 × 17 1pc Rear number plate 40.00 40.00 Dented 18 1pc Tailgate '70km/h' sticker Necessary 12.00 12.00 19 Tailgate 'flammable gas' sticker 1pc Necessary 25.00 25.00 20 1pc Tailgate outer aluminium board Dented 500.00 500.00 400 🗸 21 2pcs Side gate outer aluminium board @ \$900.00 Broken/Twisted 1,600.00 1,600.00 X NN

Our ref: CAS/22-08/006

## Constant Appraiser Services

Vehicle No: GBE 5150S Our ref: CAS/22-08/006

S/No	Qty	Descriptions	Assessed Condition	Estimate by Workshop (\$)	Revised Amount (\$)	
Aria de Aria (Aria	and the cut of his hard in 1800 at Earth with Mark Mark Mark	PARTS REPLACEMENT – SPECIAL NETT ITEMS (CONT'D)	Condition	γ στιστισμ (ψ)	Timount (#)	
22	4pcs	Silicon for aluminium board @ \$40.00	Necessary	160.00	160.00	× NN
23	50pcs	Bolt & nut set @ \$1.50	Necessary	75.00	75.00	30✓
24	1pc	Company advertisement	Necessary	1,000.00	800.00	300 🗸
			Part total	38,316.48	36,196.12	
		LABOUR & MISC. CHARGES				
1		To remove, reinstall electrical wiring harness, check lighting, resetting & rewire for parking sensor		100.00	60.00	30 🗸
2		To remove, reinstall transmission gearbox & propeller shaft		480.00	300.00 ✓	
3		To remove, reinstall rear carriage		450.00	350.00 🗸	
4		To respray painting on the change bodyparts, repair portion & where consistent to the accident		2,500.00	2,000.00	600 🗸
5		To remove & change exhaust silencer box with pipe, realign where necessary consistent to the accident		100.00	70.00	<b>/</b>
6		To provide labour, workmanship to change the above damaged bodyparts, repair, re- construct & re-align body structure, body alignment & damaged consistent to the				
		accident		2,500.00	2,200.00	1600 🗸
7		To apply anti-rust chemical on repaired & replaced panel		200.00	150.00	30✓
8		To repair & straighten chassis member & realign back position		1,200.00	800.00	600 🗸
9		To remove & replace rear wooden board & beam		1,000.00	800.00	400 🗸
			Grand total	46,846.48	42,926.12	
		st of lump sum repair at condition)			34,350.00	

20 days

Vehicle No: GBE 5150S Our ref: CAS/22-08/006

### Adjustment/Recommendations

We have thoroughly inspected each and every item on the estimate against the physical damage found on the vehicle and we have listed the breakdown of our finding and our recommendation.

The repairer has agreed to undertake the job at a lump sum of \$34,350.00 on a contractual basis. Under normal circumstances, the repair period would be about 32 (Thirty Two) working days.

Yours faithfully,

**Constant Appraiser Services** 

Lim Yong Tian (Sebastian)

Licensed Appraiser

Adv. Dip. In Mechanical Engineering (AUS)

MSAAA

# **INVOICE**

Mailing Address: 65 Chestnut Ave #18-15, Singapore 679524 Tel: 6674 8965 Fax: 6674 8965 Hp: 9730 8695 Email: lys88@yahoo.com.sg

# LYS ENGINEERING

Specialise in Motor Repairing, Welding, Panel Beating, Spray Painting, Side Guide, Accident Claims, General Insurance Agents, ROV Inspection, Insurance Claim.

Mrs Me Pa Gas Enterprise Pte Utol GBE 5150S  BReg. 48754100J			No: 5189  Terms: Cash/30 days  Date: 778 2022				
Quantity	1	t Price	Amount \$ cts				
	lump Sum repair	34,35	0. 00	34350	00		
				1			
e of 1.5% inte	d within 30 days of date, interest at the serest per month will be carry out until settled. uld be crossed & made payable to RING".		OTAL \$	34,350.	00		
viotomasta Si	gnature & Official Stamp E. & O. E.	*	\	GINEE			



### Mailing Address: 65 Chestnut Ave #18-15, Singapore 679524

Tel: 6674 8965 Fax: 6674 8965 Hp: 9730 8695

Email: lys88@yahoo.com.sq

# LYS ENGINEERING

Specialise in Motor Repairing, Welding, Panel Beating, Spray Painting, Side Guide, Accident Claims, General Insurance Agents, ROV Inspection, Insurance Claim.

M/S	GRE 5150S			190 b/30 days	
B Reg. 487	54100J	Date: _	11/	0/20	
Quantity	Description	Unit \$	Price cts	Amou \$	unt cts
_	Towing From Fort Rd to	7			
	NO 3 Pioneer Road North	5		60.	N
	Towing from Fort Rd to NO 3 Pioneer Road North Accident Reporting Centre				
-	Towing From NO3 Pioneer				
	Road North to 7 soon			,	
	Lee Street #01-39 (ispuce	/		60-	00
					-/
					/
ite of 1.5% in	id within 30 days of date, interest at the terest per month will be carry out until settled. Sould be crossed & made payable to	т	TAL \$	120.	00

FOR LYS ENGINEERING

Customer's Signature & Official Stamp

E. & O. E.

# CASH SALES/INVOICE

No:0004092



# **James Towing Services**

Blk 288 Yishun Ave 6 #07-50 Singapore 760288 James Low **HP:9015** 7488 • 9811 9966 24 Hrs Towing Services 拖车服务

寶號 Messre: 車號 型號 Vehicle No: Model No: 由 From: 時間(日夜) Time (day/night) Progress 其他 Other: 現金 200 CASH\$ CHEQUE: 在進行中如有任何損失或破壞,一概由車主自行負責。 NOTES: Vehicle is towed at owner's risk. The company accepts no responsibility for demage or other misdemeanor to your vehicle whilst being towed. 收貨人 Received by Issued by