

WG APPRAISAL SERVICES

Blk 224B, Compassvale Walk, #07-647, Singapore 542224

Email: Winsongkk@hotmail.com Contact: 9747 0063

Company Register No. 53326249J

Our Ref: WG/TP/2020-49

Invoice No: TP/MCC/2020-49

Date 12 February 2020

Vehicle No: SJB7262K

Attn: TEW CHANG YUAN IVAN

Company: MY CAR CONSULTANT PTE LTD

Address: 53 Ubi Ave 1, #01-33, Paya Ubi Industrial Park . Singapore 408934

Invoice

Surveyor Fee:	S\$290
Re-inspection Fee:	S\$50
Transport:	S\$50
Photographs:	S\$35/- (@ \$1 per photo, total 35 photos)
Total:	S\$425

Surveyor:

Signature:

Date:

Winson Goh

12 February 2020



WG APPRAISAL SERVICES

Blk 224B, Compassvale Walk, #07-647 Singapore 542224
Email: winsongkk@hotmail.com Contact: 9747 0063
Company Register No. 53326249J

ACCIDENT DAMAGED VEHICLE INSPECTION REPORT

M/S : TEW CHANG YUAN IVAN
C/O MY CAR CONSULTANT PTE LTD
53 Ubi Ave 1, #01-33, Paya Ubi Industrial Park
Singapore 408934

Date : 12 February 2020
Our Ref : WG/TP/2020-49

REFERENCE PARTICULARS

Date of Accident : 12 January 2020
Date of Inspection : 14 January 2020

Type of Inspection : Third Party Claim
Date of Re-Inspn : 15 January 2020

VEHICLE PARTICULARS

Registration No : SJB7262K
Make : PEUGEOT
Model : 508 ALLURE 1.6 BLUEHDI EAT6
Year : 2016

Engine No : 10JBHX3018999
Chassis No : VF38DBHGTGL040701
Odometer : 65411km
Colour : Grey

CONDITION OF VEHICLE (STATIC CHECKS AT TIME OF INSPECTION ONLY)

Engine condition : Good
Foot Brake : Serviceable
Hand Brake : Serviceable

General Body Work : Good
Steering : Serviceable
Lightings : Serviceable

TYRE CONDITION (Remaining estimated life of tyre in mm)

	<u>Make</u>	<u>Size</u>	<u>Thread Balance</u>
Front Near side	: Contential	245/40R18	5 mm
Front Off Side	: Contential	245/40R18	5 mm
Rear Near Side	: Contential	245/40R18	5 mm
Rear off Side	: Contential	245/40R18	5 mm

GENERAL DESCRIPTION OF DAMAGES

The vehicle sustained damage at the rear portion.
For details, refer to assessment for repairs and photographs attached.

ASSESSMENT SUMMARY

Our assessment of the repair costs to pre-accident condition was **SS\$6,750.00** nett at lump sum basis (Subject to GST if applicable)

Under normal circumstances, estimated period required for repairs : Seven (07) working days.

Enclosed Thirty-five (35) photographs depicting damage to the vehicle.

Inspection conducted at : MY CAR CONSULTANT PTE LTD
53 Ubi Ave 1, #01-33, Paya Ubi Industrial Park . Singapore 408934

In accordance to your instruction, we have **not authorise** repairs and inspection

was conducted strictly on a "WITHOUT PREJUDICE BASIS".

VEHICLE NO : SJB7262K
MODEL : 508 ALLURE 1.6 BLUEHDI EAT6

Our Ref : WG/TP/2020-49

ASSESSMENT OF REPAIRS AND SPARE PARTS COSTS

DESCRIPTION OF PARTS AND NATURE OF REPAIRS

	SPARE PARTS	QTY PC/SET	ASSESSED CONDITION	ORIGINAL QUOTATION	REVISED QUOTATION	
1	REAR BUMPER	1	CRACKED	\$ 1,673.20	\$ 1,673.20	1280 ✓
2	REAR BUMPER LOWER GARNISH	1	GRAZED	\$ 690.40	\$ 690.40	480 ✓
3	REAR BUMPER RETAINER	2	NECESSARY	\$ 190.30	\$ 190.30	✓
4	REAR BUMPER REINFORCEMENT	1	DENTED	\$ 812.10	\$ 812.10	500 ✓
5	REAR BUMPER GUIDE	1	CRACKED	\$ 293.10	\$ 293.10	✓
6	REAR BUMPER REFLECTOR LH	1	NOT NECESSARY	\$ 82.50	\$ -	
7	PDC SENSOR	1 →	MALFUNCTION	\$ 675.00	\$ 675.00	225 ✓
8	PDC SENSOR WIRE HARNESS	1	NOT NECESSARY	\$ 193.20	\$ -	✗ NN
9	REAR TOW COVER	1	CRACKED	\$ 55.00	\$ 55.00	✓
10	REAR RH TAILLAMP	1	CRACKED	\$ 1,104.20	\$ 1,104.20	✓
11	REAR RH TAILLAMP BRACKET	1	NECESSARY	\$ 120.00	\$ 120.00	✓
12	END PANEL	1	DENTED	\$ 1,105.20	\$ 1,105.20	✗ Repair
				\$ 6,994.20	\$ 6,718.50	
			Less 10%	\$ 699.42	\$ 671.85	
				\$ 6,294.78	\$ 6,046.65	

B) S/NETT ITEM

13	REAR BUMPER CLIP	1 SET	NECESSARY	\$ 30.00	\$ 20.00	✓
14	JOINT SEALANT	1	NECESSARY	\$ 120.00	\$ 100.00	✗ NN
				\$ 150.00	\$ 120.00	

Parts Total :

\$ 6,444.78	\$ 6,166.65
--------------------	--------------------

C) LABOUR CHARGES & MISC

15	CHECK REAR WIRING AND LIGHTNING SYSTEM			\$ 60.00	\$ 50.00	✓
16	REMOVE, REFIT REAR LINING, TRIM AND GARNISH			\$ 150.00	\$ 120.00	80 ✓
17	REMOVE AND RENEW REAR REVERSE SENSOR			\$ 120.00	\$ 100.00	30 ✓
18	REMOVE AND STRAIGHTEN REAR EXHAUST			\$ 120.00	\$ 100.00	✗
19	DIAGNOSIS CHECK AND CLEAR FAULT CODE			\$ 300.00	\$ 200.00	100 ✓
20	PANEL BEATING ON AFFECTED AREAS			\$ 700.00	\$ 600.00	500 ✓
21	SPRAY PAINTING ON AFFECTED AREAS			\$ 1,200.00	\$ 1,000.00	500 ✓
22	APPLY ANTI RUST ON AFFECTED AREAS			\$ 120.00	\$ 100.00	30 ✓

Labour Total :

\$ 2,770.00	\$ 2,270.00
--------------------	--------------------

Total Parts and Labour :

\$ 9,214.78	\$ 8,436.65
--------------------	--------------------

FINAL LUMP SUM ADJUSTMENT

\$ 6,750.00

5 days

POINT OF IMPACT

The impact was confined to the rear portion of the vehicle.

The damages appeared to be consistent as per the accident report statement.

Please refer the attached schedule and photographs for details.

ADJUSTMENT/RECOMMENDATIONS

We have thoroughly inspected each and every item on the repairer's estimates against the actual damaged found on the vehicle. We have listed the breakdown of our findings and recommendations as per assessment above.

CONCLUSION

The repairer has agreed to undertake repair the vehicle at a lump sum basis of **\$6,750.00 nett** corresponding to replacement of parts, spray painting and labour charges. We now revert for your decision on the above claim.

Yours faithfully,

WG APPRAISAL SERVICES



Winson Goh
Automotive Appraiser

















