

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/MSG22008414/KVY3E2

Date: 19/09/2022

REFERENCE

Handling Insurer: MSIG Insurance (Singapore) Pte. Ltd. Policy No: A29152578AT2
Claimant Vehicle No : SMC7279Y Insured Vehicle No : SLJ7350Z
Date of Loss: 26/08/2022 Nature of Claim: TP Claim No: 642537

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SMC7279Y**
Make & Model: KIA CARENS, 1.7 D DCT 5DR FWD (A) Engine No: D4FDJD024159
Reg. Date: 19/07/2018 (Man. Year: 2018) Chassis No: KNAHU815VJ7211173
Colour: Red Odometer: 311236 km
Engine Capacity: 1685 cc
Market Value/New Car Price: N/A
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 205/55 R16 Rear Tyre Size: 205/55 R16
Front Left Side: Grenlander 9 mm Rear Left Side: Grenlander 9 mm
Front Right Side: Grenlander 9 mm Rear Right Side: Grenlander 9 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	3,583.00	170.10	3,412.90	95.25
Miscellaneous Items	0.00	0.00	0.00	
Labour	2,070.00	765.00	1,305.00	63.04
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	5,653.00	935.10	4,717.90	83.46
+ GST 7.00/7.00% (S\$)	395.71	65.46	330.25	83.46
Nett Amount (S\$)	6,048.71	1,000.56	5,048.15	83.46

INSPECTION

Date of Assignment: 31/08/2022
Date Inspected: 01/09/2022 Inspected At: Munich Autocare Pte Ltd (HQ)
60 Jalan Lam Huat, #07-43
Singapore 737869
Estimated Period of Repair: 4.0 days

Adjuster: KENNETH KONG

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG	Version: 1.0 (Last Synchronised: 15 Sep 2022)
Parts: M1-MPV	KIA CARENS 1.7 D DCT 5DR FWD (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SMC7279Y)
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*TAILGATE ASSY PANEL	Repair	1,462.00 F	*- FL
2	1		*REAR BUMPER LOWER	Dented	254.00 F	*189.00 FL
3	1		*REAR BUMPER UPPER	Repair	692.00 F	*- FL
4	2		*ULTRASONIC SENSOR	Serviceable	390.00 F	*- FL
5	1		*WIRE SENSOR HARDNESS	Serviceable	302.00 F	*- FL
6	1		*REAR BUMPER BEAM	Repair	441.00 F	*- FL
7	6		*REAR BUMPER CLIPS	Not Necessary	42.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$)	3,583.00	189.00
- List Item Discount on L Items 0.00/10.00% (\$)	0.00	18.90
Total Parts (\$)	3,583.00	170.10

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	LABOUR FOR SPRAY PAINT ALL AFFECTED DAMAGED AREAS	New	800.00	400.00
2	LABOUR FOR PANEL BEATING ALL AFFECTED DAMAGED AREAS	New	1,000.00	350.00
3	TO WHEEL ALIGNMENT	New	120.00	0.00
4	TO CHECK ALL WIRING FOR PROPER FUNCTION	New	150.00	15.00
			Gross Labour Cost (\$\$)	2,070.00
				765.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >