



ABSOLUTE APPRAISAL SERVICES PTE LTD
LOSS ADJUSTERS & MOTOR APPRAISERS
160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722
Mobile: 9688-0418 Fax: 6266-7396
Email: absolute.app.svcs@gmail.com

Vehicle Inspection Report

To: Ng Shu Ting Dixie
C/o: 160 Sin Ming Drive #06-10
Sin Ming AutoCity (S) 575722

Date of report: 26.06.2022
Date of request: 06.06.2022
Date of inspection: 06.06.2022
Date of accident: 03.06.2022
Claim type: Third Party Claim

Report No: AAS/2022/104

Particulars of affected vehicle:

Registration no: SKV3326U
Make/Model: Toyota Lexus GS450h (A)
Year of registration: 2008/09
Colour: Metallic Grey

Odometer: 275316 km
Engine Capacity: 3456 cc
Engine no: 2GR8663570
Chassis no: JTHBC96SX05018598

Condition of tires:

Front Left: 6mm
Make: Michelin
Rear Left: 6mm
Make: Michelin

Front Right: 6mm
Make: Michelin
Rear Right: 6mm
Make: Michelin

Type of road wheel: Alloy (The above represent the remaining life of the tire thread)

Pre-accident condition (Static tests only)

General Bodywork	: Good
Paintwork	: Good
Handbrake	: In order
Footbrake	: In order
Steering	: In order
Apparent engine modification	: Nil

The Assignment

The inspection was conduct at M/s. Lian Heng Painter Company
160 Sin Ming Drive #06-10
Sin Ming AutoCity (S) 575722

(Subsequent inspection was conducted)

Assessment

Repairer's estimate:	\$ 14,614.30
Revised estimate:	\$ 10,891.81
Recommended reserve:	\$ 8,700.00 (Lump sum)

Estimated normal duration of repairs : 8 Working days



ABSOLUTE APPRAISAL SERVICES PTE LTD
LOSS ADJUSTERS & MOTOR APPRAISERS
160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722
Mobile: 9688-0418 Fax: 6266-7896
Email: absolute.app.svcs@gmail.com

Vehicle No: SKV3326U

Report No: AAS/2022/104

W/O PREJUDICE

Point of impact

At the rear portion.

General description of damages

The boot lid, LH tail lamp, LH tail lamp panel, rear bumper, rear end panel, etc.

Other parts were also found damaged. (See schedule for details)

Recommendation

The estimate cost of repair submitted by M/s Lian Heng Painter Company as per schedule attached have been revise and scrutinize. We list the breakdown of our findings and recommendation as per attached.

Our adjusted amount for the cost of repair is SGD \$10,891.81

Conclusion

The repairer has agreed to undertake the repair at a lumpsum of SGD \$8,700.00

Under normal circumstances, the repair of the damaged vehicle should be completed within a reasonable period of 8 working days.

We have **Not Authorised** and/or instruction to the repairer to proceed with the repairs. This inspection was conducted entirely on a '**Without Prejudice**' basis.

We are pleased to advise that the inspection was carried out accordingly and hereby submit our appraisal report which includes 90 photographs.

Your Faithfully
Absolute Appraisal Services Pte Ltd



Nicky Seah
Automobile Appraiser
MSAAA / MSMCTA



ABSOLUTE APPRAISAL SERVICES PTE LTD LOSS ADJUSTERS & MOTOR APPRAISERS

160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722

Mobile: 9688-0413 Fax: 6266-7396

Email: absolute.app.svcs@gmail.com

Vehicle No: SKV3326U

Report No: AAS/2022/104

Appraisement Schedule

S/N	Parts Description	Qty	Condition		Repairer's Est	Revised Est
1	Boot lid	1	Dented/Distorted		\$ 860.70	\$ 860.70
2	Boot lid emblem	1	Necessary		\$ 66.50	\$ 66.50
3	Boot lid garnish	1	Dented/Loop Broken		\$ 1,867.30	\$ 1,867.30
4	Boot lid garnish clips	10	Necessary	\$ 3.50	\$ 35.00	\$ 35.00
5	Boot lid nameplate 'Lexus'	1	Necessary		\$ 75.30	\$ 75.30
6	Boot lid nameplate 'GS450h'	1	Necessary		\$ 85.80	\$ 85.80
7	Boot lid lamp LH/RH	2	Refit	\$ 587.20	\$ 1,174.40	-
8	Boot lid inner trim clips	11	Necessary	\$ 4.00	\$ 44.00	\$ 44.00
9	Boot lid lock	1	Distorted		\$ 1,229.00	\$ 1,229.00
10	Boot lid catch	1	Refit		\$ 42.20	-
11	Boot lid sensor	1	Dented		\$ 195.10	\$ 195.10
12	Boot lid hinge LH/RH	2	Bent/Repair	\$ 154.90	\$ 309.80	-
13	Boot lid absorber LH/RH	2	Refit	\$ 220.40	\$ 440.80	-
14	Boot lid weather-strip	1	Necessary		\$ 186.70	\$ 186.70
15	Tail lamp LH/RH	2	LH Crazed	\$ 715.30	\$ 1,430.60	\$ 715.30
16	Rear bumper	1	Dented		\$ 980.20	\$ 980.20
17	Rear bumper tow hook cover	2	Refit	\$ 29.30	\$ 58.60	-
18	Rear bumper retainer LH/RH	2	Cracked/Necessary	\$ 95.00	\$ 190.00	\$ 190.00
19	Rear bumper bracket LH/RH	2	Cracked/Necessary	\$ 42.30	\$ 84.60	\$ 84.60
20	Rear bumper sponge	1	Dented/Cracked		\$ 93.20	\$ 93.20
21	Rear bumper reinforcement	1	Dented		\$ 495.40	\$ 495.40
22	Rear bumper undercover	1	Refit		\$ 258.30	-
23	Rear bumper clips	8	Necessary	\$ 4.30	\$ 34.40	\$ 34.40
24	Reverse sensor	2	Cracked/Broken	\$ 330.70	\$ 661.40	\$ 661.40
25	Rear end panel	1	Dented		\$ 797.60	\$ 797.60
26	Rear end panel top garnish	1	Deformed		\$ 389.50	\$ 389.50
27	Rear end panel top garnish clips	7	Necessary	\$ 3.50	\$ 24.50	\$ 24.50
28	Spare tyre panel cover	1	Refit		\$ 336.70	-
29	Exhaust tip LH	1	Missing		\$ 379.40	\$ 379.40
Total:					\$ 12,827.00	\$ 9,490.90
-10%					\$ 1,282.70	\$ 949.09
List total:					\$ 11,544.30	\$ 8,541.81
1	Joint sealant	1	Necessary		\$ 60.00	\$ 40.00
Special nett total:					\$ 60.00	\$ 40.00
Parts Total:					\$ 11,604.30	\$ 8,581.81



ABSOLUTE APPRAISAL SERVICES PTE LTD
LOSS ADJUSTERS & MOTOR APPRAISERS
180 Sin Ming Drive #03-16 Sin Ming AutoCity (S) 575722
Mobile: 9688-0413 Fax: 6266-7396
Email: absolute.app.svcs@gmail.com

Vehicle No: SKV3326U		Report No: AAS/2022/104	
S/N	Labour Description	Repairer's Est	Revised Est
1	To remove & refit rear trimmings.	\$ 80.00	\$ 60.00
2	To transfer boot lid fittings.	\$ 100.00	\$ 60.00
3	To renew & transfer reverse sensor.	\$ 80.00	\$ 50.00
4	To check wirings.	\$ 50.00	\$ 30.00
5	Rust proofing.	\$ 100.00	\$ 30.00
6	To remove and renew damaged parts. Re-align all affected area.	\$ 1,200.00	\$ 880.00
7	To putty and respray all damaged parts. Touch up all affected area.	\$ 1,400.00	\$ 1,200.00
Labour Total:		\$ 3,010.00	\$ 2,310.00
Grand Total:		\$ 14,614.30	\$ 10,891.81

The final adjusted lump sum amount is \$8,700.00

Under normal circumstances, the repair should be completed within a reasonable period of 8 working days.

90 Photographs were taken at the time of inspection.

Disclaimer: This report is intended for the exclusive use of the address solely in relation to the loss occurrence in which the assessed vehicle involved. No liability or responsibility whatsoever shall be held by Absolute Appraisal Service Pte Ltd for any reliance on this report by any third party.













































