



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SCJ 7886B

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT BUMPER REINFORCEMENT	TO REPAIR SEE LABOUR	877.00	-
1	FRONT BUMPER IMPACT ABSORBER	SERVICEABLE	489.00	-
1	HEADLAMP N/S	SERVICEABLE	965.00	-
1	HEADLAMP LOWER BRACKET N/S	TO REPAIR SEE LABOUR	109.00	-
1	FRONT BUMPER OUTER	CRACKED	969.00	306.00
1	FRONT BUMPER INNER	CRACKED	1,396.00	1,215.00
2	FRONT BUMPER SIDE RETAINER @\$64.00	N/S DISTORTED	128.00	64.00
1	FRONT FENDER N/S	TO REPAIR SEE LABOUR	874.00	-
1	FRONT SIGNAL LAMP N/S	SERVICEABLE	689.00	-
	LESS 10% DISCOUNT		-649.60	-158.50
			5,846.40	1,426.50
<u>SPECIAL NETT ITEMS</u>				
12	FRONT BUMPER CLIPS @\$7.50 (SN)	NECESSARY	90.00	90.00
8	FRONT FENDER INNER SHIELD CLIPS N/S @\$7.50 (SN)	NOT NECESSARY	60.00	-
8	FRONT BUMPER LOWER SPLASH COWLING CLIPS @\$7.50 (SN)	NOT NECESSARY	60.00	-
1	SUNDRIES (SN)	NOT NECESSARY	50.00	-
			260.00	90.00
<u>LABOUR</u>				
	TO DISMANTLE / RENEW ACCIDENT DAMAGED PORTIONS. TO PANEL BEAT, RESHAPE, STRAIGHTEN, ORIENTATE AND ALIGN REPAIR / REPLACEMENT PARTS. INCLUSIVE OF THE REPAIR OF FRONT BUMPER REINFORCEMENT, HEADLAMP LOWER BRACKET N/S AND FRONT FENDER N/S.		1,200.00	300.00
	TO DISCONNECT FRONT WIRE HARNESS OF ELECTRICAL COMPONENTS TO FACILITATE REPAIRS, RECONNECT AND CHECK FUNCTIONS INCLUDING FOCUSING HEADLAMPS.		50.00	15.00
	TO RUST PROOF ALL AFFECTED PORTIONS AFTER REPAIR.	NOT NECESSARY	100.00	-

Report Ref No. CS/INC22008476/Kny3e2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	SUPPLY SPRAY PAINT MATERIAL AND NECESSARY ITEMS TO RESPRAY AFFECTED AREA / PANEL.		1,000.00	480.00
			2,350.00	795.00
GRAND TOTAL			8,456.40	2,311.50
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION) (CONFIRMED)				1,850.00

Report Ref No. CS/INC22008476/Kny3e2

KONG SENG CHEONG

Licensed Appraiser

K.K.LAU CPT(RET)

BEng(Hons),B.Bus,MBA,PEng,PE,
MInstAEA,MASME,MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.