

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/TMI22008544/GQY3Q2**Date:** 13/12/2022REFERENCE

Handling Insurer:	Tokio Marine Insurance Singapore Ltd	Policy No:	MP002155
Claimant Vehicle No :	SHD7027L	Insured Vehicle No :	GBB5077L
Date of Loss:	31/08/2022	Nature of Claim:	TP
		Claim No:	M2204739

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SHD7027L	Engine No:	D4FDEU480294
Make & Model:	HYUNDAI I40, 1.7 D CRDi (A)	Chassis No:	KMHLB41UMGU078509
Reg. Date:	08/10/2015 (Man. Year: 2015)	Odometer:	866216 km
Colour:	Blue		
Engine Capacity:	1685 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Good	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	Good

CONDITION OF TYRES

Front Tyre Size:	195/65 R15	Rear Tyre Size:	195/65 R15
Front Left Side:	West Lake 6 mm	Rear Left Side:	West Lake 6 mm
Front Right Side:	West Lake 6 mm	Rear Right Side:	West Lake 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	1,409.44	0.00	1,409.44	100.00
Miscellaneous Items	11.00	11.00	0.00	0.00
Labour	1,260.00	780.00	480.00	38.10
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	2,680.44	791.00	1,889.44	70.49
+ GST 7.00/7.00% (S\$)	187.63	55.37	132.26	70.49
Nett Amount (S\$)	2,868.07	846.37	2,021.70	70.49

INSPECTION

Date of Assignment:	01/09/2022	Present Location:	ComfortDelGro Engineering Pte Ltd (Loyang)
Date Inspected:	02/09/2022	Inspected At:	ComfortDelGro Engineering Pte Ltd (Loyang) 59 Loyang Drive Singapore 508969
Estimated Period of Repair:	3.0 days		

Adjuster: XING GUO QIANG**Manager:** SHIAU CHAN*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference	
Part Source: MRM-SG	Version: 1.0 (Last Synchronised: 13 Dec 2022)
Parts: 143	HYUNDAI I40 1.7 D CRDi (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's	(Price-denominated Standard List)
Print Code: (Unsubmitted, no print-code for SHD7027L)	
Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount	
1	1		*FRONT BUMPER	Repair	1,052.20 FL	*- FL	
2	1		*FRONT BUMPER SIDE BRKT RH	Not Necessary	24.60 FL	*- FL	
3	10		*FRONT BUMPER CLIPS	Not Necessary	22.00 FL	*- FL	
4	1		*FRONT FENDER RH	Repair	663.00 FL	*- FL	
					Sub Total (S\$)	1,761.80	0.00
					- List Item Discount on L Items 20.00/20.00% (S\$)	352.36	0.00
					Total Parts (S\$)	1,409.44	0.00

F=Franchise part. L=ListItemDisc.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

No	Qty	Particulars	Repairer's	Amount
Miscellaneous Items				
1	1	OD/TP Case (Insurer)	11.00	11.00
			Sub Total (\$\$)	11.00

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEATING	New	600.00	280.00
2	SPRAY PAINTING	New	600.00	500.00
3	TUFF KOTE	New	60.00	0.00
			Gross Labour Cost (\$\$)	780.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >