

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com; cs-a@lkkauto.com; admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC6/AIG22008561/AYA3Q2**Date:** 31/07/2023**REFERENCE**

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	7220075134
Claimant Vehicle No :	SKT200D	Insured Vehicle No :	SNG9866G
Date of Loss:	26/08/2022	Nature of Claim:	TP
		Claim No:	5898676637SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SKT200D		
Make & Model:	MERCEDES-BENZ A250, 2.0 AMG (A)	Engine No:	26092030089971
Reg. Date:	13/12/2019 (Man. Year: 2019)	Chassis No:	WDD1771462J126118
Colour:	Grey	Odometer:	27852 km
Engine Capacity:	1991 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	245/40 R18	Rear Tyre Size:	245/40 R18
Front Left Side:	Michelin 6 mm	Rear Left Side:	Michelin 6 mm
Front Right Side:	Michelin 6 mm	Rear Right Side:	Michelin 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	18,972.70	14,096.10	4,876.60	25.70
Miscellaneous Items	0.00	0.00	0.00	
Labour	4,380.00	2,150.00	2,230.00	50.91
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	23,352.70	16,246.10	7,106.60	30.43
Approved Total (Overridden) (S\$)		13,000.00		
Nett Amount (S\$)	23,352.70	13,000.00	10,352.70	44.33
+ Loss of Use (14.0 x S\$100.00/day) (S\$)		1,400.00		
Nett Liability (S\$)		14,400.00		
Global Sum Settlement (S\$)		14,300.00		

INSPECTION

Date of Assignment:	29/08/2022	
Date Inspected:	29/08/2022 Inspected At:	ADVANCE AUTO GARAGE (23 KAKI BUKIT) (HQ) 25 KAKI BUKIT AVE 4 #04-01 VICOM KAKI BUKIT Singapore 415933
Estimated Period of Repair:	10.0 days	

Adjuster: ADRIAN LING**Manager:** Ezlyna*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT DOOR	Dented	2,245.00 FL	*2,245.00 FL
2	1		*FRONT DOOR LOCK	Damaged	389.00 FL	*389.00 FL
3	1		*FRONT DOOR WEATHERSTRIPE	Necessary	321.00 FL	*321.00 FL
4	1		*FRONT DOOR INNER TRIM BOARD	Cracked	898.00 FL	*898.00 FL
5	1		*FRONT DOOR OUTER HANDLE	Not Necessary	228.00 FL	*- FL
6	1		*FRONT DOOR GLASS REGULATOR GEAR	Damaged	345.00 FL	*345.00 FL
7	1		*FRONT DOOR GLASS REGULATOR MOTOR	Not Necessary	418.00 FL	*- FL
8	1		*FRONT DOOR GLASS OUTER MOULDING	Not Necessary	218.00 FL	*- FL
9	2		*FRONT DOOR HINGE	Not Necessary	280.00 FL	*- FL
10	1		*ROCKER PANEL OUTER SKIRTING	Deformed	890.00 FL	*890.00 FL
11	1		*REAR DOOR	Dented	2,319.00 FL	*2,319.00 FL
12	1		*REAR DOOR LOCK	Not Necessary	402.00 FL	*- FL
13	1		*REAR DOOR WEATHERSTRIPE	Necessary	343.00 FL	*343.00 FL
14	1		*REAR DOOR INNER TRIM BOARD	Cracked	881.00 FL	*881.00 FL
15	1		*REAR DOOR GLASS REGULATOR GEAR	Damaged	359.00 FL	*359.00 FL
16	1		*REAR DOOR GLASS REGULATOR MOTOR	Not Necessary	450.00 FL	*- FL
17	1		*REAR DOOR GLASS OUTER MOULDING	Not Necessary	204.00 FL	*- FL
18	2		*REAR DOOR HINGE	Not Necessary	280.00 FL	*- FL
19	1		*REAR DOOR CHECK	Not Necessary	95.00 FL	*- FL
20	1		*REAR BUMPER	Torn	1,458.00 FL	*1,458.00 FL
21	1		*REAR LOWER ARM	Bent	635.00 FL	*635.00 FL
22	1		*REAR LOWER ARM COVER	Not Necessary	95.00 FL	*- FL
23	1		*REAR SHOCK ABSORBER	Not Necessary	604.00 FL	*- FL
24	1		*REAR KNUCKLE ARM	Damaged	998.00 FL	*998.00 FL
25	1		*REAR WHEEL HUB C/W BEARING	Damaged	485.00 FL	*485.00 FL
26	1		*REAR CONTROL ARM	Bent	321.00 FL	*321.00 FL
27	1		*REAR STAY ARM	Bent	342.00 FL	*342.00 FL
28	1		*SET FRONT DOOR INNER TRIM BOARD CLIPS	Necessary	50.00 FS	*30.00 FS
29	1		*ROCKER PANEL OUTER SKIRTING GARNISH	Repair	320.00 FS	*- FS
30	1		*SET ROCKER PANEL OUTER SKIRTING GARNISH CLIPS	Not Necessary	50.00 FS	*- FS
31	1		*SET REAR DOOR INNER TRIM BOARD CLIPS	Necessary	50.00 FS	*30.00 FS
32	1		*SET REAR BUMPER CLIPS	Necessary	50.00 FS	*50.00 FS
33	1		*REAR WHEEL RIM	Cut	1,500.00 FS	*880.00 FS
34	1		*REAR TYRE	Not Necessary	300.00 FS	*- FS
35	1		*STICKER WRAP	Necessary	1,800.00 FS	*1,200.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$)	20,623.00	15,419.00
- List Item Discount on L Items 10.00/10.00% (\$)	1,650.30	1,322.90
Total Parts (\$)	18,972.70	14,096.10

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEATING REMOVE AND REFIT PARTS	New	1,400.00	600.00
2	SPRAY PAINTING TO AFFECTED AREA	New	1,400.00	800.00
3	WIRING CHECK	New	100.00	30.00
4	TO APPLY TUFF COAT	New	150.00	60.00
5	TO REMOVE REVERSE SENSOR	New	100.00	50.00
6	TO REMOVE UPHOLSTERY	New	150.00	0.00
7	TO DISMANTLE UNDERCARRIAGE	New	380.00	220.00
8	TO PERFORM WHEEL ALIGNMENT	New	150.00	80.00
9	TO TRANSFER FRONT & REAR DOOR FITTINGS	New	300.00	160.00
10	TO PERFORM DIAGNOSTIC TEST	New	250.00	150.00
Gross Labour Cost (S\$)			4,380.00	2,150.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >