

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com; cs-a@lkkauto.com; admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC6/AIG22008564/AYA3Q2**Date:** 27/03/2023**REFERENCE**

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	7210065422
Claimant Vehicle No :	SKC881C	Insured Vehicle No :	SKH4994H
Date of Loss:	27/08/2022	Nature of Claim:	TP
		Claim No:	8579078974SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SKC881C	Engine No:	CHH312054
Make & Model:	VOLKSWAGEN GOLF, 2.0 GTI (A)	Chassis No:	WVWZZZAUZLW009296
Reg. Date:	30/12/2019 (Man. Year: 2019)	Odometer:	44690 km
Colour:	White		
Engine Capacity:	1984 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	225/40 R18	Rear Tyre Size:	225/40 R18
Front Left Side:	Bridgestone 6 mm	Rear Left Side:	Bridgestone 6 mm
Front Right Side:	Bridgestone 6 mm	Rear Right Side:	Bridgestone 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	57,425.74	31,551.25	25,874.49	45.06
Miscellaneous Items	0.00	0.00	0.00	
Labour	13,140.00	5,470.00	7,670.00	58.37
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	70,565.74	37,021.25	33,544.49	47.54
Approved Total (Overridden) (S\$)		29,600.00		
(S\$)	70,565.74	29,600.00	40,965.74	58.05
+ GST 8.00/8.00% (S\$)	5,645.26	2,368.00	3,277.26	58.05
Nett Amount (S\$)	76,211.00	31,968.00	44,243.00	58.05
+ Loss of Use (18.0 x S\$100.00/day) (S\$)		1,800.00		
+ Doc/Search Fee (S\$)		2.00		
+ Other Costs (S\$)		250.00		
Nett Liability (S\$)		34,020.00		
Global Sum Settlement (S\$)		34,000.00		

INSPECTION

Date of Assignment:	30/08/2022	
Date Inspected:	30/08/2022	Inspected At: Success United Pte Ltd (HQ) 2 Kaki Bukit Ave 2 #01-33, Kaki Bukit AutoHub Singapore 417921
Estimated Period of Repair:	18.0 days	

Adjuster: ADRIAN LING

Manager: Ezlyna

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER ASSY	Distorted	1,365.15 FL	*1,150.00 FL
2	10		*REAR BUMPER CLIPS	Necessary	32.00 FL	*32.00 FL
3	2		*REAR BUMPER SIDE HOLDER L/R	Damaged	116.80 FL	*116.80 FL
4	2		*REAR BUMPER BRACKET L/R	Damaged	110.30 FL	*110.30 FL
5	6		*REAR BUMPER PDC PARKING SENSOR	Damaged	1,505.10 FL	*1,505.10 FL
6	1		*REAR BUMPER TOW HOOK COVER	Distorted	32.65 FL	*32.65 FL
7	1		*REAR BUMPER LOWER EXHAUST GUARD GARNISH	Deformed	326.75 FL	*326.75 FL
8	1		*REAR BUMPER CENTRE BRACKET	Cracked	148.13 FL	*148.13 FL
9	1		*REAR BUMPER REINFORCEMENT	Distorted	585.95 FL	*585.95 FL
10	2		*REAR NO. PLATE LAMP	Damaged	133.16 FL	*133.16 FL
11	2		*REAR REFLECTOR LAMP L/R	Cracked	174.60 FL	*174.60 FL
12	1		*REAR END PANEL	Distorted	986.45 FL	*986.45 FL
13	2		*REAR LAMP L/R	Cracked	996.20 FL	*996.20 FL
14	2		*REAR LAMP PANEL L/R	Dented	744.30 FL	*744.30 FL
15	1		*REAR FENDER L/R	N/S Distorted / O/S Repair	3,665.70 FL	*1,350.00 FL
16	2		*REAR FENDER INNER UPHOLSTERY TRIM L/R	Distorted	793.30 FL	*793.30 FL
17	10		*REAR FENDER INNER UPHOLSTERY TRIM CLIPS	Necessary	32.00 FL	*32.00 FL
18	1		*REAR END PANEL INNER TOP GARNISH	Distorted	216.05 FL	*216.05 FL
19	1		*REAR SPARE TYRE PANEL	Repair	1,398.25 FL	*- FL
20	1		*REAR SPONGE TOOLS TRAY	Damaged	90.52 FL	*90.52 FL
21	1		*REAR TYRE PANEL TRAY	Deformed	480.25 FL	*480.25 FL
22	1		*REAR BOOT LID WEATHERSTRIP	Cut	387.40 FL	*387.40 FL
23	1		*REAR EXHAUST SILENCER BOX ASSY	Not Necessary	1,458.85 FL	*- FL
24	1		*REAR PDC SENSOR WIRE HARNESS	Cut	327.30 FL	*327.30 FL
25	1		*REAR TAILGATE	Distorted	1,983.60 FL	*1,450.00 FL
26	1		*REAR TAILGATE MECHANISM LOCK	Jammed	381.62 FL	*381.62 FL
27	1		*REAR TAILGATE LOCK HOOK	Damaged	56.01 FL	*56.01 FL
28	2		*REAR TAILGATE HINGE L/R	Bent	307.30 FL	*307.30 FL
29	2		*REAR TAILGATE DAMPER ABSORBER L/R	Damaged	343.00 FL	*343.00 FL
30	2		*REAR BOOT LAMP L/R	Cracked	1,036.20 FL	*1,036.20 FL
31	1		*REAR TAILGATE VOLKSWAGEN LOGO	Necessary	150.75 FL	*150.75 FL
32	1		*REAR TAILGATE GTI EMBLEM	Necessary	121.65 FL	*121.65 FL
33	1		*REAR WIPER MOTOR ASSY	Damaged	399.45 FL	*399.45 FL
34	1		*REAR WIPER ARM	Cut	78.65 FL	*78.65 FL
35	1		*REAR WIPER BLADE	Cut	58.30 FL	*58.30 FL
36	1		*REAR WIPER COVER	Cut	28.45 FL	*28.45 FL
37	1		*REAR WINDSCREEN	Shattered	896.40 FL	*896.40 FL
38	3		*REAR WINDSCREEN INNER SIDE GARNISH	Deformed	295.20 FL	*295.20 FL
39	1		*REAR BOOTLID INNER TRIM BOARD	Distorted	371.20 FL	*371.20 FL
40	1		*REAR WINDSCREEN HEATER WIRE	Necessary	28.90 FL	*28.90 FL
41	1		*REAR BOOT LID TENEAU COVER	Deformed	531.70 FL	*531.70 FL
42	2		*REAR FENDER INNER TRIM GARNISH L/R	Not Necessary	506.30 FL	*- FL
43	2		*REAR DOOR L/R	Repair	3,976.90 FL	*- FL
44	2		*REAR DOOR MECHANISM LOCK L/R	Not Necessary	913.50 FL	*- FL
45	1		*REAR REVERSE CAMERA	Damaged	431.20 FL	*431.20 FL
46	2		*REAR BOOT LID INNER LAMP GARNISH L/R	Not Necessary	146.20 FL	*- FL
47	1		*REAR BOOT SPOILER (TOP)	Deformed	1,523.05 FL	*1,523.05 FL
48	2		*REAR BOOT SPOILER SIDE GUARD GARNISH L/R	Necessary	747.90 FL	*747.90 FL
49	2		*REAR TAILGATE STOPPER L/R	Necessary	63.70 FL	*63.70 FL
50	1		*BLINDSPOT MONITOR SENSOR / RADAR L/R	N/S Cracked	2,543.30 FL	*1,271.65 FL
51	2		*BLINDSPOT MONITOR RADAR WIRE HARNESS	Not Necessary	544.60 FL	*- FL
52	1		*FRT BONNET	Repair	1,581.35 FL	*- FL
53	1		*FRT BONNET MECHANISM LOCK	Not Necessary	261.45 FL	*- FL
54	2		*FRT BONNET HINGE L/R	Not Necessary	173.30 FL	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
55	2		*BONNET DAMPER L/R	Not Necessary	270.90 FL	*- FL
56	1		*HEADLAMP ASSY LH	Not Necessary	2,135.25 FL	*- FL
57	1		*HEADLAMP BRACKET LH	Not Necessary	58.45 FL	*- FL
58	1		*FRT GRILLE ASSY	Not Necessary	651.38 FL	*- FL
59	1		*FRT BUMPER ASSY	Deformed	1,238.50 FL	*1,080.00 FL
60	1		*FRT BUMPER SIDE HOLDER LH	Not Necessary	36.55 FL	*- FL
61	1		*FRT BUMPER BRACKET LH	Not Necessary	49.65 FL	*- FL
62	1		*FRT BUMPER INNER SPONGE	Not Necessary	54.05 FL	*- FL
63	1		*FRT BUMPER REINFORCEMENT	Not Necessary	588.50 FL	*- FL
64	2		*FRT BUMPER PDC SENSOR LH	Not Necessary	517.70 FL	*- FL
65	1		*AIR BAG SENSOR	Activated	532.05 FL	*532.05 FL
66	1		*AIR BAG ECU	Activated	1,472.00 FL	*1,472.00 FL
67	1		*DRIVER SEATBELT LH	Activated	1,356.95 FL	*950.00 FL
68	1		*PASSENGER SEATBELT LH	Activated	1,356.95 FL	*950.00 FL
69	1		*REAR WHEEL HOUSE LH	Repair	2,433.75 FL	*- FL
70	1		*REAR DYNA AUDIO SUBWOOFER BOX	Damaged	2,453.54 FL	*2,453.54 FL
71	1		*TYRE PANEL UPHOLSTERY TRIM	Deformed	760.17 FL	*760.17 FL
72	1		*REAR CAMERA POWERBANK	Not Necessary	1,424.64 FL	*- FL
73	2		*REAR BLINDSPORT MONITOR ECU	Not Necessary	2,769.44 FL	*- FL
74	2		*REAR INNER LAMP PANEL SHELL	Distorted	1,021.50 FL	*1,021.50 FL
75	2		*REAR LAMP PANEL LOWER EXTENSION PANEL	Distorted	744.20 FL	*744.20 FL
76	1		*REAR WHEEL HOUSE LOWER EXTENSION PANEL LH	Repair	384.56 FL	*- FL
77	2		*REAR FENDER INNER LOWER AIR DUCT	Distorted	321.40 FL	*321.40 FL
78	1		*REAR TYRE PANEL SIDE EXTENSION PANEL	Repair	211.58 FL	*- FL
79	5		*REAR PDC PARKING SENSOR BRACKET HOLDER	Damaged	435.50 FL	*125.00 FL
80	1		*REAR THIRD BRAKE LAMP	Not Necessary	150.00 FL	*- FL
81	1		*REAR WHEELHOUSE SHELL PANEL RH	Buckled	698.10 FL	*698.10 FL
82	1		*CONTROL UNIT FOR ELECTRONIC REGULATED DAMPING	Damaged	1,807.50 FL	*1,807.50 FL
83	1		*BATTERY	Damaged	350.00 FS	*200.00 FS
84	1		*WINDSCREEN SEALANT	Necessary	40.00 FS	*40.00 FS
85	1		*SETS FRT & REAR NO. PLATE W/FRAME	Rear Damaged	90.00 FS	*45.00 FS
86	1		*REAR BOOT CARGO NETTING	Not Necessary	195.00 FS	*- FS
87	1		*REAR ROAD CAMERA	Missing	480.00 FS	*480.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$) 63,678.05 34,971.95
- List Item Discount on L Items 10.00/10.00% (\$\$) 6,252.31 3,420.70
Total Parts (\$\$) 57,425.74 31,551.25

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE, REARRANGE ELECTRICAL WIRINGS, CHECK LIGHTING	New	250.00	100.00
2	TO REMOVE, REPLACE REAR WINDSCREEN	New	350.00	120.00
3	TO REMOVE, REPLACE & TRANSFER REAR BOOT LID COMPONENTS	New	300.00	60.00
4	TO REMOVE, REINSTALL UPHOLSTERY, INNER TRIM GARNISHES	New	480.00	120.00
5	TO REMOVE, REPLACE EXHAUST SILENCER, REALIGN PIPE LINE	New	360.00	0.00
6	TO REMOVE, REPLACE SEATBELTS TO CHANGE & REPROGRAM ECU	New	550.00	200.00
7	TO REMOVE, REPAIR AND REPLACED DAMAGED BODYPARTS, REALIGN BODYWORKS & WHERE CONSISTENT TO THE ACCIDENT	New	5,800.00	2,200.00
8	TO PUTTY & RESPRAY PAINTING ON REAR BOOT LID, REAR BUMPER, END PANEL, TYRE PANEL, REAR FENDER L/R, REAR DOOR L/R, REAR LAMP PANEL L/R, FRT BONNET AND BUMPER	New	4,200.00	2,000.00
9	C2S COATING	New	600.00	550.00
10	TOWING FROM TP COMPOUND TO WORKSHOP (KING TROLLEY)	New	250.00	120.00
Gross Labour Cost (S\$)			13,140.00	5,470.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >