



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKL 2882P

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BOOT	BENT	1,619.00	1,619.00
1	REAR BOOT LOCK	DENTED	330.00	330.00
1	REAR BOOT RUBBER	SERVICEABLE	180.00	-
1	REAR END PANEL	BENT	630.00	625.50
1	REAR END PANEL TOP GARNISH	BUCKLED	345.00	272.60
1	REAR SPARE TYRE WHEEL HOUSE	TO REPAIR SEE LABOUR	1,049.00	-
1	REAR BUMPER	BENT	690.00	690.00
4	REAR BUMPER PARKTRONIC SENSOR @\$280.00	SHORTED (2 PCS ONLY)	1,120.00	412.00
4	REAR BUMPER PARKTRONIC SENSOR 'O' RING @\$27.00	SERVICEABLE	108.00	-
4	REAR BUMPER PARKTRONIC SENSOR HOLDER @\$34.00	SERVICEABLE	136.00	-
2	REAR BUMPER TOWING COVER @\$45.00	SERVICEABLE	90.00	-
2	REAR BUMPER REFLECTOR @\$66.00	SERVICEABLE	132.00	-
1	REAR BUMPER SPONGE	NO SUCH PARTS	105.00	-
	LESS 25% DISCOUNT		-1,633.50	-987.28
			4,900.50	2,961.82
<u>SPECIAL NETT ITEMS</u>				
1	REAR BOOT EMBLEM (SN)	NECESSARY	56.00	56.00
1	REAR BOOT 'ESTIMA' DESIGNATION (SN)	NECESSARY	56.00	56.00
1	REAR BOOT 'AERAS' DESIGNATION (SN)	NECESSARY	67.00	67.00
1	REAR LICENSE SMART PLATE & CASING (SN)	SERVICEABLE	35.00	-
			214.00	179.00
<u>LABOUR</u>				
	REMOVE AND REFIT REAR WINDSCREEN .		200.00	120.00
	HEAT/WELD/CUT/RENEW REAR END PANEL, HEAT/WELD CUT/RENEW REAR SPARE TYRE WHEEL HOUSE, HEAT/WELD/BEATING/PULL/STRAIGHTEN/ALIGN REAR CHASSIS FRAME BY CHASSIS ALIGNMENT JACK. INCLUSIVE OF THE REPAIR OF REAR SPARE TYRE WHEEL HOUSE .}		1,200.00	600.00
	REMOVE AND TRANSFER REAR BOOT NECESSARY ATTACHMENT SPART PART ITEMS.}		-	-

Report Ref No. CS/AGI22008654/Kny3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE AND TRANSFER REAR BUMPER NECESSARY ATTACHMENT SPART PART ITEMS.}		-	-
	REMOVE AND REFIT REAR BOOT ,REAR BOOT LOCK ,REAR END PANEL TOP GARNISH ,REAR BUMPER ,REAR BUMPER PARKTRONIC SENSORS,REAR BUMPER PARKTRONIC SENSOR 'O' RINGS ,REAR BUMPER PARKTRONIC SENSOR HOLDERS,REAR BUMPER TOWING COVERS ,REAR BUMPER REFLECTORS ,REAR BUMPER SPONGE.}		-	-
	DIAGNOSTIC AND RESET REAR BUMPER PARKTRONIC SENSOR FAULT ERROR BY HHT.		100.00	50.00
	UNDER COATING ON REAR DAMAGED PORTION .		150.00	60.00
	PUTTY /PRIMER APPLICATION ,SPRAY PAINTING ON REAR BOOT ,REAR END PANEL,REAR SPARE TYRE WHEEL HOUSE,REAR BUMPER ,REAR BUMPER PARKTRONIC SENSORS ,REAR BUMPER TOWING COVERS (PEARL WHITE).		1,800.00	660.00
			3,450.00	1,490.00
GRAND TOTAL			8,564.50	4,630.82
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				3,700.00

Report Ref No. CS/AGI22008654/Kny3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.