

SKC3537C - Submitted by: Lai Huat (Meng Kee) Motor Pte Ltd (Sin Ming)



1/32: Front View Right



2/32: Front View



3/32: Front View Left

SKC3537C - Submitted by: Lai Huat (Meng Kee) Motor Pte Ltd (Sin Ming)



4/32: Photographs of Damaged Parts



5/32: Photographs of Damaged Parts



6/32: Photographs of Damaged Parts

SKC3537C - Submitted by: Lai Huat (Meng Kee) Motor Pte Ltd (Sin Ming)



7/32: Photographs of Damaged Parts



8/32: Photographs of Damaged Parts



9/32: Photographs of Damaged Parts

SKC3537C - Submitted by: Lai Huat (Meng Kee) Motor Pte Ltd (Sin Ming)



10/32: Photographs of Damaged Parts



11/32: Photographs of Damaged Parts



12/32: Photographs of Damaged Parts

SKC3537C - Submitted by: Lai Huat (Meng Kee) Motor Pte Ltd (Sin Ming)



13/32: Photographs of Damaged Parts



14/32: Photographs of Damaged Parts



15/32: Photographs of Damaged Parts

SKC3537C - Submitted by: Lai Huat (Meng Kee) Motor Pte Ltd (Sin Ming)



16/32: Photographs of Damaged Parts



17/32: Photographs of Damaged Parts



18/32: Photographs of Damaged Parts

SKC3537C - Submitted by: Lai Huat (Meng Kee) Motor Pte Ltd (Sin Ming)



19/32: **Photographs of Damaged Parts**



20/32: **Photographs of Damaged Parts**



21/32: **Photographs of Damaged Parts**


SKC3537C - Submitted by: Lai Huat (Meng Kee) Motor Pte Ltd (Sin Ming)



22/32: Photographs of Damaged Parts



23/32: Photographs of Damaged Parts

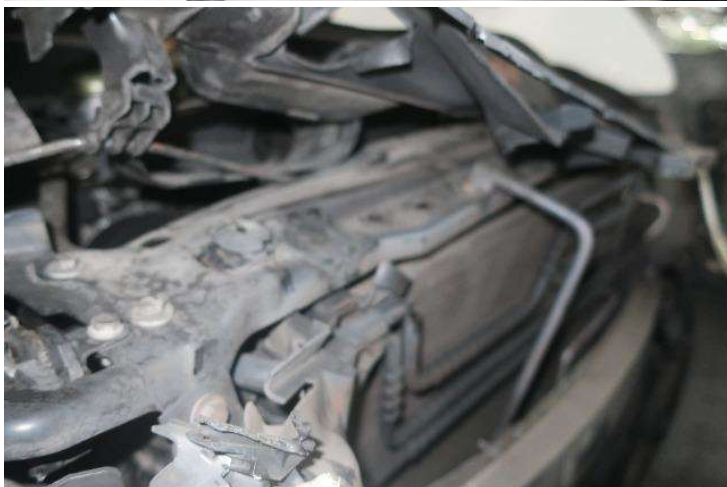

24/32: Photographs of Damaged Parts

SKC3537C - Submitted by: Lai Huat (Meng Kee) Motor Pte Ltd (Sin Ming)



25/32: Photographs of Damaged Parts



26/32: Photographs of Damaged Parts



27/32: Photographs of Damaged Parts

SKC3537C - Submitted by: Lai Huat (Meng Kee) Motor Pte Ltd (Sin Ming)



28/32: Photographs of Damaged Parts



29/32: Photographs of Damaged Parts



30/32: Tyre - Bridgestone; Tyre size - 225 45 R17

SKC3537C - Submitted by: Lai Huat (Meng Kee) Motor Pte Ltd (Sin Ming)



31/32: Odometer Reading



32/32: Accident Scene