



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Ref: CC6/CTI22008942/Kpa3q2 Date: 30/06/2023 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	PC 6823Y	Veh. Inspected	GZ 2181C
Policy No.	DMB1SNW00015932104	Coverage (\$)	0.00
Claim No.	SNM22D206218/C02/PC6823Y/ KHONGLH	Excess (\$)	0.00
Assign From		Assign Date	12/09/2022
2. Vehicle Particulars & Condition			
Make & Model	TOYOTA HILUX (M)	c.c	2494
Engine No.	HIDDEN	Year of Reg.	2006
Chassis No.	MR0CS12G300016606	Colour	SILVER
Odometer	373509 KM	Steering	JAMMED
Brakes	IN ORDER	Modification	NIL
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	195 R15X8	BRIDGESTONE	2 mm
L/H Front Tyre	195 R15X8	BRIDGESTONE	2 mm
R/H Rear Tyre	195 R15X8	BRIDGESTONE	6 mm
L/H Rear Tyre	195 R15X8	BRIDGESTONE	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION & N/S BODY. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	01/09/2022	Inspection Date	09/09/2022
Survey held at	GUAN MOTOR WORKS 176 SIN MING DRIVE #02-03 SIN MING AUTOCARE SINGAPORE 575721		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		21 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GZ 2181C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BUMPER	BUCKLED	663.90	663.90
1	FRONT BUMPER LH FOG LAMP COVER	SERVICEABLE	226.90	-
2	FRONT BUMPER SIDE RETAINER	N/S DISTORTED	60.60	30.30
1	LH HEADLAMP	SERVICEABLE	730.50	-
1	FRONT GRILLE	CRACKED	519.30	519.30
1	FRONT GRILLE CENTRE 'TOYOTA' LOGO	NECESSARY	79.10	79.10
1	FRONT LH FENDER	BENT	1,288.90	1,288.90
1	FRONT LH FENDER SIGNAL LAMP	SERVICEABLE	22.90	-
1	FRONT LH FENDER UNDER SHIELD	DISTORTED	256.90	256.90
1	SET FRONT LH MUDFLAP	DISTORTED	147.80	147.80
1	SET FRONT FENDER UNDER SHIELD CLIPS	NECESSARY	40.00	40.00
1	FRONT LH SHOCK ABSORBER	BENT	361.00	361.00
1	FRONT LH LOWER ARM	BENT	1,414.70	1,207.40
1	FRONT LH TOP ARM	BENT	1,001.30	1,001.30
1	FRONT LH KNUCKLE ARM	BENT	1,120.50	1,120.50
1	FRONT LH WHEEL HUB	BENT	417.20	417.20
1	FRONT LH WHEEL BEARING	NECESSARY	189.30	189.30
1	STEERING RACK & PINION	BENT / JAMMED	4,926.70	4,220.60
1	FRONT ENGINE CROSS MEMBER	SERVICEABLE	2,997.50	-
1	FRONT LH DOOR MIRROR ASSY	DENTED / CUT	950.00	950.00
1	FRONT LH DOOR	BENT	1,786.40	1,457.00
1	FRONT LH DOOR 'HILUX' EMBLEM	NECESSARY	47.93	47.93
1	FRONT LH DOOR 'D4D' EMBLEM	NECESSARY	60.60	60.60
1	FRONT LH DOOR OUTER HANDLE	DENTED	235.30	235.30
2	FRONT LH DOOR HINGE (TOP & BOTTOM)	LOWER BENT	373.80	186.90
1	FRONT LH DOOR WEATHERSTRIP	SERVICEABLE	275.65	-
1	REAR BUMPER	BENT	699.75	699.75
1	REAR BUMPER INNER REINFORCEMENT	BENT	486.70	486.70
2	REAR BUMPER INNER BRACKET	TO REPAIR SEE LABOUR	370.00	-
2	REAR NUMBER PLATE LAMP	CRACKED	85.70	85.70
1	REAR TOW HOOK	TO REPAIR SEE LABOUR	187.40	-
1	REAR TAILGATE	BENT	1,517.90	1,517.90



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR TAILGATE LH 'TOYOTA' EMBLEM	NECESSARY	67.80	67.80
1	REAR TAILGATE RH 'HILUX' EMBLEM	NECESSARY	56.93	56.93
1	REAR TAILGATE RH 'J' EMBLEM	NECESSARY	49.80	49.80
2	REAR TAILGATE TOP SIDE LOCK	BENT	355.60	355.60
2	TAILLAMP	BROKEN	739.40	739.40
2	REAR SIDE BODY PANEL (FENDER)	BENT	3,956.80	3,602.40
1	REAR FLOOR DECK ASSY	BENT	2,504.70	2,504.70
1	REAR DECK END PANEL	BENT	789.63	789.63
	LESS 25% DISCOUNT		-8,015.70	-6,359.39
			24,047.09	19,078.15
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT NUMBER PLATE (SN)	BENT	45.00	20.00
1	FRONT LH WHEEL RIM (SN)	BENT	220.00	220.00
1	FRONT LH TYRE (20%) (SN)	TORN	180.00	36.00
1	FRONT LH DOOR LOWER BLACK STICKER (SN)	NECESSARY	40.00	40.00
1	SET REVERSE SENSORS (SN)	DENTED	250.00	200.00
1	REAR NUMBER PLATE (SN)	DENTED	45.00	20.00
1	REAR TAILGATE LH '70KM/H' STICKER (SN)	NECESSARY	12.00	12.00
1	REAR TAILGATE RH '8 PAX' STICKER (SN)	NECESSARY	12.00	12.00
			804.00	560.00
	<u>LABOUR</u>			
	TOWING CHARGES.		100.00	50.00
	LABOUR CHARGES FOR REMOVE /REFIT ,CUTTING /WELDING AND REPLACEMENT OF DAMAGES.		2,500.00	2,200.00
	TO PUTTY AND SPRAY SPRAY PAINTING CHARGES.		2,400.00	1,800.00
	TO CHECK WIRING AND LIGHTINGS FOR FRONT & REAR PORTION .		60.00	40.00
	TO REMOVE ,REFIT FRONT UNDER CARRIAGES.		300.00	200.00
	TO CONDUCT COMPUTERISE WHEEL ALIGNMENT TEST.		80.00	60.00
	TO REMOVE ,REFIT FRONT LH DOOR FITTINGS .		80.00	60.00
	TO LIFT UP & DISMANTLE REAR DECK ASSY .		300.00	200.00
	TO SUPPLY &APPLY ANTI RUST TREATMENTS.		120.00	120.00
			5,940.00	4,730.00
	GRAND TOTAL		30,791.09	24,368.15



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			19,400.00
---	--	--	------------------

Report Ref No. CC6/CT122008942/Kpa3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GZ 2181C

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd





51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GZ 2181C

RE-INSPECTION

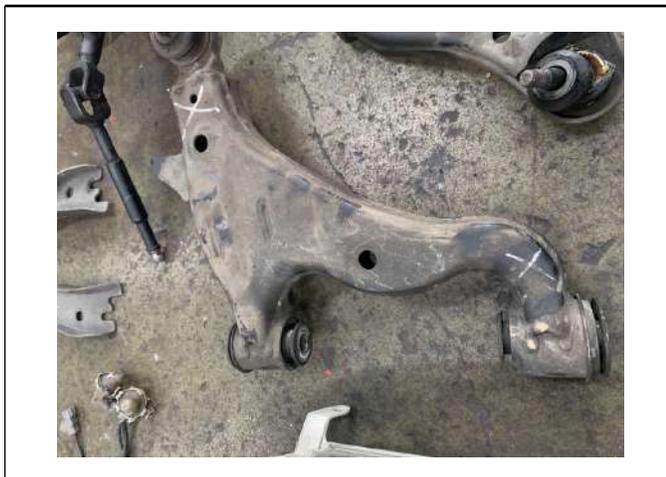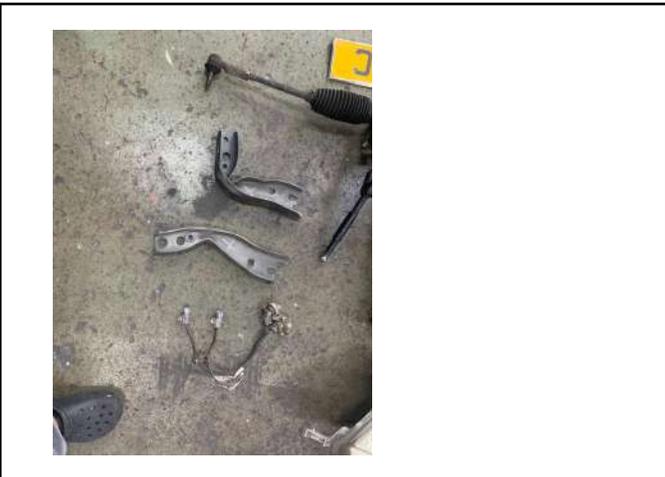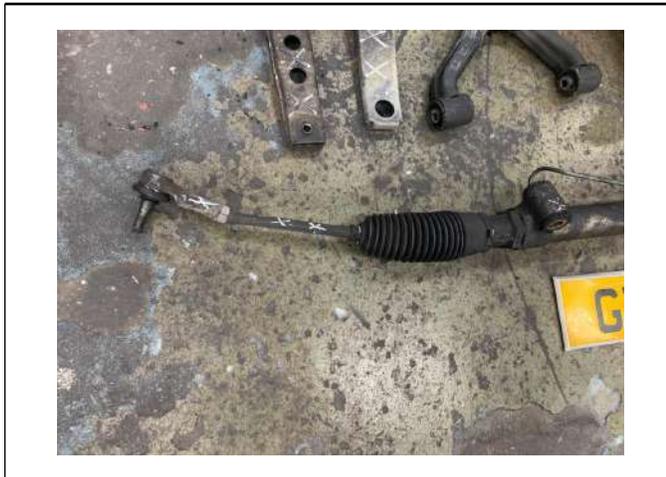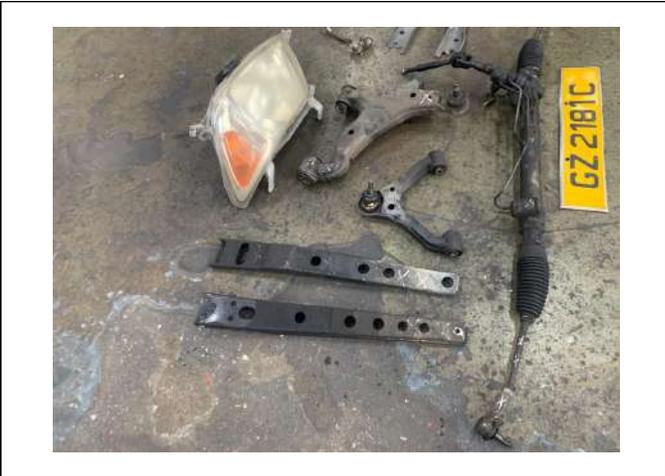



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GZ 2181C

RE-INSPECTION

