

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS3/EG122009037/TWY3E2**Date:** 10/11/2022REFERENCE

Handling Insurer:	ERGO Insurance Pte. Ltd.	Policy No:	DMCG21003167
Claimant Vehicle No :	XE7733L	Insured Vehicle No :	YP6143B
Date of Loss:	20/04/2021	Nature of Claim:	TP
		Claim No:	CDMCG21000753

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	XE7733L		
Make & Model:	MITSUBISHI FUSO, 12.0 D FV51SKM2DEA (M)	Engine No:	OM457LA457972C0309512
Reg. Date:	24/07/2015 (Man. Year: 2015)	Chassis No:	FV51SKA10021
Colour:	White	Odometer:	427711 km
Engine Capacity:	11967 cc		
Market Value/New Car Price:	N/A		
Sum Insured (\$\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	295/80 R22.5	Rear Tyre Size:	295/80 R22.5 (D)
Front Left Side:	LANVIGATOR 8 mm	Rear Left Side:	LANVIGATOR 8/8 mm
Front Right Side:	LANVIGATOR 8 mm	Rear Right Side:	LANVIGATOR 8/8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (\$\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment:	14/09/2022	
Date Inspected:	14/09/2022	Inspected At: 68 Kaki Bukit Avenue 6, #01-22 ARK @ KB
Estimated Period of Repair:	10.0 days	Repairer: Zoom Autowerks Pte Ltd

Adjuster: MOHD TAUFIKH BIN HAMID**Manager:** XinYu

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.

B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.

THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.

C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$12,000.00
-\$15,000.00

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 10 Nov 2022)	
Parts:	N/A	MITSUBISHI FUSO 12.0 D FV51SKM2DEA (M) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for XE7733L)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >