1/10/23, 8:46 AM Adjuster Report

## LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

#### VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/CTI22009100/UQY3Q2

10/01/2023 Date:

**REFERENCE** 

No:

China Taiping Insurance Handling Insurer:

(Singapore) Pte. Ltd.

Policy No:

DMCVSNW00031622201

**Claimant Vehicle** 

YQ6826J

Insured

**GBJ3367X** 

Vehicle No:

Date of Loss: 12/09/2022 Nature of Claim: TP

Claim No:

SNM22D206581/C02/TOHHS

**DESCRIPTION & IDENTIFICATION OF VEHICLE** 

YQ6826J Reg No:

Make & Model: TOYOTA DYNA 150, 3.0 D 5MT (M)

29/04/2022 (Man. Year: 2022)

Engine No: Chassis No: Odometer:

1GD8894132 JHHAGV4680K002155

18595 km

Colour:

Silver 2755 cc

**Engine Capacity:** Market Value/New Car

Sum Insured (S\$):

Price:

Reg. Date:

N/A

Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Footbrake (Serviceable): Yes Yes

Handbrake (Serviceable): Yes **Engine Modification:** No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 175/75 R15 Rear Tyre Size: 145/80 R13

Front Left Side: Rear Left Side: Bridgestone 8/8 mm Bridgestone 8 mm Bridgestone 8/8 mm Front Right Side: Bridgestone 8 mm Rear Right Side:

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	670.00	476.00	194.00	28.96
Miscellaneous Items	410.00	20.00	390.00	95.12
Labour	310.20	310.20	0.00	0.00
Paintwork Labour	743.91	743.91	0.00	0.00
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	2,134.11	1,550.11	584.00	27.37
Approved Total (Overridden) (S\$)		1,550.00		
(S\$)	2,134.11	1,550.00	584.11	27.37
+ GST 7.00/7.00% (S\$)	149.39	108.50	40.89	27.37
Nett Amount (S\$)	2,283.50	1,658.50	625.00	27.37

**INSPECTION** 

Date of Assignment: 16/09/2022 Present Location: Jin Auto Services Pte Ltd (Defu)

Jin Auto Services Pte Ltd (Defu) Date Inspected: 09/12/2022 Inspected At:

Blk 14 Defu Lane 10, #01-410/412

Singapore 539195

Estimated Period of Repair: 3.0 days

Adjuster: MARCUS CHUA Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

1/10/23, 8:46 AM Adjuster Report

### **REPAIR DETAILS**

Reference

Part Source: (Last Synchronised: 09 Jan 2023)

Parts: N/A TOYOTA DYNA 150 3.0 D 5MT (M) (Model not available in database)

Labour: Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for YQ6826J)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with

the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk \*.

#### **Recommended Parts**

No. Qty Part No.	Particulars	Condition	Repairer's	Amount
1 1 F=Franchise part.	*TOTAL PARTS		670.00 F	*476.00 F
r ranomos para		Total Parts (S\$)	670.00	476.00
	Report was u	nsubmitted during this print-out.		

# Recommended Miscellaneous Items

No	Qty	Particulars		Repairer's	Amount
Mis	cellan	eous Items			
1	1	13 PAX STICKER (NECESSARY)		15.00	10.00
2	1	60KM/HR STICKER (NECESSARY)		15.00	10.00
3	3 1	TAILGATE ALUMINIUM COVER (REPAIR)		380.00	0.00
			Sub Total (S\$)	410.00	20.00

## Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount	
<u>Pair</u>	ntwork Labour				
1	TOTAL PAINT LABOUR CHARGE	New	743.91	743.91	
Lab	our Items				
2	TOTAL LABOUR CHARGE	New	310.20	310.20	
		Gross Labour Cost (S\$)	1,054.11	1,054.11	
	Report was unsubmitted during this print-out.				

< END OF ESTIMATES >