



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI22009179/Epa3q2 Date: 03/01/2023 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SJT 2363R	Veh. Inspected	SMG 6308H	
Policy No.	DMPCNA00050722202	Coverage (\$)	0.00	
Claim No.	SNM22D206692/C02/SJT2363R /LEEPG	Excess (\$)	0.00	
Assign From		Assign Date	19/09/2022	
2. Vehicle Particulars & Condition				
Make & Model	HONDA CITY	c.c	1497	
Engine No.	HIDDEN	Year of Reg.	2018	
Chassis No.	MRHGM6670KT000158	Colour	SILVER	
Odometer	63148 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/60 R15	MICHELIN	4 mm	
L/H Front Tyre	195/60 R15	MICHELIN	4 mm	
R/H Rear Tyre	195/60 R15	MICHELIN	4 mm	
L/H Rear Tyre	195/60 R15	MICHELIN	4 mm	
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE FRONT O/S PORTION. DAMAGES SEE DETAILS.			
5. General Information				
Accident Date	16/09/2022	Inspection Date	19/09/2022	
Survey held at	AUTOMOTIVE REPAIR CENTRE PTE LTD 38 WOODLANDS INDUSTRIAL PARK E1 # 05-18 SINGAPORE 757700			
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMG 6308H

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT BUMPER	BROKEN	509.80	509.80
1	FRONT BUMPER SIDE RETAINER RH	NOT NECESSARY	31.40	-
1	FRONT FENDER RH	DENTED	393.80	393.80
1	FRONT FENDER INNERSHIELD RH	NOT NECESSARY	96.50	-
1	FRONT DOOR RH	DENTED	788.40	788.40
1	FRONT DOOR UPPER RH	NOT NECESSARY	76.80	-
1	FRONT DOOR HINGE LOWER RH	NOT NECESSARY	78.40	-
1	FRONT HEADLAMP RH	NOT NECESSARY	695.70	-
1	FRONT RIM RH	CUT	640.20	640.20
1	FRONT WHEEL BEARING RH	NOT NECESSARY	173.50	-
1	FRONT WHEEL HUB RH	NOT NECESSARY	188.20	-
1	FRONT LOWER ARM RH	NOT NECESSARY	210.30	-
1	FRONT KNUCKLE ARM RH	NOT NECESSARY	246.70	-
1	FRONT SHOCK ABSORBER RH	NOT NECESSARY	381.20	-
1	FRONT SHOCK ABSORBER MOUNTING RH	NOT NECESSARY	55.80	-
1	FRONT TIE ROD END RH	NOT NECESSARY	91.80	-
1	FRONT STABILIZER LINKAGE RH	NOT NECESSARY	69.80	-
	LESS 20% DISCOUNT		-945.66	-466.44
			3,782.64	1,865.76
<u>SPECIAL NETT ITEMS</u>				
10	FRONT BUMPER CLIPS @\$5.00 (SN)	NECESSARY	50.00	30.00
10	FRONT FENDER INNERSHIELD CLIPS @\$5.00 (SN)	NOT NECESSARY	50.00	-
			100.00	30.00
<u>LABOUR</u>				
	REMOVE,REFIT ,REPAIR AND REPLACE ACCIDENT AFFECTED PARTS.		1,000.00	700.00
	SPRAY PAINT (FRONT BUMPER ,FRONT FENDER RH ,FRONT DOOR RH,ROCKER PANEL RH).		1,000.00	800.00
	TO PERFORM 4 WHEEL ALIGNMENT.		70.00	70.00
	REMOVE,REFIT AND REPLACE FRONT UNDERCARRIAGE RH .	NOT NECESSARY	180.00	-
	TRANSFER DOOR FITTING AND WINDOW MECHANISM TO NEW DOOR .		80.00	50.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	CHECK AND RECTIFY ELECTRICAL WIRING.		50.00	30.00
			2,380.00	1,650.00
GRAND TOTAL			6,262.64	3,545.76
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				2,850.00

Report Ref No. CC6/CTI22009179/Epa3q2

CHEN TSUE YEE

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMG 6308H

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

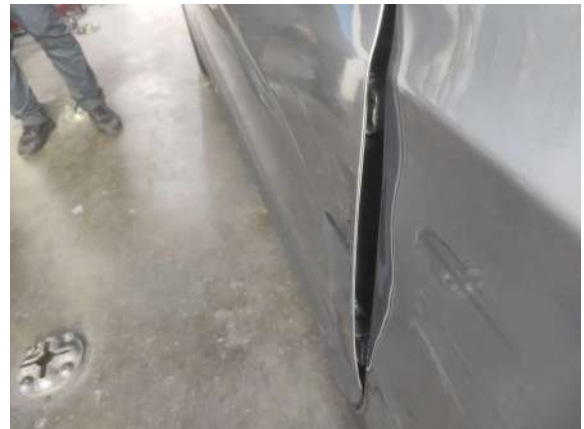



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMG 6308H

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMG 6308H

RE-INSPECTION

