



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKH 8255G

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BUMPER	DEFORMED/TORN	1,550.00	1,450.00
1	FRONT BUMPER SIDE BRACKET RH	DEFORMED	135.60	135.60
1	FRONT BUMPER REINFORCEMENT	NOT NECESSARY	625.80	-
1	FRONT BUMPER SPONGE SIDE RH	TORN/COMPRESSED	102.50	102.50
1	FRONT BUMPER CHROME MOULDING RH	DEFORMED	89.30	89.30
1	FRONT BUMPER FOG LAMP GARNISH CHROME RIM RH	DEFORMED/TORN	124.80	124.80
1	FRONT BUMPER FOG LAMP RH	FRACTURED	168.50	168.50
3	FRONT BUMPER PARKING SENSOR @\$298.50	DENTED/MALFUNCTION (1PIECE ONLY)	895.50	298.50
1	FRONT BUMPER NOZZLE RH	FRACTURED	98.30	98.30
1	FRONT BUMPER NOZZLE COVER RH	GRAZED/FRACTURED	83.00	83.00
1	HEADLAMP RH	DEFACED/HOLDER BROKEN	3,250.00	2,955.00
1	HEADLAMP PANEL RH	NOT NECESSARY	165.80	-
1	FRONT FENDER RH - DENTED	TO REPAIR SEE LABOUR	1,100.00	-
1	FRONT FENDER BADGE RH	NECESSARY	65.00	65.00
1	FRONT FENDER INNER SHIELD -FRONT RH	REUSE	190.00	-
1	BONNET - GRAZED (NPA)	TO REPAIR SEE LABOUR	-	-
	LESS 10% DISCOUNT		-864.41	-557.05
			7,779.69	5,013.45
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT BUMPER CLIPS (SN)	NECESSARY	55.00	30.00
			55.00	30.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	TO DISMANTLE, REPLACE, CUT, WELD, KNOCK OUT DENTS TO STRAIGHTEN ACCIDENT PARTS AS-MENTIONED ON THE 'PARTS REPAIR' COLUMN INCLUSIVE OF REPLACEMENT PARTS. INCLUSIVE OF THE REPAIR OF FRONT FENDER RH -DENTED & BONNET - GRAZED.		720.00	450.00
	PUTTY & SPRAY PAINTING TO ADJACENT PANELS. JOB ALLOWANCE. PAINT / MATERIAL.		750.00	660.00
	APPLY RUST PROOFING ON THE ADJACENT PANELS.		40.00	30.00
	REMOVE AND REPLACE FRONT BUMPER SENSOR & CONDUCT DISTANCE SAFETY SETTING.		76.50	76.50
	SPECIALIST CHARGES - CHECK/DIAGNOSTIC AND REPROGRAMMING.		180.00	180.00
	WIRING AND BULB CHECKING.		27.00	27.00
			1,793.50	1,423.50
	GRAND TOTAL		9,628.19	6,466.95
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				5,400.00

Report Ref No. CS1/SPF22009224/Eqy3m4

NOTES : THE ESTIMATED UPPER RANGE OF REPAIR COST FOR THE DAMAGED VEHICLE IS IN THE REGION OF \$5,400-\$5,500

CHEN TSUE YEE

Automotive Assessor

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.