

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Allianz Insurance Singapore Pte. Ltd.
79 Robinson Road #09-01
Singapore 068897

Our File No: CS/AIS22009288/RQY3Q2**Date:** 13/02/2023**REFERENCE**

Insured/Claimant:	CAR(S) LEASING PTE LTD	Policy No:	SP2002749495
Date of Loss:	16/09/2022	Nature of Claim:	OD
		Claim No:	202222006898JK

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	GBL1127A	Engine No:	1GD8665579
Make & Model:	TOYOTA HIACE, 2.8 D DX (A)	Chassis No:	GDH2012016494
Reg. Date:	17/03/2021 (Man. Year: 2020)	Odometer:	47501 km
Colour:	White		
Engine Capacity:	2754 cc		
Market Value/New Car Price:	S\$90,000.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	195/60 R15	Rear Tyre Size:	195/60 R15
Front Left Side:	Dunlop 6 mm	Rear Left Side:	Dunlop 6 mm
Front Right Side:	Dunlop 6 mm	Rear Right Side:	Dunlop 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	8,157.50	6,733.00	1,424.50	17.46
Miscellaneous Items	0.00	0.00	0.00	
Labour	2,800.00	1,590.00	1,210.00	43.21
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	10,957.50	8,323.00	2,634.50	24.04
Approved Total (Overridden) (S\$)		6,650.00		
- Excess (S\$)	0.00	2,000.00	-2,000.00	
(S\$)	10,957.50	4,650.00	6,307.50	57.56
+ GST 7.00/7.00% (S\$)	767.03	325.50	441.53	57.56
Nett Amount (S\$)	11,724.53	4,975.50	6,749.03	57.56

INSPECTION

Date of Assignment:	20/09/2022 Present Location:	Forza Autohaus Pte Ltd (HQ)
		Forza Autohaus Pte Ltd (HQ)
Date Inspected:	21/09/2022 Inspected At:	No.39 Woodlands Close, #01-34/35,
		Mega@Woodlands
		Singapore 737856
Estimated Period of Repair:	7.0 days	

Adjuster: MOHD RASUL**Manager:** SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 12 Feb 2023)
Parts:	213	TOYOTA HIACE 2.8 D DX (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for GBL1127A)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BONNET	Bent	380.00 F	*380.00 F
2	1		*FRONT BONNET HINGE L/R	N/S Serviceable / O/S Bent	140.00 F	*70.00 F
3	1		*FRONT BRAKE BOOSTER	Bent	1,050.00 F	*1,050.00 F
4	1		*FRONT CORNER PANEL RH	Bent	235.00 F	*235.00 F
5	1		*FRONT GRILLE ASSEMBLY	Missing	450.00 F	*450.00 F
6	1		*FRONT GRILLE ASSEMBLY INNER BACKING	Cracked	215.00 F	*215.00 F
7	1		*FRONT HEADLAMP (LED) RH	Broken	1,550.00 F	*1,550.00 F
8	1		*FRONT HEADLAMP (LED) CONTROL MODULE RH	Cracked	370.00 F	*370.00 F
9	1		*FRONT DOOR RH	Repair	1,120.00 F	*- F
10	1		*FRONT DOOR PILLAR RH (REPAIR) (NPA)	Repair	0.00 F	*- F
11	1		*FRONT BUMPER	Torn	435.00 F	*435.00 F
12	1		*FRONT BUMPER RETAINER RH	Cracked	95.00 F	*95.00 F
13	1		*FRONT BUMPER REINFORCEMENT	Bent	320.00 F	*320.00 F
14	1		*FRONT BUMPER TOW COVER LH	Serviceable	25.00 F	*- F
15	1		*FRONT BUMPER CLIPS SET	Necessary	20.00 FS	*20.00 FS
16	1		*FRONT BUMPER FOG LAMP GARNISH RH	Missing	135.00 F	*135.00 F
17	1		*FRONT BUMPER NUMBER PLATE	Cracked	25.00 FS	*25.00 FS
18	1		*CABLE CONNECTOR BLOCK RH	Cut	225.00 F	*225.00 F
19	1		*AIR CLEANER ASSY	Cracked	420.00 F	*420.00 F
20	1		*FRONT HEADLAMP BRACKET RH	Serviceable	80.00 F	*- F
21	1		*FRONT BUMPER LOWER GRILLE GARNISH	Cracked	130.00 F	*130.00 F
						F=Franchise part. S=SpcNett.
					Sub Total (\$\$)	7,420.00 6,125.00
					+ Margin on L,N Items 10.00/10.00% (\$\$)	737.50 608.00
					Total Parts (\$\$)	8,157.50 6,733.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO DISMANTLE AND REINSTATE DASHBOARD TRIM	New	200.00	0.00
2	TO REMOVE AND REPLACE FRONT BRAKE BOOSTER	New	100.00	60.00
3	TO CHECK WIRING AND HEADLAMP FOCUSING	New	100.00	30.00
4	TO PROVIDE LABOUR, WORKSMANSHIP TO CHANGE ABOVE DAMAGED BODYPARTS, REPAIR , RE-ALIGN BODY STRUCTURE , BODY ALIGNMENTS AND DAMAGED CONSISTENT TO THE ACCIDENT	New	1,200.00	700.00
5	TO RE-SPRAYING PAINTING ON THE CHANGED BODYPARTS, REPAIR PORTION , AND WHERE CONSISTENT TO THE ACCIDENT	New	1,200.00	800.00
Gross Labour Cost (S\$)			2,800.00	1,590.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >