Auto Insure Pte. Ltd 6 Marsiling Lane 739145

Full Report

Insurer Reference: GBB1938D

Repairer Reference: M6019/GBB1938D Date calculated: 14/11/2022 12:08 PM

Registration: GBB1938D Printed: 14/11/2022 12:09 PM

Summary Information

Claim

Location: Singapore (SG) Work Provider: China Taiping Insurance

(Singapore) Pte Ltd

Printed by: Claim Reference:

Marvyn Chua GBB1938D Currency: SGD
Date of Incident: 24/08/22

Hire Car Start: Hire Car End:

Actual Repair Days:

Estimated Repair Time:

Vehicle Details

Vehicle

Manufacturer: TOYOTA Model: HIACE

Sub Model: BASE MODEL
Model Sheet Number: 70 84 01
Registration: GBB1938D

VIN number: JTFHT02P800030889

Odometer:

Model Specs

R/SLIDING DOOR BUS TWO COAT METALLIC PREPARE OFF VEHICLE


Vehicle Condition

Vehicle Status

Pre-Accident Damage: Date of Inspection:

Damage Areas

All	
Underbody	

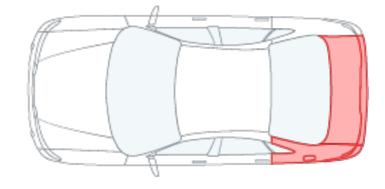

Tyres Condition

Tyre Brand Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner), Tread (Right Outer), Tread (Right Outer),

mm mm mm mm Middle), mm

Spare Tyre Brand

Tread (Spare), mm

Labour

	Time Base 10 WU/h	Price = 42.	00 SGD/h
Code	Description	WU	Price SGD
G036	R + R LEFT CENTRE SLIDING WINDOW	24.0	100.80
B270	RENEW L/RR WING	196.0	823.20
NO NUMBER	RENEW REAR END PANEL INCLUDES: R + R BUMPER, TAILGATE SEAL, LOCK STRIKER PLATE AND SPARE WHEEL CARRIER	46.0	193.20
B390	RENEW TAILGATE INCLUDES: R + R TAILGATE AND NECESSARY ATTACHED PARTS DOES NOT INCLUDE: R + R REAR WINDOW	30.0	126.00
G040	R + R TAILGATE REAR SCREEN	23.0	96.60
NO NUMBER	R + R L/R BUMPER CORNER	3.0	12.60
3577	L/R CORNER PILLAR REPAIR	15.0*	63.00

Labour Cost	Hrs	WU	
Panel / Mechanical Labour	33.70	337.0	1,415.40

_	•		-
בע		n	•
Га			L

Paint Work	SYSTEM AZT Time Basis 10 WU/	
Code	Description - TWO COAT METALLIC	WU Price SGD
	REAR PANEL NEW PART PAINTING	15.0
	BOOTLID/TAILGATE NEW PART PAINTING	27.0
	L/RR SIDE PANEL NEW PART PAINTING	40.0
	L/R CORNER PILLAR REPAIR PAINTING <50%	8.0

Paint Material Per Part

Total of Labour

Code	Description	Price SGD
2711	REAR PANEL NEW PART PAINTING	14.30
2931	BOOTLID/TAILGATE NEW PART PAINTING	91.85
3481	L/RR SIDE PANEL NEW PART PAINTING	60.50
3577	L/R CORNER PILLAR REPAIR PAINTING <50%	5.81

Labour Cost - Paint		Hrs	WU	Price SGD
Factor	42.00 SGD/h			
Time Paint			90.0	
Preparation Main Work Metal		2.50	25.0	105.00
Total	10 WU/h	11.50	115.0	483.00

Material Cost - Paint	Price SGD
New Part Painting	166.65
Repair Painting	5.81
Material-constant Metal Preparation	28.60
Total	201.06

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2015-06-01/01 Price SGD
3015 2977 2931 2619 2591 3281 3481 2979 2581 2973	BADGE TOYOTA BOOT/TAILGATE LOCK BOOTLID/TAILGATE L/R BUMPER BRACKET L/R BUMPER CORNER L/R LAMP L/RR SIDE PANEL NO-PLATE LAMP COVER REAR BUMPER REAR LOCK CATCH REAR PANEL	90975 02064 69350 26122 67005 26G51 52158 26010 52166 26030A0 81561 26200 61612 26520 76811 26130 52159 26470 69430 95J00 57069 26120	Original	50.00 110.00 780.00 25.00 60.00 110.00 65.00 170.00 55.00
2411	REAR SCREEN BOND KIT	1 PZ491 00C1131		0.00

f: OEM Parts n: Non-OEM Parts u: Used parts Savings

0.00

1,415.40

Subtotal	2,170.00
Total	2,170.00

Extras

Code	Description	Price SGD
1000	SUNDRIES	30.00*
1001	NUMBER PLATE &HOLDER	35.00*
	Total Extras	65.00

Final Calculation

	SGD	SGD
Parts	2,170.00	
Total Parts	,	2,170.00
Labour Time Base 10 WU/h		
Total 337.0 WU X 42.00 SGD/h	1,415.40	
Total of Labour		1,415.40
Total Of Extras		65.00
Paint Work Time Base 10 WU/h		
Labour Cost 115.0 WU X 42.00 SGD/h	483.00	
Material Cost	201.06	
Total Paint Including Material		684.06
Repair Cost Excludes GST		4,334.46
GST (+7.0%)		303.41
Repair Cost Included GST		4,637.87
Deductions (Excludes GST)		
Repair Cost Discount (+20.00%)	-866.89	
Total Of Deductions (Excludes GST)		-866.89
Grand Total Excludes GST		3,467.57
GST (+7.0%)		242.73
Grand Total Included GST		3,710.30

Comments

* - USER SUPPLIED DATA

NN - NO MANUFACTURERS CODE EXISTS

) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

Author	Date	Text
LimMeiHong	12/11/2022 10:30 AM	RASUL