

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC6/AIG22009314/APA3Q2**Date:** 20/03/2023**REFERENCE**

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	7210127857
Claimant Vehicle No :	SKT9207B	Insured Vehicle No :	SMW5471R
Date of Loss:	15/09/2022	Nature of Claim:	TP
		Claim No:	0264513284SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SKT9207B		
Make & Model:	TOYOTA COROLLA ALTIS, 1.6 CLASSIC CVT (A)	Engine No:	1ZRX516355
Reg. Date:	26/06/2015 (Man. Year: 2015)	Chassis No:	MR053REH104534529
Colour:	Silver	Odometer:	186912 km
Engine Capacity:	1598 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/55 R16	Rear Tyre Size:	205/55 R16
Front Left Side:	KAPSEN 6 mm	Rear Left Side:	KAPSEN 6 mm
Front Right Side:	KAPSEN 6 mm	Rear Right Side:	KAPSEN 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	14,144.45	5,312.55	8,831.90	62.44
Miscellaneous Items	0.00	0.00	0.00	
Labour	5,930.00	2,600.00	3,330.00	56.16
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	20,074.45	7,912.55	12,161.90	60.58
Approved Total (Overridden) (S\$)		6,300.00		
Nett Amount (S\$)	20,074.45	6,300.00	13,774.45	68.62
+ Loss of Use (9.0 x S\$60.00/day) (S\$)		540.00		
+ Doc/Search Fee (S\$)		7.45		
Nett Liability (S\$)		6,847.45		
Global Sum Settlement (S\$)		6,800.00		

INSPECTION

Date of Assignment:	16/09/2022	
Date Inspected:	16/09/2022 Inspected At:	JL Perfect Autowork Pte Ltd (HQ) 8 Kaki Bukit Avenue 4, #08-09 Premier@Kaki Bukit Singapore 415875
Estimated Period of Repair:	8.0 days	

Adjuster: ADRIAN LING**Manager:** CHEW HSIAO TONG*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER	Deformed	515.10 FL	*515.10 FL
2	1		*REAR BUMPER REFLECTOR	N/S Cracked	150.20 FL	*75.10 FL
3	2		*REAR BUMPER SIDE RETAINER	Damaged	210.20 FL	*210.20 FL
4	1		*REAR BUMPER REINFORCEMENT	Dented	395.10 FL	*395.10 FL
5	2		*REAR BUMPER REINFORCEMENT BRACKET	Not Necessary	180.20 FL	*- FL
6	1		*BOOTLID	Dented	756.10 FL	*756.10 FL
7	1		*BOOTLID CENTER MOULDING	Cracked	237.10 FL	*237.10 FL
8	1		*BOOTLID DETECTOR	Not Necessary	385.00 FL	*- FL
9	1		*BOOTLID LOGO	Necessary	85.00 FL	*85.00 FL
10	1		*BOOTLID LAMP	N/S Cut	684.00 FL	*342.00 FL
11	1		*BOOTLID EMBLEM COROLLA	Necessary	70.00 FL	*70.00 FL
12	1		*BOOTLID EMBLEM ALTIS	Necessary	70.00 FL	*70.00 FL
13	2		*BOOT LID HINGE	Not Necessary	140.00 FL	*- FL
14	1		*BOOTLID TOP LOCK	Damaged	318.10 FL	*318.10 FL
15	1		*BOOTLID LOWER LOCK	Not Necessary	20.00 FL	*- FL
16	1		*BOOTLID WEATHERSTRIP	Cut	195.00 FL	*195.00 FL
17	1		*TAILLAMP	N/S Cut	930.00 FL	*391.00 FL
18	2		*TAILLAMP PANEL	Repair	396.00 FL	*- FL
19	2		*TAILLAMP LOWER BRACKET	Not Necessary	230.20 FL	*- FL
20	1		*REAR FENDER LH	Dented	987.00 FL	*987.00 FL
21	2		*REAR FENDER INNER COWLING	Not Necessary	700.40 FL	*- FL
22	2		*REAR FENDER INNER TRIM	Not Necessary	1,540.20 FL	*- FL
23	1		*REAR WINDSCREEN MOULDING	Necessary	163.00 FL	*163.00 FL
24	1		*REAR WHEEL RIM RH	Cut	738.75 FS	*480.00 FS
25	1		*REAR ABS SENSOR RH	Not Necessary	295.00 FL	*- FL
26	1		*REAR WHEEL HUP C/W BEARING RH	Not Necessary	810.00 FL	*- FL
27	1		*REAR SHOCK ABSORBER RH	Not Necessary	390.00 FL	*- FL
28	1		*REAR AXLE	Not Necessary	2,850.00 FL	*- FL
29	1		*REAR END PANEL	Dented	695.30 FL	*695.30 FL
30	1		*REAR END PANEL TOP GARNISH	Deformed	250.10 FL	*250.10 FL
31	1		*REAR FLOOR PANEL TOP BOARD	Not Necessary	271.10 FL	*- FL
32	1		*SET REVERSE SENSOR	Damaged	368.20 FL	*368.20 FL
33	1		*REAR NUMBER PLATE	Not Necessary	80.00 FS	*- FS
34	1		*SET REAR BUMPER CLIPS	Necessary	80.00 FS	*30.00 FS
35	1		*SET BOOT LID INSULATOR CLIP	Not Necessary	80.00 FS	*- FS
36	1		*SET TAILLAMP CLIPS	Necessary	60.00 FS	*10.00 FS
37	1		*TAILLAMP PANEL SEALANT LH	Not Necessary	60.00 FS	*- FS
38	1		*REAR FENDER SEALANT LH	Necessary	150.00 FS	*60.00 FS
39	1		*SET REAR FENDER COWLING CLIPS	Not Necessary	80.00 FS	*- FS
40	1		*SET REAR FENDER INNER TRIM CLIPS	Not Necessary	80.00 FS	*- FS
41	1		*REAR WINDSCREEN SEALANT	Necessary	80.00 FS	*40.00 FS
42	1		*REAR WINDSCREEN INNER SEAL	Necessary	60.00 FS	*30.00 FS
43	1		*SET REAR END PANEL TOP GARNISH CLIPS	Necessary	50.00 FS	*10.00 FS
44	1		*REAR END PANEL INSULATION SEAL	Necessary	150.00 FS	*60.00 FS
45	1		*REAR WHEEL TYRE LH	Not Necessary	480.00 FS	*- FS
46	1		*REVERSE CAMERA	Not Necessary	450.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$)	17,966.35	6,843.40
- List Item Discount on L Items 25.00/25.00% (\$)	3,821.90	1,530.85
Total Parts (\$)	14,144.45	5,312.55

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEATING REMOVAL AND REPLACING PARTS	New	2,000.00	1,200.00
2	TO SPRAY PAINT AFFECTED AREA	New	1,800.00	1,000.00
3	TUFF COAT	New	250.00	100.00
4	WIRING CHECK	New	180.00	30.00
5	REMOVE AND REFIX CUSHION SEAT /UPHOLSTERY AND ROOF LINING TO FACILITATE REPAIR	New	350.00	80.00
6	REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING	New	80.00	50.00
7	REMOVE AND REFIX REVERSE CAMERA AND DISTANCE SETTING	New	80.00	0.00
8	TRANFER BOOTLID MECHANISM	New	80.00	60.00
9	CONDUCT WATER LEAKAGE TEST	New	100.00	0.00
10	REMOVE AND REFIX FUEL TANK TO FACILITATE FLOOR PANEL REPLACEMENT	New	80.00	0.00
11	FOUR WHEEL ALIGNMENT	New	120.00	80.00
12	RESET ABS LIGHT	New	350.00	0.00
13	REMOVE AND REFIX REAR EXHAUST PIPE	New	180.00	0.00
14	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT /CONTROL UNITS ,RESET MEMORIES TO SPECIFICATION ETC	New	280.00	0.00
Gross Labour Cost (S\$)			5,930.00	2,600.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >