

LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 1

PRE-REPAIR INSPECTION REPORT CS3/ASM22004807/Vvce2 AXA INSURANCE PTE LTD Ref: 8 SHENTON WAY #24-01 AXA TOWER Date: 25/07/2022 SINGAPORE 068811 ATTN: LOH CYNTHIA Code: ASM 1. Policy Particulars :- (THIRD PARTY CLAIM) Insured Veh. SH 7589E GBL 2280H Veh. Inspected Policy No. VFX/P2419138 Coverage (\$) 0.00 Claim No. S2M041KP Excess (\$) 0.00 **LOH CYNTHIA Assign Date** 23/05/2022 Assign From **Vehicle Particulars & Condition** 2. TOYOTA DYNA Make & Model 2982 C.C HIDDEN 2021 Engine No. Year of Reg. JTFAT35Y30K216559 WHITE Chassis No. Colour Odometer 35121 KM Steering IN ORDER **IN ORDER** SPORTS RIM **Brakes** Modification GOOD General 3. **Conditions of Tyres** Size Make **Balance** R/H Front Tyre 195 R15C **FALKEN** 5 mm **FALKEN** L/H Front Tyre 195 R15C 5 mm 195 R15C **FALKEN** R/H Rear Tyre 5 mm **FALKEN** L/H Rear Tyre 195 R15C 5 mm 4. **Description of Damages** THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. 5. **General Information** 18/05/2022 23/05/2022 (01:00 PM) Inspect Date / Time Accident Date **CARSMITH PTE LTD** Survey held at BARTLEY BIZ CENTRE, 13 KAKI BUKIT ROAD 4 #01-20 SINGAPORE 417807 5a. Remarks A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION. THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE. C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS. D) THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$6,000-\$7,000

Report Ref No. CS3/ASM22004807/Vvce2

Estimate Days of Repair

Inspected By

5b.

THEVAN THOMAS KARTHIKESAVAN

Asst. Automotive Assessor

ESTIMATED NORMAL PERIOD FOR REPAIR:

L

K.K.LAU CPT(RET)

 $BEng(Hons), B. Bus, MBA, PEng, PE, \, MInstAEA, MASME, MIRTE$

REGD Auto Consultant-SAE, Licensed Appraiser

6 Working Days