

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way, #09-16
Singapore 079120

Our File No: CC3/AIG22009477/EQCM4**Date:** 27/01/2023**REFERENCE**

Insured/Claimant:	RAJIV BHANDARI	Policy No:	2070153937	
Date of Loss:	22/09/2022	Nature of Claim:	OD	Claim No: 0689038432SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SJN7516R		
Make & Model:	AUDI A4, 2.0 TFSI S-TRONIC (A)	Engine No:	DEM025385
Reg. Date:	30/10/2020 (Man. Year: 2020)	Chassis No:	WAUZZZF47MN001180
Colour:	Blue	Odometer:	21180 km
Engine Capacity:	1984 cc		
Market Value/New Car Price:	S\$164,000.00		
Sum Insured (\$\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	225/50 R17	Rear Tyre Size:	225/50 R17
Front Left Side:	Hankook 5 mm	Rear Left Side:	Hankook 5 mm
Front Right Side:	Hankook 5 mm	Rear Right Side:	Hankook 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	49,491.00	19,687.76	29,803.24	60.22
Miscellaneous Items	0.00	0.00	0.00	
Labour	16,104.00	8,364.00	7,740.00	48.06
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	65,595.00	28,051.76	37,543.24	57.23
- Excess (\$\$)	550.00	550.00	0.00	0.00
(\$\$)	65,045.00	27,501.76	37,543.24	57.72
+ GST 8.00/8.00% (\$\$)	5,203.60	2,200.14	3,003.46	57.72
Nett Amount (\$\$)	70,248.60	29,701.90	40,546.70	57.72

INSPECTION

Date of Assignment:	26/09/2022	
Date Inspected:	26/09/2022 Inspected At:	24 BENOI SECTOR SINGAPORE 629857 REPAIRER: PREMIUM AUTOMOBILES PTE LTD
Estimated Period of Repair:	10.0 days	

Adjuster: CHEN TSUE YEE**Manager:** SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Crushed	2,377.00 FS	*1,901.60 FS
2	1		*FRONT BUMPER FIXING PARTS	Not Necessary	393.00 FS	*- FS
3	2		*FRONT BUMPER SECURING STRIP	Not Necessary	79.00 FS	*- FS
4	1		*FRONT BUMPER GRILLE - CENTER	Broken	219.00 FS	*174.80 FS
5	1		*FRONT BUMPER CLOSING ELEMENT - LOWER CENTRE	Broken	293.00 FS	*234.00 FS
6	2		*FRONT BUMPER AIR GUIDE - LH / RH	Not Necessary	102.00 FS	*- FS
7	1		*FRONT BUMPER CLOSING ELEMENT - UPPER CENTRE	Broken	293.00 FS	*234.00 FS
8	2		*FRONT BUMPER AIR GUIDE GRILLE - LH / RH	Missing	302.00 FS	*240.80 FS
9	2		*FRONT BUMPER TRIM - LH / RH	Not Necessary	108.00 FS	*- FS
10	1		*RADIATOR GRILLE	Broken	1,754.00 FS	*1,403.20 FS
11	1		*FRONT BUMPER FOAM FILLER PIECE	Broken	212.00 FS	*169.20 FS
12	1		*FRONT BUMPER REINFORCEMENT BEAM	Dented	899.00 FS	*719.20 FS
13	1		*FRONT BUMPER GUIDE SECTION - LH / RH 2PIECE	Crushed (1 Piece Only)	82.00 FS	*32.24 FS
14	2		*FRONT BUMPER BRACKET - LH / RH	Bent	508.00 FS	*406.40 FS
15	1		*FRONT BUMPER TOP COVER	Crushed	143.00 FS	*114.00 FS
16	1		*CAUTION SIGN STICKER	Necessary	16.00 FS	*12.40 FS
17	1		*AIR CONDITIONER STICKER	Necessary	9.00 FS	*6.64 FS
18	1		*FRONT BUMPER BRACKET	Broken	154.00 FS	*122.80 FS
19	2		*FRONT BUMPER SUPPORT - LH / RH	Necessary	64.00 FS	*51.04 FS
20	4		*FRONT PARKING AID SENSOR - INNER / OUTER	Not Necessary	1,062.00 FS	*- FS
21	4		*FRONT PARKING AID SEAL RING	Not Necessary	10.00 FS	*- FS
22	1		*SET FRONT BUMPER WIRING	Not Necessary	642.00 FS	*- FS
23	1		*HORN HIGH TONE - LH	Not Necessary	134.00 FS	*- FS
24	1		*HORN LOW TORN - RH	Not Necessary	139.00 FS	*- FS
25	2		*HORN BRACKET - LH / RH	Not Necessary	66.00 FS	*- FS
26	1		*FRONT FENDER - LH / RH	N/s Dented	2,454.00 FS	*981.60 FS
27	1		*FRONT FENDER ATTACHMENT PARTS	Not Necessary	225.00 FS	*- FS
28	1		*FRONT FENDER CLOSING ELEMENTT - LH / RH	N/s Necessary	162.00 FS	*64.24 FS
29	1		*FRONT FENDER BRACKET - LH / RH	N/s Bent	82.00 FS	*32.72 FS
30	2		*FRONT FENDER DEFORMATION ELEMENT BRACKET - LH / RH	Not Necessary	110.00 FS	*- FS
31	1		*FRONT FENDER RIVET 13PIECES	Necessary	50.00 FS	*39.52 FS
32	2		*FRONT FENDER BRACE - LH / RH	Not Necessary	264.00 FS	*- FS
33	2		*FRONT WHEEL HOUSING LINER - LH / RH	Not Necessary	518.00 FS	*- FS
34	1		*FRONT WHEEL HOUSING LINER ATTACHMENT PARTS	Not Necessary	149.00 FS	*- FS
35	2		*FRONT WHEEL SPOILER - LH / RH	Not Necessary	164.00 FS	*- FS
36	2		*FRONT SPOILER - LH / RH	Not Necessary	79.00 FS	*- FS
37	1		*FRONT FENDER LEDGE COVER - LH / RH LONG	N/s Necessary	70.00 FS	*27.52 FS
38	1		*HEADLIGHT COVER - LH / RH	N/s Necessary	98.00 FS	*38.64 FS
39	1		*BONNET	Dented	3,425.00 FS	*2,740.00 FS
40	1		*BONNET ATTACHMENT PARTS	Not Necessary	431.00 FS	*- FS
41	2		*BONNET HINGE - LH / RH	Not Necessary	680.00 FS	*- FS
42	3		*BONNET IMPACT PROTECTION - CENTER / LH / RH	Necessary	93.00 FS	*73.20 FS
43	2		*BONNET STRIKER - LH / RH	Bent	112.00 FS	*89.12 FS
44	2		*BONNET LOCK	Bent	455.00 FS	*364.00 FS
45	1		*BONNET BOWDEN CABLE	Bent	64.00 FS	*50.56 FS
46	1		*BONNET RELEASE LEVER	Not Necessary	15.00 FS	*- FS
47	1		*BONNET BOWDEN CABLE - CENTER	Not Necessary	64.00 FS	*- FS
48	1		*BONNET BOWDEN CABLE COVER	Not Necessary	11.00 FS	*- FS
49	1		*BONNET LOCK CABEL - RH	Not Necessary	82.00 FS	*- FS
50	1		*PLENUM CHAMBER COVER	Not Necessary	108.00 FS	*- FS
51	1		*ENGINE SOUND ABSORBER	Crushed	382.00 FS	*305.60 FS
52	1		*HEADLIGHT - LH / RH	N/s Broken	16,344.00 FS	*6,537.60 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
53	2		*HEADLIGHT HOSE	Not Necessary	83.00 FS	*- FS
54	2		*HEADLIGHT COMPENSATING PIECE	Not Necessary	89.00 FS	*- FS
55	2		*HEADLIGHT COMPENSATING PIECE	Not Necessary	93.00 FS	*- FS
56	2		*HEADLIGHT COMPENSATING PIECE	Not Necessary	89.00 FS	*- FS
57	2		*LIFT CYLINDER - LH / RH	Not Necessary	462.00 FS	*- FS
58	2		*LIFT CYLINDER BRACKET	Not Necessary	14.00 FS	*- FS
59	1		*LIFT CYLINDER CORRUGATED PIPE	Not Necessary	107.00 FS	*- FS
60	1		*LOCK CARRIER	Broken	1,478.00 FS	*901.60 FS
61	2		*LOCK CARRIER SUPPORT - LH / RH	Not Necessary	85.00 FS	*- FS
62	1		*CHARGE AIR COOLER	Bent	654.00 FS	*522.80 FS
63	1		*CHARGE AIR COOLER PRESSURE HOSE - RH	Not Necessary	413.00 FS	*- FS
64	1		*CHARGE AIR COOLER PRESSURE PIPE - LH	Not Necessary	496.00 FS	*- FS
65	1		*A/C CONDENSER	Bent	683.00 FS	*546.00 FS
66	1		*A/C CONDENSER REFRIGERANT LINE	Not Necessary	186.00 FS	*- FS
67	1		*A/C CONDENSER REFRIGERANT LINE	Not Necessary	381.00 FS	*- FS
68	1		*OUTSIDE TEMPERATURE SENSOR BRACKET	Broken	21.00 FS	*16.32 FS
69	1		*RADIATOR	Not Necessary	1,013.00 FS	*- FS
70	1		*RADIATOR FAN RING	Not Necessary	292.00 FS	*- FS
71	1		*RADIATOR FAN CONTROL UNIT	Not Necessary	2,489.00 FS	*- FS
72	6		*READY-MIX COOLANT	Necessary	297.00 FS	*237.12 FS
73	2		*RADIATOR AIR GUIDE - LH / RH INNER	Broken	102.00 FS	*80.16 FS
74	2		*RADIATOR AIR GUIDE - LH / RH OUTER	Broken	38.00 FS	*29.28 FS
75	2		*RADIATOR AIR GUIDE - UPPER / LOWER	Not Necessary	44.00 FS	*- FS
76	1		*INTAKE AIR DUCT - RH	Not Necessary	25.00 FS	*- FS
77	1		*INTAKE AIR GUIDE	Not Necessary	61.00 FS	*- FS
78	1		*INTAKE AIR DUCT HOSE	Not Necessary	110.00 FS	*- FS
79	1		*AIR FILTER	Not Necessary	418.00 FS	*- FS
80	1		*AIR MASS METER	Not Necessary	629.00 FS	*- FS
81	1		*FRONT NOISE INSULATION	Not Necessary	640.00 FS	*- FS
82	2		*FRONT WINDOW SLOT SEAL TRIM STRIP - LH / RH	Not Necessary	688.00 FS	*- FS
83	1		*FRONT NO PLATE	Necessary	60.00 FS	*60.00 FS
84	1		*SUNDRIES	Necessary	500.00 FS	*127.84 FS

F=Franchise part. S=SpcNett.

Total Parts (\$\$) 49,491.00 19,687.76

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE, CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR, HEADLIGHT WASHER ASSY AND FRONT PARKING AID	New	480.00	480.00
2	TO REMOVE AND TRANSFER BOTH HEADLIGHTS CONTROL UNIT AND POWER MODULE	New	700.00	250.00
3	TO REMOVE AND RENEW AIRCON CONDENSER, CHARGE AIR COOLER AND RADIATOR. CHECK ELECTRICAL FANS AND CONTROL UNIT. PRESSURISE COOLING SYSTEM	New	1,400.00	1,400.00
4	TO CARRY OUT VACUUM AND REGAS FOR R1234	New	1,200.00	1,200.00
5	TO REMOVE AND REINSTALL BOTH FRONT DOOR PANEL TRIM. TO REMOVE AND REINSTALL BOTH WING MIRROR ASSY TO FACILITATE RESPRAY OF BOTH FRONT DOOR	New	560.00	0.00
6	TO DISMANTLE AND RENEW FRONT BUMPER, BONNET, BOTH FRONT FENDER AND BOTH HEADLIGHT. TO RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION, RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	New	5,600.00	3,000.00
7	TO RESPRAY FRONT BUMPER, BOTH FRONT FENDERS, BONNET, HINGES AND BOTH FRONT DOORS	New	5,500.00	1,650.00
8	TO TOW BACK THE VEHICLE FROM ACCIDENT SCENE	New	280.00	0.00
9	TO CARRY OUT PRE/POST DIAGNOSTIC CHECK	New	384.00	384.00
Gross Labour Cost (S\$)			16,104.00	8,364.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >