

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC4/AIS22009509/UPA3Q2**Date:** 29/12/2022**REFERENCE**

Handling Insurer: Allianz Insurance Singapore Pte. Ltd. Policy No: SP2002159546-01
Claimant Vehicle No : SMC9669S **Insured Vehicle No :** SNE818R
 Date of Loss: 23/09/2022 Nature of Claim: TP Claim No: 202222007006SL

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SMC9669S**
 Make & Model: MERCEDES-BENZ C180, 1.5 SEDAN AVG (R17 LED) (A) Engine No: 27491031657145
 Reg. Date: 09/04/2019 (Man. Year: 2018) Chassis No: WDD2050402R476623
 Colour: Grey Odometer: 64632 km
 Engine Capacity: 1595 cc
 Market Value/New Car Price: N/A
 Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
 Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition: Yes

CONDITION OF TYRES

Front Tyre Size: 225/45Z R18 Rear Tyre Size: 225/45Z R18
 Front Left Side: Falken 6 mm Rear Left Side: Falken 6 mm
 Front Right Side: Falken 6 mm Rear Right Side: Falken 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	14,893.38	8,751.24	6,142.14	41.24
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,660.00	1,270.00	2,390.00	65.30
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	18,553.38	10,021.24	8,532.14	45.99
+ Loss of Use (5.0 x S\$60.00/day) (S\$)		300.00		
+ Doc/Search Fee (S\$)		7.45		
Nett Liability (S\$)		10,328.69		
Global Sum Settlement (S\$)		10,300.00		

INSPECTION

Date of Assignment: 27/09/2022
 Date Inspected: 27/09/2022 Inspected At: Jementah Motor Works (HQ)
 14 Defu Lane 10, #01-406
 Singapore 539195
 Estimated Period of Repair: 4.0 days

Adjuster: MARCUS CHUA**Manager:** CHEW HSIAO TONG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 28 Dec 2022)
Parts:	143	MERCEDES-BENZ C180 1.5 SEDAN AVG (R17 LED) (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SMC9669S)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BONNET	Repair	2,883.00 FL	*- FL
2	1		*FRONT BONNET LOGO	Not Necessary	68.00 FL	*- FL
3	1		*FRONT HEADLAMP -RH	Broken	3,617.00 FL	*3,617.00 FL
4	1		*FRONT GRILLE	Serviceable	485.00 FL	*- FL
5	1		*FRONT GRILLE CHROME MOULDING	Not Necessary	282.00 FL	*- FL
6	1		*FRONT BUMPER	Distorted	1,887.00 FL	*1,789.00 FL
7	1		*SET FRONT BUMPER CLIP	Necessary	85.00 FL	*60.00 FL
8	1		*FRONT BUMPER SIDE GRILLE	Not Necessary	142.00 FL	*- FL
9	1		*FRONT BUMPER INNER SPONGE	Torn	155.00 FL	*155.00 FL
10	1		*FRONT BUMPER REINFORCEMENT	Repair	522.00 FL	*- FL
11	1		*FRONT BUMPER SIDE RETAINER O/S	Cracked	75.50 FL	*75.50 FL
12	1		*FRONT BUMPER TOP RUBBER SEAL	Not Necessary	115.00 FL	*- FL
13	1		*FRONT BUMPER PDC SENSORS	O/S Shorted	1,074.00 FL	*305.00 FL
14	1		*FRONT FENDER -RH	Repair	1,085.00 FL	*- FL
15	1		*FRONT FENDER INNER SHIELD	Not Necessary	185.00 FL	*- FL
16	1		*FRONT HEADLAMP -LH	Cracked	3,617.00 FL	*3,617.00 FL
17	1		*FRONT BUMPER SIDE INNER GARNISH HOLDER	Cracked	270.70 FL	*105.10 FL

F=Franchise part. L=ListItemDisc.

Sub Total (\$\$)	16,548.20	9,723.60
- List Item Discount on L Items 10.00/10.00% (\$\$)	1,654.82	972.36
Total Parts (\$\$)	14,893.38	8,751.24

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO CHECK WIRING AND RESET HEADLAMPS FOCUSING	New	80.00	20.00
2	TO REMOVE AND REPLACED PDC SENSOR	New	150.00	50.00
3	TO CONDUCT WHEEL ALIGNMENT	New	180.00	0.00
4	TO APPLY UNDERCOATING	New	150.00	0.00
5	PANEL BEATING	New	1,600.00	600.00
6	TO RE-SPRAY PAINTING ON THE AFFECTED AREAS	New	1,500.00	600.00
Gross Labour Cost (S\$)			3,660.00	1,270.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >